

# ***DENSO ROBOT***

Horizontal articulated

**H\*-E SERIES**

**GENERAL INFORMATION ABOUT ROBOT**

Copyright © DENSO WAVE INCORPORATED, 2003

All rights reserved. No part of this publication may be reproduced in any form or by any means without permission in writing from the publisher.

Specifications are subject to change without prior notice.

All products and company names mentioned are trademarks or registered trademarks of their respective holders.

# Preface

Thank you for purchasing this high-speed, high-accuracy assembly robot.

Before operating your robot, read this manual carefully to safely get the maximum benefit from your robot in your assembling operations.

## Robot series and/or models covered by this manual

Series	Model (Note 1)		Overall arm length
	Floor-mount	Overhead-mount	
HS-E (Small-sized, horizontal articulated)	HS-4535*E HS-4545*E HS-4555*E	— HSS-4545*E HSS-4555*E	350 mm 450 mm 550 mm
HM-E (Medium-sized, horizontal articulated)	HM-4*60*E2 HM-4*70*E2 HM-4*85*E2 HM-4*A0*E2  (Note 2)	— HMS-4*70*E2 HMS-4*85*E2 —  (Note 2)	600mm 700mm 850mm 1000mm

**NOTE 1:** Model names listed above apply to the models of robot systems. The model names of robot units are followed by M. If the robot system model is HS-4535\*E, for example, the robot unit model is HS-4535\*EM.

**NOTE 2:** The second arm of the HM-E series robot was modified, and also, the model name of the robot was changed to the HM-E2 series from the HM-E series at August 2003.

Robot model —



## Important

To ensure operator safety, be sure to read the precautions and instructions in "SAFETY PRECAUTIONS."

---

Instructions on how to use the Manual Pack CD are given in Appendix.

---

# How the documentation set is organized

The documentation set consists of the following books. If you are unfamiliar with this robot and option(s), please read all books and understand them fully before operating your robot and option(s).

## **GENERAL INFORMATION ABOUT ROBOT - this book -**

Provides the packing list of the robot and outlines of the robot system, robot unit, and robot controller.

## **INSTALLATION & MAINTENANCE GUIDE**

Provides instructions for installing the robot components and customizing your robot, and maintenance & inspection procedures.

## **BEGINNER'S GUIDE**

Introduces you to the DENSO robot. Taking an equipment setup example, this book guides you through running your robot with the teach pendant, making a program in WINCAPSII, and running your robot automatically.

## **SETTING-UP MANUAL**

Describes how to set-up or teach your robot with the teach pendant, operating panel, or mini-pendant.

## **WINCAPSII GUIDE**

Provides instructions on how to use the teaching system WINCAPSII which runs on the PC connected to the robot controller for developing and managing programs.

## **PROGRAMMER'S MANUAL (I), (II)**

Describes the PAC programming language, program development, and command specifications in PAC.

## **RC5 CONTROLLER INTERFACE MANUAL**

Describes the RC5 controller, interfacing with external devices, system- and user-input/output signals, and I/O circuits.

## **ERROR CODE TABLES**

List error codes that will appear on the teach pendant, operating panel, or PC screen if an error occurs in the robot series or WINCAPSII. These tables provide detailed description and recovery ways.

## **OPTIONS MANUAL**

Describes the specifications, installation, and use of optional devices.

# How this book is organized

This book is just one part of the robot documentation set. This book consists of SAFETY PRECAUTIONS, chapters one through five, and appendix.

## **SAFETY PRECAUTIONS**

Defines safety terms and related symbols and provides precautions that should be observed. Be sure to read this section before operating your robot.

## **Chapter 1 Packing List of the Robot**

Lists the standard components contained in the product package and optional components.

## **Chapter 2 Configuration of the Robot System**

Illustrates the configuration of the robot system and describes the component names of the robot unit and controller.

## **Chapter 3 Specifications of the Robot Unit**

Describes the specifications, motion space, robot positioning time, air piping and signal wiring, and engineering-design notes for robot hands.

## **Chapter 4 Specifications of the Robot Controller**

Lists the specifications of the robot controller and controller setting table (SETPRM LIST).

## **Chapter 5 Warranty**

Describes the warranty period and coverage.

## **Appendix How to Use the Manual Pack CD**



# SAFETY PRECAUTIONS

Be sure to observe all of the following safety precautions.

Strict observance of these warning and caution indications are a **MUST** for preventing accidents, which could result in bodily injury and substantial property damage. Make sure you fully understand all definitions of these terms and related symbols given below, before you proceed to the text itself.

 <b>WARNING</b>	Alerts you to those conditions, which could result in serious bodily injury or death if the instructions are not followed correctly.
 <b>CAUTION</b>	Alerts you to those conditions, which could result in minor bodily injury or substantial property damage if the instructions are not followed correctly.

## Terminology and Definitions

**Maximum space:** Refers to the volume of space encompassing the maximum designed movements of all robot parts including the end-effector, workpiece and attachments. (Quoted from the RIA\* Committee Draft.)

**Restricted space:** Refers to the portion of the maximum space to which a robot is restricted by limiting devices (i.e., mechanical stops). The maximum distance that the robot, end-effector, and workpiece can travel after the limiting device is actuated defines the boundaries of the restricted space of the robot. (Quoted from the RIA Committee Draft.)

**Motion space:** Refers to the portion of the restricted space to which a robot is restricted by software motion limits. The maximum distance that the robot, end-effector, and workpiece can travel after the software motion limits are set defines the boundaries of the motion space of the robot. (The "motion space" is DENSO WAVE-proprietary terminology.)

**Operating space:** Refers to the portion of the restricted space (or motion space in Denso robot) that is actually used by the robot while performing its task program. (Quoted from the RIA Committee Draft.)

**Task program:** Refers to a set of instructions for motion and auxiliary functions that define the specific intended task of the robot system. (Quoted from the RIA Committee Draft.)

(\*RIA: Robotic Industries Association)

---

## 1. Introduction

This section provides safety precautions to be observed during installation, teaching, inspection, adjustment, and maintenance of the robot.

## 2. Installation Precautions

### 2.1 Insuring the proper installation environment

#### 2.1.1 For standard type

The standard type has not been designed to withstand explosions, dust-proof, nor is it splash-proof. Therefore, it should not be installed in any environment where:

- (1) there are flammable gases or liquids,
- (2) there are any shavings from metal processing or other conductive material flying about,
- (3) there are any acidic, alkaline or other corrosive gases,
- (4) there is cutting or grinding oil mist,
- (5) it may likely be submerged in fluid,
- (6) there is sulfuric cutting or grinding oil mist, or
- (7) there are any large-sized inverters, high output/high frequency transmitters, large contactors, welders, or other sources of electrical noise.

#### 2.1.2 For dust-proof, splash-proof type

The dust-proof, splash-proof type is an IP54-equivalent structure, but it has not been designed to withstand explosions. (The HM/HS-E-W and the wrist of the VM-D-W/VS-E-W are an IP65-equivalent dust-proof and splash-proof structure.)

Note that the robot controller is not a dust- or splash-proof structure. Therefore, when using the robot controller in an environment exposed to mist, put it in an optional protective box.

The dust-proof, splash-proof type should not be installed in any environment where:

- (1) there are any flammable gases or liquids,
- (2) there are any acidic, alkaline or other corrosive gases,
- (3) there are any large-sized inverters, high output/high frequency transmitters, large contactors, welders, or other sources of electrical noise,
- (4) it may likely be submerged in fluid,
- (5) there are any grinding or machining chips or shavings,
- (6) any machining oil not specified in this manual is in use, or  
Note: Yushiron Oil No. 4C (non-soluble) is specified.
- (7) there is sulfuric cutting or grinding oil mist.

### 2.2 Service space


The robot and peripheral equipment should be installed so that sufficient service space is maintained for safe teaching, maintenance, and inspection.

## SAFETY PRECAUTIONS

---

- 2.3 Control devices outside the robot's restricted space** The robot controller, teach pendant, and operating panel should be installed outside the robot's restricted space and in a place where you can observe all of the robot's movements when operating the robot controller, teach pendant, or operating panel.
- 2.4 Positioning of gauges** Pressure gauges, oil pressure gauges and other gauges should be installed in an easy-to-check location.
- 2.5 Protection of electrical wiring and hydraulic/pneumatic piping** If there is any possibility of the electrical wiring or hydraulic/pneumatic piping being damaged, protect them with a cover or similar item.
- 2.6 Positioning of emergency stop switches** Emergency stop switches should be provided in a position where they can be reached easily should it be necessary to stop the robot immediately.
- (1) The emergency stop switches should be red.
  - (2) Emergency stop switches should be designed so that they will not be released after pressed, automatically or mistakenly by any other person.
  - (3) Emergency stop switches should be separate from the power switch.
- 2.7 Positioning of operating status indicators** Operating status indicators should be positioned in such a way where workers can easily see whether the robot is on temporary halt or on an emergency or abnormal stop.

## 2.8 Setting-up the safety fence or enclosure

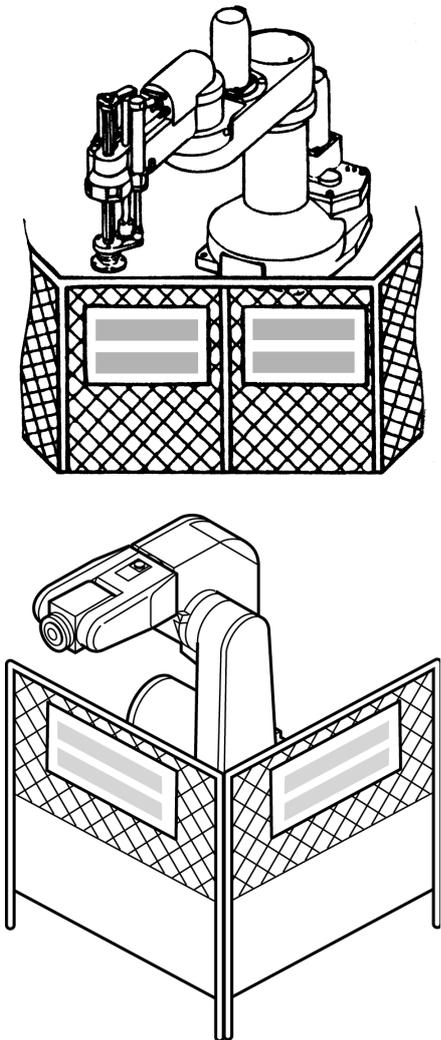

A safety fence or enclosure should be set up so that no one can easily enter the robot's restricted space. If it is impossible, utilize other protectors as described in Section 2.9.

- (1) The fence or enclosure should be constructed so that it cannot be easily moved or removed.
- (2) The fence or enclosure should be constructed so that it cannot be easily damaged or deformed through external force.
- (3) Establish the exit/entrance to the fence or enclosure. Construct the fence or enclosure so that no one can easily get past it by climbing over the fence or enclosure.
- (4) The fence or enclosure should be constructed to ensure that it is not possible for hands or any other parts of the body to get through it.
- (5) Take any one of the following protections for the entrance/exit of the fence or enclosure:
  - 1) Place a door, rope or chain across the entrance/exit of the fence or enclosure, and fit it with an interlock that ensures the emergency stop device operates automatically if it is opened or removed.
  - 2) Post a warning notice at the entrance/exit of the fence or enclosure stating "In operation--Entry forbidden" or "Work in progress--Do not operate" and ensure that workers follow these instructions at all times.

When making a test run, before setting up the fence or enclosure, place an overseer in a position outside the robot's restricted space and one in which he/she can see all of the robot's movements. The overseer should prevent workers from entering the robot's restricted space and be devoted solely to that task.

## 2.9 Positioning of rope or chain

If it is not possible to set up the safety fence or enclosure described in Section 2.8, hang a rope or chain around the perimeter of the robot's restricted space to ensure that no one can enter the restricted space.

- (1) Ensure the support posts cannot be moved easily.
- (2) Ensure that the rope or chain's color or material can easily be discerned from the surrounds.
- (3) Post a warning notice in a position where it is easy to see stating "In operation--Entry forbidden" or "Work in progress --Do not operate" and ensure that workers follow these instructions at all times.
- (4) Set the exit/entrance, and follow the instructions given in Section 2.8, (3) through (5).

# SAFETY PRECAUTIONS

## 2.10 Setting the robot's motion space

The area required for the robot to work is called the robot's operating space.

If the robot's motion space is greater than the operating space, it is recommended that you set a smaller motion space to prevent the robot from interfering or disrupting other equipment.

Refer to the "INSTALLATION & MAINTENANCE GUIDE."

## 2.11 No robot modification allowed

Never modify the robot unit, robot controller, teach pendant or other devices.

## 2.12 Cleaning of tools

If your robot uses welding guns, paint spray nozzles, or other end-effectors requiring cleaning, it is recommended that the cleaning process be carried out automatically.

## 2.13 Lighting



Sufficient illumination should be assured for safe robot operation.

## 2.14 Protection from objects thrown by the end-effector

If there is any risk of workers being injured in the event that the object being held by the end-effector is dropped or thrown by the end-effector, consider the size, weight, temperature and chemical nature of the object and take appropriate safeguards to ensure safety.

## 2.15 Affixing the warning label

Place the warning label packaged with the robot on the exit/entrance of the safety fence or in a position where it is easy to see.

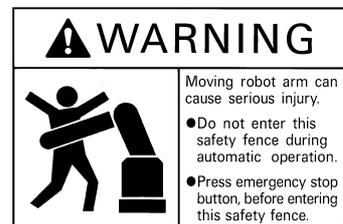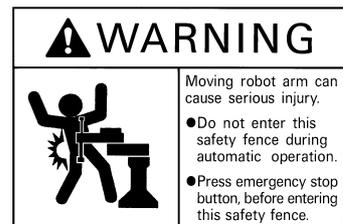

### 3. Precautions while robot is running



Touching the robot while it is in operation can lead to serious injury. Please ensure the following conditions are maintained and that the cautions listed from Section 3.1 onwards are followed when any work is being performed.

<b>⚠ WARNING</b>	
	Moving robot arm can cause serious injury. ● Do not enter this safety fence during automatic operation. ● Press emergency stop button, before entering this safety fence.
<b>⚠ WARNING</b>	
	Moving robot arm can cause serious injury. ● Do not enter this safety fence during automatic operation. ● Press emergency stop button, before entering this safety fence.

- 1) Do not enter the robot's restricted space when the robot is in operation or when the motor power is on.
- 2) As a precaution against malfunction, ensure that an emergency stop device is activated to cut the power to the robot motor upon entry into the robot's restricted space.
- 3) When it is necessary to enter the robot's restricted space to perform teaching or maintenance work while the robot is running, ensure that the steps described in Section 3.3 "Ensuring safety of workers performing jobs within the robot's restricted space" are taken.

#### 3.1 Creation of working regulations and assuring worker adherence

When entering the robot's restricted space to perform teaching or maintenance inspections, set "working regulations" for the following items and ensure workers adhere to them.

- (1) Operating procedures required to run the robot.
- (2) Robot speed when performing teaching.
- (3) Signaling methods to be used when more than one worker is to perform work.
- (4) Steps that must be taken by the worker in the event of a malfunction, according to the contents of the malfunction.
- (5) The necessary steps for checking release and safety of the malfunction status, in order to restart the robot after robot movement has been stopped due to activation of the emergency stop device
- (6) Apart from the above, any steps below necessary to prevent danger from unexpected robot movement or malfunction of the robot.
  - 1) Display of the control panel (See Section 3.2 on the following page)
  - 2) Assuring the safety of workers performing jobs within the robot's restricted space (See Section 3.3 on the following page)

3) Maintaining worker position and stance

Position and stance that enables the worker to confirm normal robot operation and to take immediate refuge if a malfunction occurs.

4) Implementation of measures for noise prevention

5) Signaling methods for workers of related equipment

6) Types of malfunctions and how to distinguish them

Please ensure "working regulations" are appropriate to the robot type, the place of installation and to the content of the work.

Be sure to consult the opinions of related workers, engineers at the equipment manufacturer and that of a labor safety consultant when creating these "working regulations".

### **3.2 Display of operation panel**

To prevent anyone other than the worker from accessing the start switch or the changeover switch by accident during operation, display something to indicate it is in operation on the operating panel or teach pendant. Take any other steps as appropriate, such as locking the cover.

### **3.3 Ensuring safety of workers performing jobs within the robot's restricted space**

When performing jobs within the robot's restricted space, take any of the following steps to ensure that robot operation can be stopped immediately upon a malfunction.

- (1) Ensure an overseer is placed in a position outside the robot's restricted space and one in which he/she can see all robot movements, and that he/she is devoted solely to that task.
  - ① An emergency stop device should be activated immediately upon a malfunction.
  - ② Do not permit anyone other than the worker engaged for that job to enter the robot's restricted space.
- (2) Ensure a worker within the robot's restricted space carries the portable emergency stop switch so he/she can press it (the robot stop button on the teach pendant) immediately if it should be necessary to do so.

---

### **3.4 Inspections before commencing work such as teaching**

Before starting work such as teaching, inspect the following items, carry out any repairs immediately upon detection of a malfunction and perform any other necessary measures.

- (1) Check for any damage to the sheath or cover of the external wiring or to the external devices.
- (2) Check that the robot is functioning normally or not (any unusual noise or vibration during operation).
- (3) Check the functioning of the emergency stop device.
- (4) Check there is no leakage of air or oil from any pipes.
- (5) Check there are no obstructive objects in or near the robot's restricted space.

### **3.5 Release of residual air pressure**

Before disassembling or replacing pneumatic parts, first release any residual air pressure in the drive cylinder.

### **3.6 Precautions for test runs**

Whenever possible, have the worker stay outside of the robot's restricted space when performing test runs.

### **3.7 Precautions for automatic operation**

#### (1) At start-up

Before the robot is to be started up, first check the following items as well as setting the signals to be used and perform signaling practice with all related workers.

- 1) Check that there is no one inside the robot's restricted space.
  - 2) Check that the teach pendant and tools are in their designated places.
  - 3) Check that no lamps indicating a malfunction on the robot or related equipment are lit.
- (2) Check that the display lamp indicating automatic operation is lit during automatic operation.

#### (3) Steps to be taken when a malfunction occurs

Should a malfunction occur with the robot or related equipment and it is necessary to enter the robot's restricted space to perform emergency maintenance, stop the robot's operation by activating the emergency stop device. Take any necessary steps such as placing a display on the starter switch to indicate work is in progress to prevent anyone from accessing the robot.

### 3.8 Precautions in repairs

- (1) Do not perform repairs outside of the designated range.
- (2) Under no circumstances should the interlock mechanism be removed.
- (3) When opening the robot controller's cover for battery replacement or any other reasons, always turn the robot controller power off and disconnect the power cable.
- (4) Use only spare tools specified in this manual.

### 4. Daily and periodical inspections

- (1) Be sure to perform daily and periodical inspections. Before starting jobs, always check that there is no problem with the robot and related equipment. If any problems are found, take any necessary measures to correct them.
- (2) When carrying out periodical inspections or any repairs, maintain records and keep them for at least 3 years.

### 5. Management of floppy disks

- (1) Carefully handle and store the "Initial settings" floppy disks packaged with the robot, which store special data exclusively prepared for your robot.
- (2) After finishing teaching or making any changes, always save the programs and data onto floppy disks.  

Making back-ups will help you recover if data stored in the robot controller is lost due to the expired life of the back-up battery.
- (3) Write the names of each of the floppy disks used for storing task programs to prevent incorrect disks from loading into the robot controller.
- (4) Store the floppy disks where they will not be exposed to dust, humidity and magnetic field, which could corrupt the disks or data stored on them.



# Contents

<b>Preface .....</b>	<b>i</b>
<b>How the documentation set is organized .....</b>	<b>ii</b>
<b>How this book is organized .....</b>	<b>iii</b>
<b>SAFETY PRECAUTIONS</b>	
<b>Chapter 1 Packing List of the Robot.....</b>	<b>1</b>
1.1 Standard Components .....	1
1.2 Optional Components .....	2
<b>Chapter 2 Configuration of the Robot System .....</b>	<b>4</b>
2.1 Configurators .....	4
2.2 Names of Axes (Joints) of the Robot Unit .....	5
2.3 Names of the Robot Controller Components .....	7
<b>Chapter 3 Specifications of the Robot Unit .....</b>	<b>9</b>
3.1 HS/HSS-E series .....	9
3.1.1 Specifications (HS/HSS-E) .....	9
3.1.2 Outer Dimensions and Workable Space of the Robot Unit (HS/HSS-E) .....	11
3.1.3 Robot Positioning Time (HS/HSS-E) .....	17
3.1.4 Notes for setting the positioning speed (HS/HSS-E) .....	27
3.1.5 Air piping and signal wiring (HS/HSS-E) .....	29
3.1.6 Engineering-design Notes for Robot Hands (HS/HSS-E) .....	31
3.2 HM/HMS-E series .....	34
3.2.1 Specifications (HM/HMS-E2 series) .....	34
3.2.2 Outer Dimensions and Workable Space of the Robot Unit (HM/HMS-E2) .....	38
3.2.3 Robot Positioning Time (HM/HMS-E series) .....	42
3.2.4 Notes for setting the positioning speed (HM/HMS-E series) .....	91
3.2.5 Air piping and signal wiring (HM/HMS-E series) .....	93
3.2.6 Engineering-design Notes for Robot Hands (HM/HMS-E series) .....	95
<b>Chapter 4 Specifications of the Robot Controller .....</b>	<b>98</b>
4.1 Specifications .....	98
4.2 Outer Dimensions of the Robot Controller .....	100
4.3 Controller Setting Table .....	101
<b>Chapter 5 Warranty .....</b>	<b>104</b>
<b>Appendix How to Use the Manual Pack CD .....</b>	<b>105</b>
1. Using this electronic manual  .....	107
2. Performing a keyword search  .....	111
3. Using the Index  .....	114



# Chapter 1 Packing List of the Robot

## 1.1 Standard Components

The components listed below are contained in the product package.

### Standard Components

No.	Item	Q'ty
(1)	Robot unit	1
(2)	Robot controller	1
(3)	Power cable (5 m) ( <b>Note 1</b> )	1
(4)	Motor & encoder cable ( <b>Note 2</b> ) (Option)	1
(5)	Manuals	1 set
(6)	NetwoRC CD (containing WINCAPSII beta version)	1
(7)	Spare fuses for robot controller	3
(8)	Initialization floppy disk (1.44 MB format) ( <b>Note 3</b> )	1
(9)	Pendantless connector (Dummy connector)	1
(10)	Connector set for hand control signals (for CN20 and CN21)	1 set
(11)	Power connector for I/O	1
(12)	Direction indicator label ( <b>Note 4</b> )	1
(13)	Warning label ( <b>Note 5</b> )	1
(14)	Spare output IC for robot controller	1
(15)	Dowel pins (internally threaded positioning pin and diamond-shaped pin)	1 set
(16)	Air regulator ( Only for HM-E series)	1

**Note 1:** Not only the standard power cable but also the UL-compliant one is available. The CE-compliant one consists of a power connector only.

**Note 2:** Choose and order a motor & encoder cable from the table below. The internal cable bending radius shall at least be 200 mm. Excessively bending will result in broken lead wires.

No.	Motor & encoder cable	Part No.
(1)	Standard cable 4 m	410141-1551
(2)	Standard cable 6 m	410141-1561
(3)	Splash-proof cable 4 m	410141-1571
(4)	Splash-proof cable 6 m	410141-1581
(5)	High-strength cable 6 m	410141-1591
(6)	High-strength cable 12 m	410141-1601
(7)	Splash-proof & high-strength cable 6 m	410141-1611
(8)	Splash-proof & high-strength cable 12 m	410141-1621

**Note 3:** Preserve the initialization floppy disk in a safe place. The disk contains arm data in WINCAPSII format. If a memory error appears on the teach pendant due to a memory failure, use the disk to load the arm data to the robot controller. (Refer to the INSTALLATION & MAINTENANCE GUIDE, "Using the Initialization Floppy Disk.")

**Note 4:** After installation, attach the direction indicator label in a position on the robot unit that can be easily seen.

**Note 5:** Attach the warning label on the robot safety fence or other location where workers will easily notice it. If necessary, prepare a plate for attaching the seal.

## 1.2 Optional Components

The table below lists the optional components.

**Optional Components (1)**

Classification	No.	Item	Remarks	Part No.
I/O cables	1	I/O cable set	(8 m) (Consists of Nos.1-1 to 1-3, one each)	410149-0330
	1-1	Input cable	(8 m)	410141-1630
	1-2	Output cable	(8 m)	410141-1650
	1-3	Hand I/O cable	(8 m)	410141-1740
	2	I/O cable set (Only hand I/O cable is a high-strength type.)	(8 m) (Consists of Nos.2-1 to 2-3, one each)	410149-0350
	2-1	Input cable	(8 m)	410141-1630
	2-2	Output cable	(8 m)	410141-1650
	2-3	Hand I/O cable (high-strength)	(8 m)	410141-1670
	3	I/O cable set	(15 m) (Consists of Nos.3-1 to 3-3, one each)	410149-0340
	3-1	Input cable	(15 m)	410141-1640
	3-2	Output cable	(15 m)	410141-1660
	3-3	Hand I/O cable	(15 m)	410141-1750
	4	I/O cable set (Only the hand I/O cable is a high-strength type.)	(15 m) (Consists of Nos.4-1 to 4-3, one each)	410149-0360
	4-1	Input cable	(15 m)	410141-1640
	4-2	Output cable	(15 m)	410141-1660
	4-3	Hand I/O cable (high-strength)	(15 m)	410141-1680
Operation devices	5	Operating panel ( <b>Note 1</b> )	(4 m)	410100-0970
	6	Operating panel ( <b>Note 1</b> )	(8 m)	410100-0980
	7	Teach pendant ( <b>Note 1</b> )	(4 m)	410100-0940
	8	Teach pendant ( <b>Note 1</b> )	(8 m)	410100-0950
	9	Teach pendant ( <b>Note 1</b> )	(12 m)	410100-0960
	10	Mini-pendant (Version 1.7 or later) (Incl. WINCAPSII Light)	(4 m)	410109-0020
	11	Mini-pendant (Version 1.7 or later) (Incl. WINCAPSII Light)	(8 m)	410109-0040
	12	Mini-pendant (Version 1.7 or later) (Incl. WINCAPSII Light)	(12 m)	410109-0060
	13	Pendant extension cable ( <b>Note 2</b> )	(4 m) For TP/MP/OP	410141-2390
	14	Pendant extension cable ( <b>Note 2</b> )	(8 m) For TP/MP/OP	410141-2400

**Note1:** The total cable length must not be more than 12 m when the operating panel and the teach pendant are to be connected in series.

**Note 2:** The total cable length must not be more than 12 m when the pendant extension cable is connected to the TP, MP or OP. Do not connect two or more pendant extension cables to the TP, MP or OP.


## Optional Components (2)

Classification	No.	Item	Remarks	Part No.
PC teaching software	15	WINCAPSII	(in CD-ROM)	410090-0860
	16	WINCAPSII	(in floppy disk)	410090-0870
Visual equipment	17	$\mu$ Vision (built-in visual) board	(NTSC)	410010-2070
	18	$\mu$ vision (built-in visual) board (for Europe)	(PAL)	410010-2080
	19	Camera		463980-0030
	20	Monitor		463980-0021
	21	Camera cable	(3 m)	463981-0110
	22	Camera cable	(5 m)	463981-0120
	23	Camera cable	(15 m)	463981-0160
	24	Monitor cable	(BNC) (1 m)	463981-0010
	25	Monitor cable	(BNC) (3 m)	463981-0030
	26	Monitor cable	(BNC) (5 m)	463981-0050
Optional boards for the robot controller	27	Ethernet board		410010-0710
	28	Built-in floppy disk drive	(for 1.44 MB floppy disk)	410010-0520
	29	DeviceNet slave board	(Slave station)	410010-0720
	30	DeviceNet master board	(Master station)	410010-0740
	31	PROFIBUS slave board	(Slave station)	410010-1190
Controller-related components	32	Controller protection box	FB-9 for HM-E	410181-0030
			FB-10 for HS-E	410181-0060
	33	I/O connector set for RC5	For parallel I/O	410159-0070
	34	Flange kit	For HS-E series	410329-0060
For 10kg payload HM-E series			410329-0070	
Manuals (Printed materials)	35	H*-E GENERAL INFORMATION ABOUT ROBOT		410002-2020
	36	H*-E INSTALLATION & MAINTENANCE GUIDE		410002-2030
	37	RC5 CONTROLLER INTERFACE MANUAL	(Common to all robot series)	410002-2040
	38	OPTIONS MANUAL	(Common to all robot series)	410002-2070
	39	BEGINNER'S GUIDE		410002-1340
	40	SETTING-UP MANUAL	(Common to all robot series)	410002-1320
	41	PROGRAMMER'S MANUAL (I)	(Common to all robot series)	410002-2050
	42	PROGRAMMER'S MANUAL (II)	(Common to all robot series)	410002-2060
	43	ERROR CODE TABLES	(Common to all robot series)	410002-1430
	44	WINCAPS II GUIDE	(Common to all robot series)	410002-0930

# Chapter 2 Configuration of the Robot System

## 2.1 Configurators

The figure below shows configurators of the typical robot system.

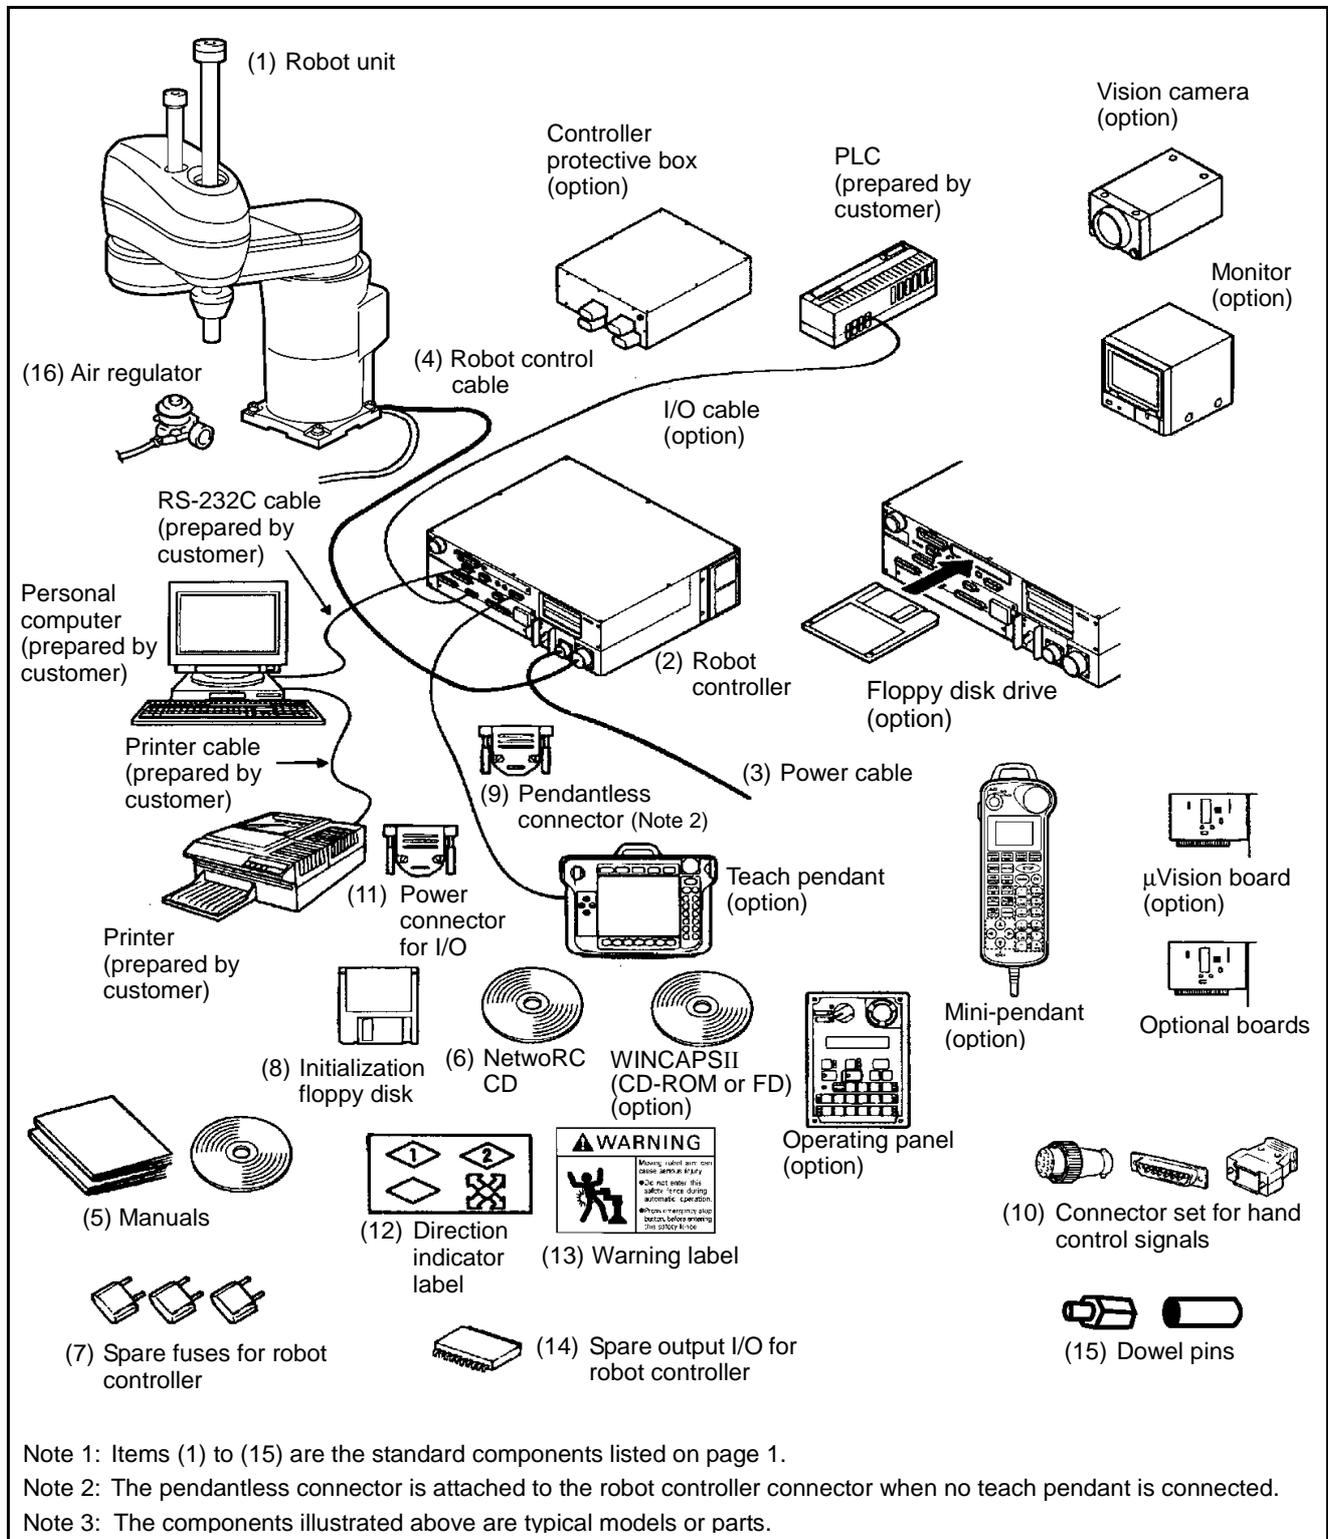


Configurators of the H\*-E Series Robot System


## 2.2 Names of Axes (Joints) of the Robot Unit

The figure below shows the four axes (joints) of the robot unit and their motion directions.

### (1) HS-E Series

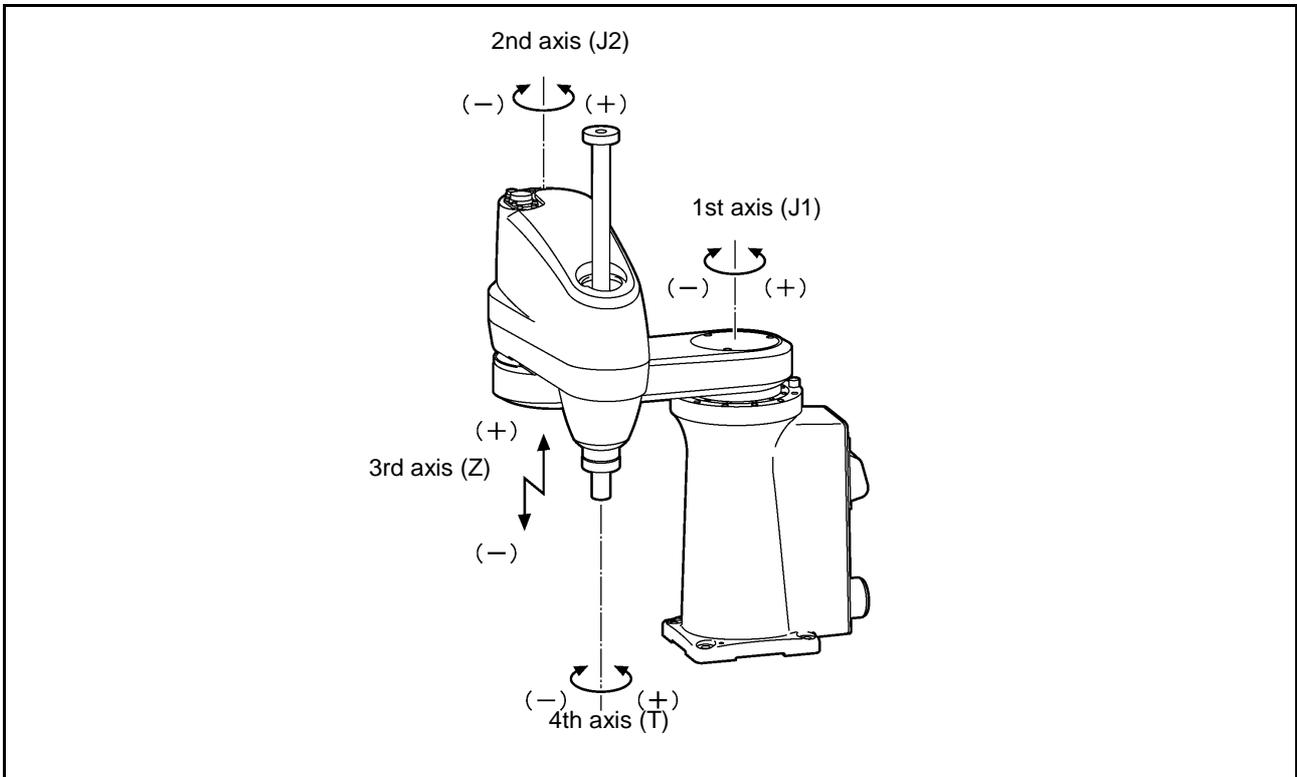


Axes (Joints) of HS-E Series Robot Unit

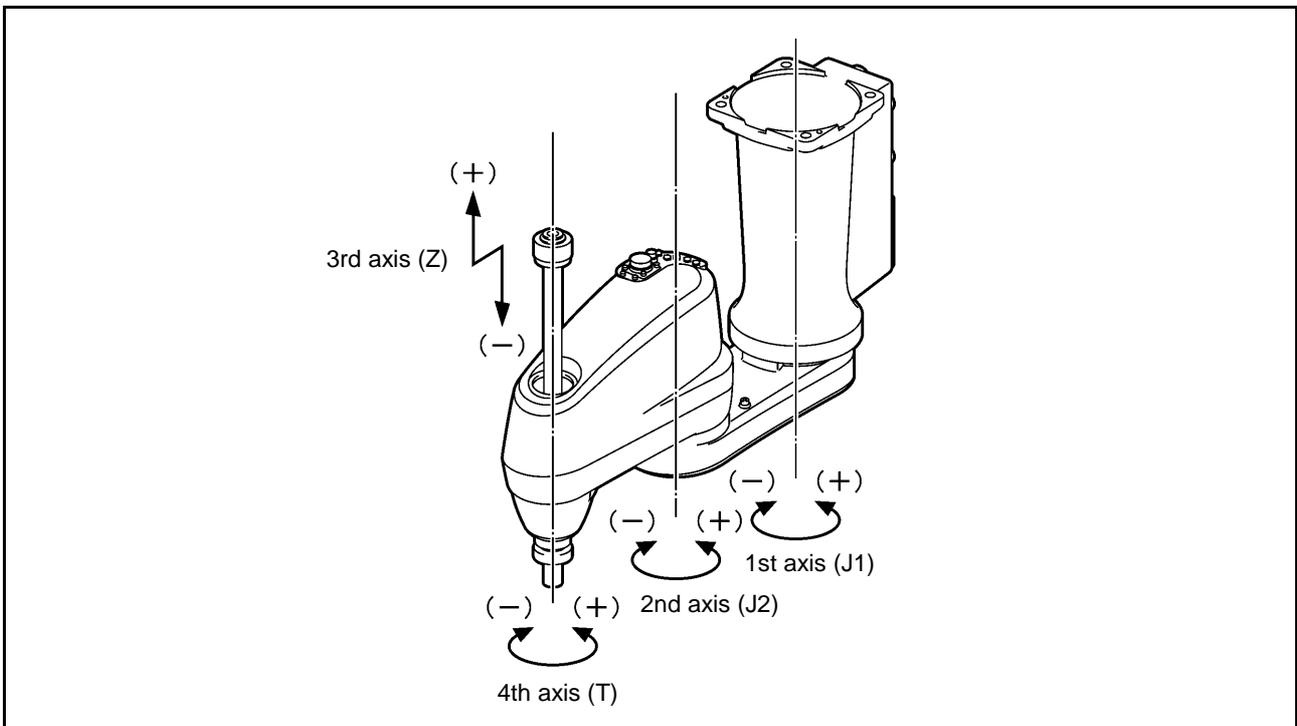


Axes (Joints) of HSS-E Series Robot Unit

## (2) HM-E Series

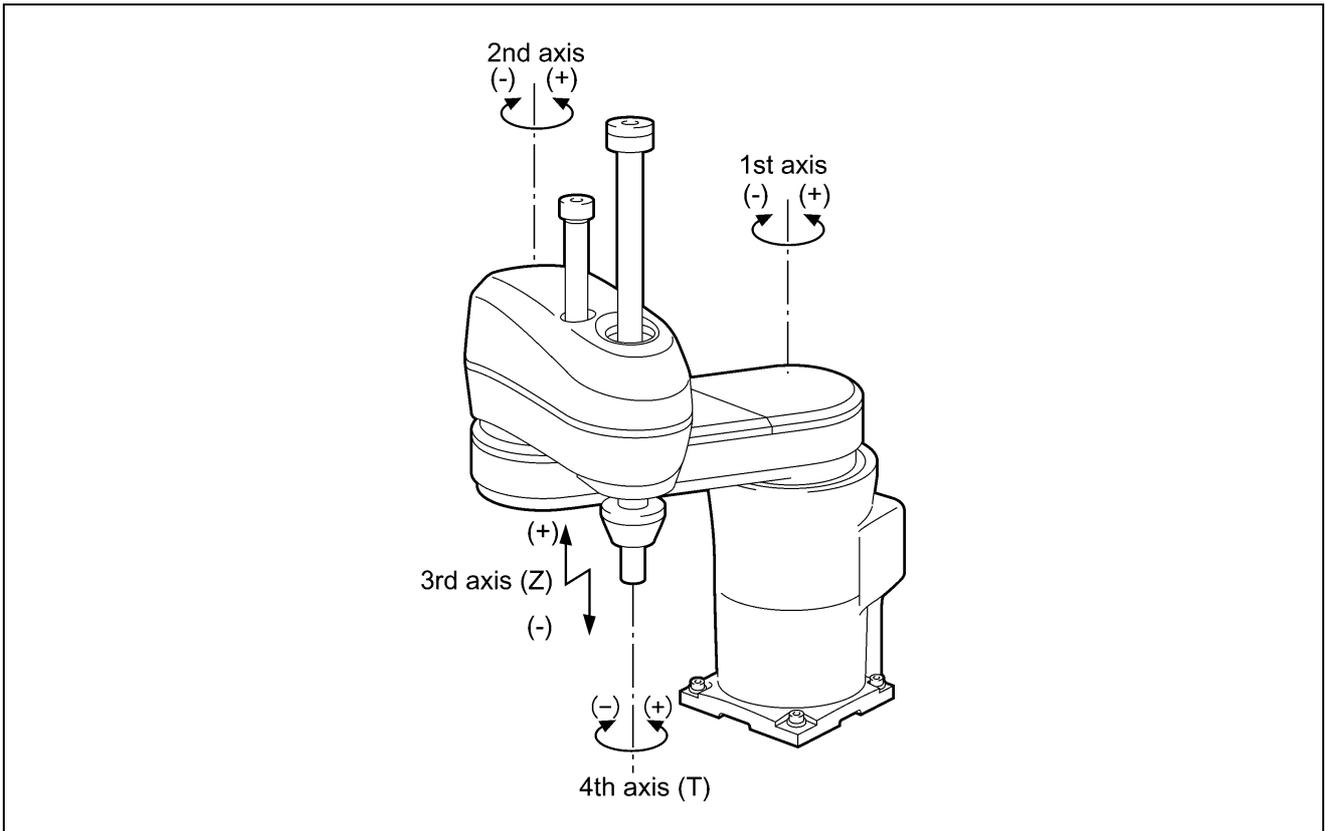


**Axes (Joints) of HM-E Series Robot Unit**

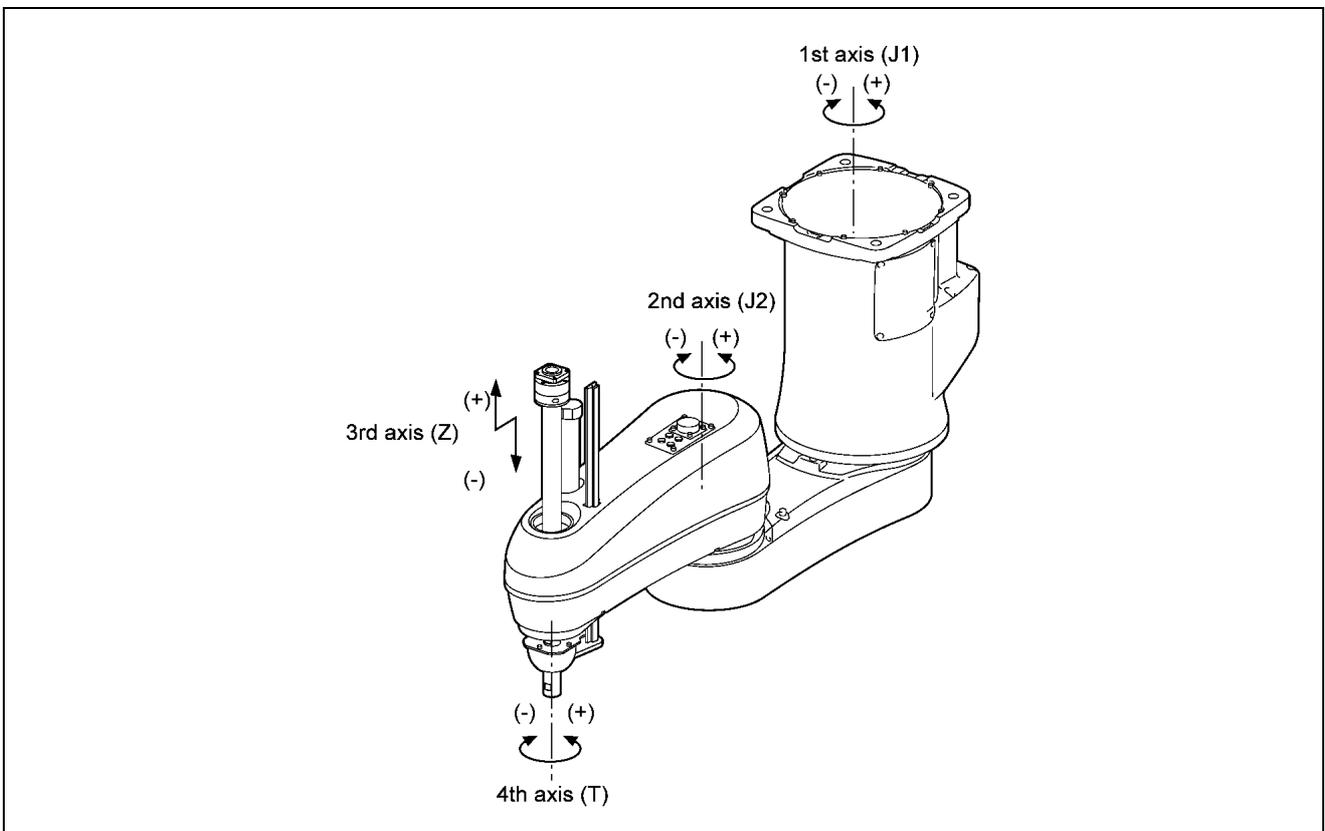

**Axes (Joints) of HMS-E Series Robot Unit**

## 2.3 Names of the Robot Controller Components

The figure below shows the names of the robot controller components.

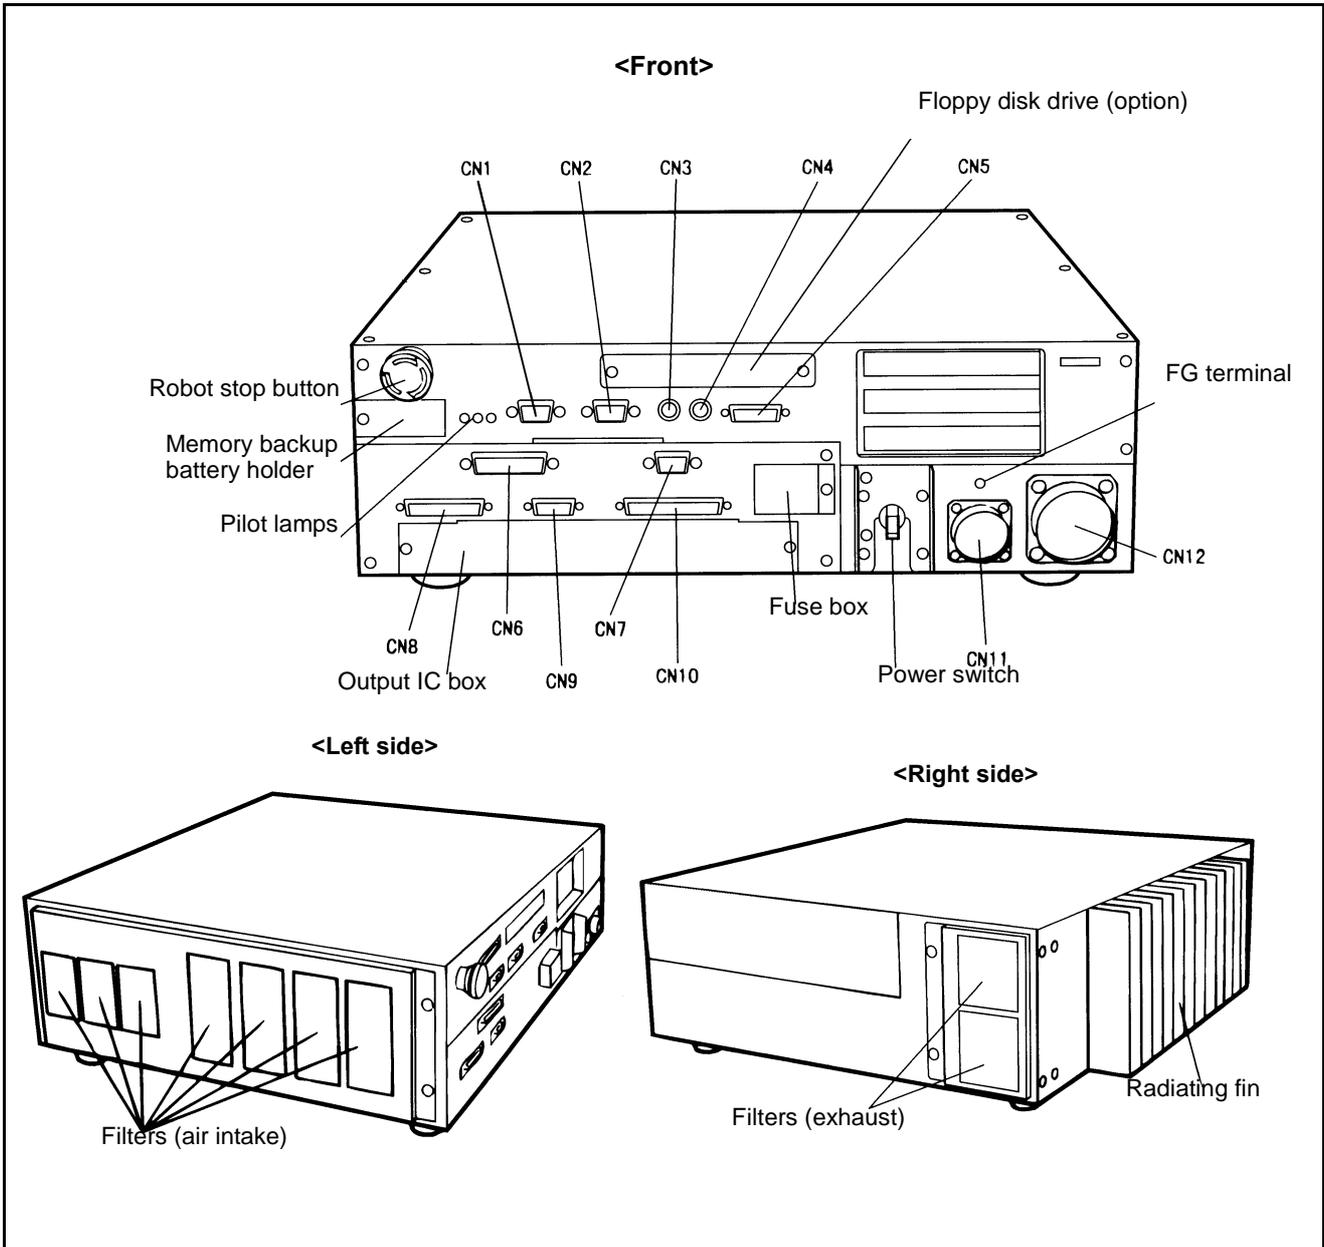

Names of Robot Controller Components

### Connector Names

Connector No.	Marking	Name	Connector No.	Marking	Name
CN1	RS232C	Serial interface connector	CN7	I/O POWER	Power connector for I/O
CN2	CRT	CRT connector	CN8	INPUT	Connector for user- or system-input
CN3	KEYBD	Keyboard connector	CN9	HAND I/O	Connector for hand I/O
CN4	MOUSE	Connector for PS/2 mouse	CN10	OUTPUT	Connector for user- or system-output
CN5	PENDANT	Connector for teach pendant	CN11	INPUT AC	Power connector
CN6	PRINTER	Printer connector (Not used.)	CN12	MOTOR	Motor/encoder connector

**⚠ Caution:** The robot controller connectors are of a screw-lock type or ring-lock type. Lock the connectors securely. If even one of the connectors is not locked, weak contact may result thereby causing an error.

**Be sure to turn the robot controller OFF before connecting/ disconnecting the power connector or motor connector. Otherwise, the internal circuits of the robot controller may be damaged.**

# Chapter 3 Specifications of the Robot Unit

## 3.1 HS/HSS-E series

### 3.1.1 Specifications (HS/HSS-E)

The table below lists the specifications of the HS-E/HSS-E series robot unit.

#### (1) HS-E Series Robot Unit (Floor-mount type)

Item		Specifications		
Model name of robot set (Note 1)		HS-4535*E (Standard)	HS-4545*E (Standard)	HS-4555*E (Standard)
		HS-4535*E-W (Dust-proof, splash-proof)	HS-4545*E-W (Dust-proof, splash-proof)	HS-4555*E-W (Dust-proof, splash-proof)
		HS-4535*E-P (Cleanroom)	HS-4545*E-P (Cleanroom)	HS-4555*E-P (Cleanroom)
Model name of robot unit		HS-4535*EM (Standard)	HS-4545*EM (Standard)	HS-4555*EM (Standard)
		HS-4535*EM-W (Dust-proof, splash-proof)	HS-4545*EM-W (Dust-proof, splash-proof)	HS-4555*EM-W (Dust-proof, splash-proof)
		HS-4535*EM-P (Cleanroom)	HS-4545*EM-P (Cleanroom)	HS-4555*EM-P (Cleanroom)
Overall arm length		125 (J1: 1st axis) + 225 (J2: 2nd axis) = 350 mm	225 (J1: 1st axis) + 225 (J2: 2nd axis) = 450 mm	325 (J1: 1st axis) + 225 (J2: 2nd axis) = 550 mm
Z-axis (3rd axis) vertical stroke*		200 mm if * = 2, 320 mm if * = 3		
Wrist rotation angle		T (4th axis): $\pm 360^\circ$		
Motion angle and stroke		J1 (1st axis): $\pm 155^\circ$ , J2 (2nd axis): $\pm 145^\circ$ , Z (3rd axis): 200 mm if * = 2, 320 mm if * = 3, T (4th axis): $\pm 360^\circ$		
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)		
Maximum payload		5 kg		
Composite speed	At the center of the hand mounting flange	7,200 mm/s	6,300 mm/s	7,100 mm/s
	Z and T	Z (3rd axis): 2,000 mm/s, T (4th axis): 2400°/s		
Position repeatability (Note 2)	J1 + J2	$\pm 0.015$ mm	$\pm 0.02$ mm	$\pm 0.02$ mm
	Z	$\pm 0.01$ mm		
	T	$\pm 0.005^\circ$		
Maximum force-fit		98N (one second or less)		
Maximum allowable moment of inertia around T axis		0.1 kgm <sup>2</sup> (with 5 kg payload)		
Position detection		Absolute encoder		
Drive motor and brake		AC servomotors for all axes, Brakes for Z axis (3rd axis) and T axis		
User air piping		4 systems ( $\phi 4 \times 2$ , $\phi 6 \times 2$ )		
User signal lines		19 (for proximity sensor signals, etc.)		
Air source	Operating pressure	0.05 to 0.35 MPa		
	Max. allowable pressure	0.59 MPa		
Degree of protection for dust-proof, splash-proof type		IP65		
Clean class for cleanroom type		Class 10 (0.1 $\mu$ ) at use points		
Weight		Approx. 20 kg		

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.

(Note 2) Value at the constant ambient temperature.

## (2) HSS-E Series Robot Unit (Overhead-mount type)

Item		Specifications	
Model name of robot set (Note 1)		HSS-4545*E (Standard) HSS-4545*E-W (Dust-proof, splash-proof)	HSS-4555*E (Standard) HS-4555*E-W (Dust-proof, splash-proof)
Model name of robot unit		HSS-4545*EM (Standard) HSS-4545*EM-W (Dust-proof, splash-proof)	HSS-4555*EM (Standard) HSS-4555*EM-W (Dust-proof, splash-proof)
Overall arm length		225 (J1: 1st axis) + 225 (J2: 2nd axis) = 450 mm	325 (J1: 1st axis) + 225 (J2: 2nd axis) = 550 mm
Z-axis (3rd axis) vertical stroke*		150 mm if * = 1, 200 mm if * = 2, 320 mm if * = 3	
Wrist rotation angle		T (4th axis): $\pm 360^\circ$	
Motion angle and stroke		J1 (1st axis): $\pm 152^\circ$ , J2 (2nd axis): $\pm 141^\circ$ , Z (3rd axis): 150 mm if * = 1, 200 mm if * = 2, 320 mm if * = 3, T (4th axis): $\pm 360^\circ$	J1 (1st axis): $\pm 155^\circ$ , J2 (2nd axis): $\pm 145^\circ$ , Z (3rd axis): 150 mm if * = 1, 200 mm if * = 2, 320 mm if * = 3, T (4th axis): $\pm 360^\circ$
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)	
Maximum payload		5 kg	
Composite speed	At the center of the hand mounting flange	6,300 mm/s	7,100 mm/s
	Z and T	Z (3rd axis): 2,000 mm/s, T (4th axis): 2400°/s	
Position repeatability (Note 2)	J1 + J2	$\pm 0.02$ mm	$\pm 0.02$ mm
	Z	$\pm 0.01$ mm	
	T	$\pm 0.005^\circ$	
Maximum force-fit		98N (one second or less)	
Maximum allowable moment of inertia around T axis		0.1 kgm <sup>2</sup> (with 5 kg payload)	
Position detection		Absolute encoder	
Drive motor and brake		AC servomotors for all axes Brakes for Z axis (3rd axis) and T axis	
User air piping		4 systems ( $\phi 4 \times 2$ , $\phi 6 \times 2$ )	
User signal lines		19 (for proximity sensor signals, etc.)	
Air source	Operating pressure	0.05 to 0.35 MPa	
	Maximum allowable pressure	0.59 MPa	
Degree of protection for dust-proof, splash-proof type		IP65	
Weight		Approx. 20 kg	

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.

(Note 2) Value at the constant ambient temperature.

### 3.1.2 Outer Dimensions and Workable Space of the Robot Unit (HS/HSS-E)

The outer dimensions and workable space of the HS-E/HSS-E series are shown on the following pages.


**NOTE:** The overhead-mount type of robots is designed with a preset motion-prohibited area where the robot cannot work.

The motion-prohibited area of the overhead-mount type is set to AREA7 that is specified in the defined interference check area setting. Therefore, you may define only up to seven interference check areas (AREA0 through AREA6) for the overhead-mount type while you may usually define up to eight (AREA0 through AREA7).

Refer to the SETTING-UP MANUAL, Chapter 4, Subsection 4.1.2, "[ 5 ] Making the defined interference check areas active or inactive."





#### Operating procedure with the teach pendant

Access: [F2 Arm]—[F6 Aux.]—[F6 Area.]

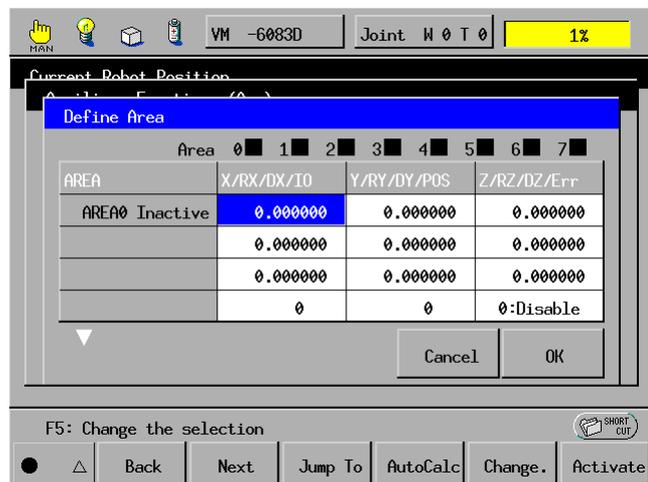


(1) Outer dimensions and workable space (HS-E series, Floor-mount)

<HS-E>

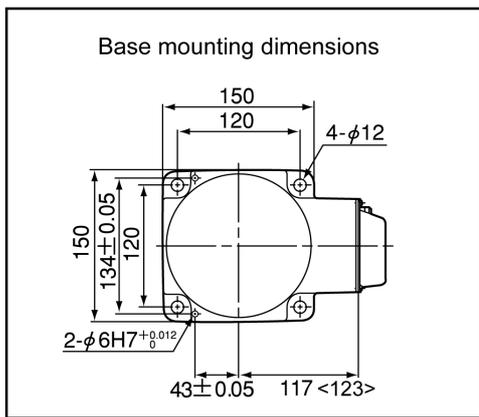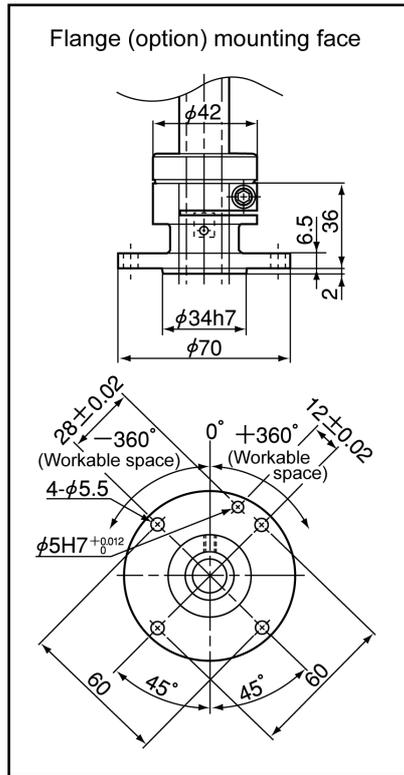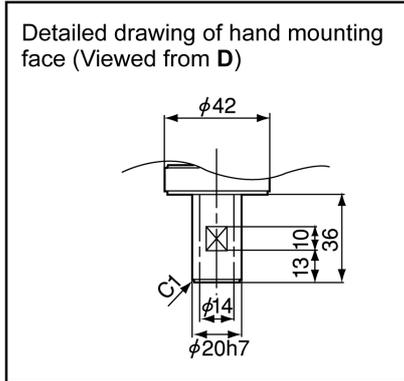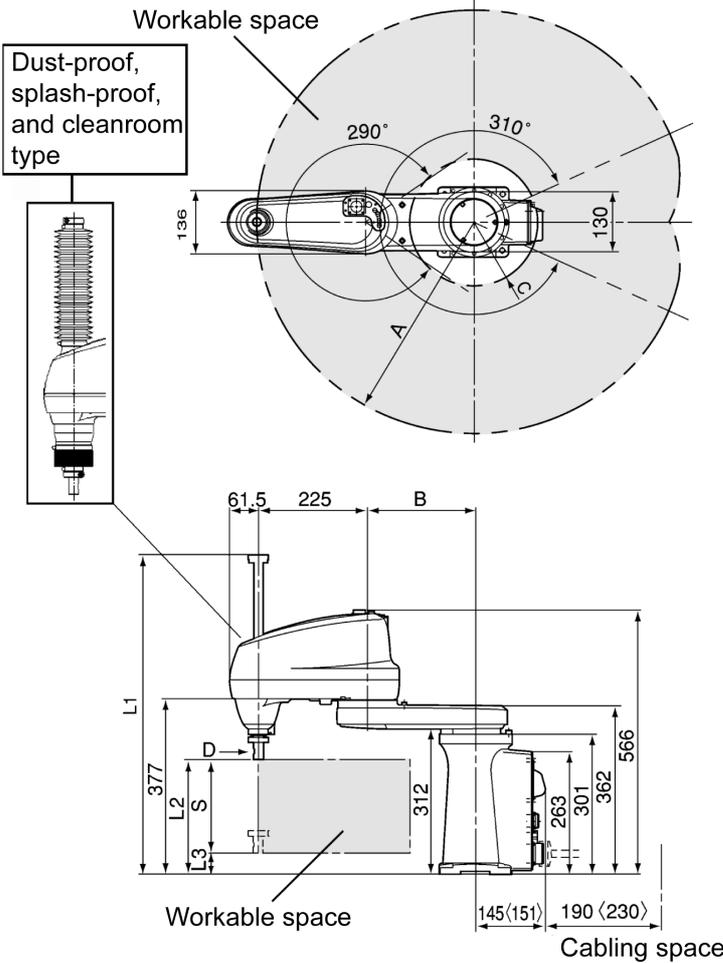

Name plate sample

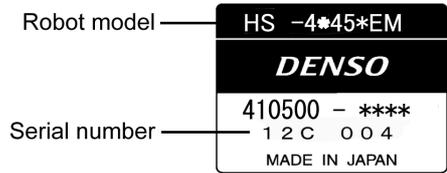

Unit: mm


Model	A	B	C
HS-4535*E	350	125	143
HS-4545*E	450	225	136
HS-4555*E	550	325	191

Note: Values enclosed in < > denote dimensions for the dust-proof, splash-proof type or cleanroom type.

S(mm)	Type	L1	L2	L3
* = 2:200	Standard	697	246	46
	Dust-proof, splash-proof	790	206	6
	Cleanroom	798		
* = 3:320	Standard	817	246	-74* <sup>1</sup>
	Dust-proof, splash-proof	910	206	-114* <sup>1</sup>
	Cleanroom	918		






\*<sup>1</sup> If the Z-axis stroke is 320mm, the lowermost position of the Z axis may reach below the base mounting face.

(2) Outer dimensions and workable space  
(HSS-4545\*E, Arm length 450 mm, Overhead-mount, Standard type)

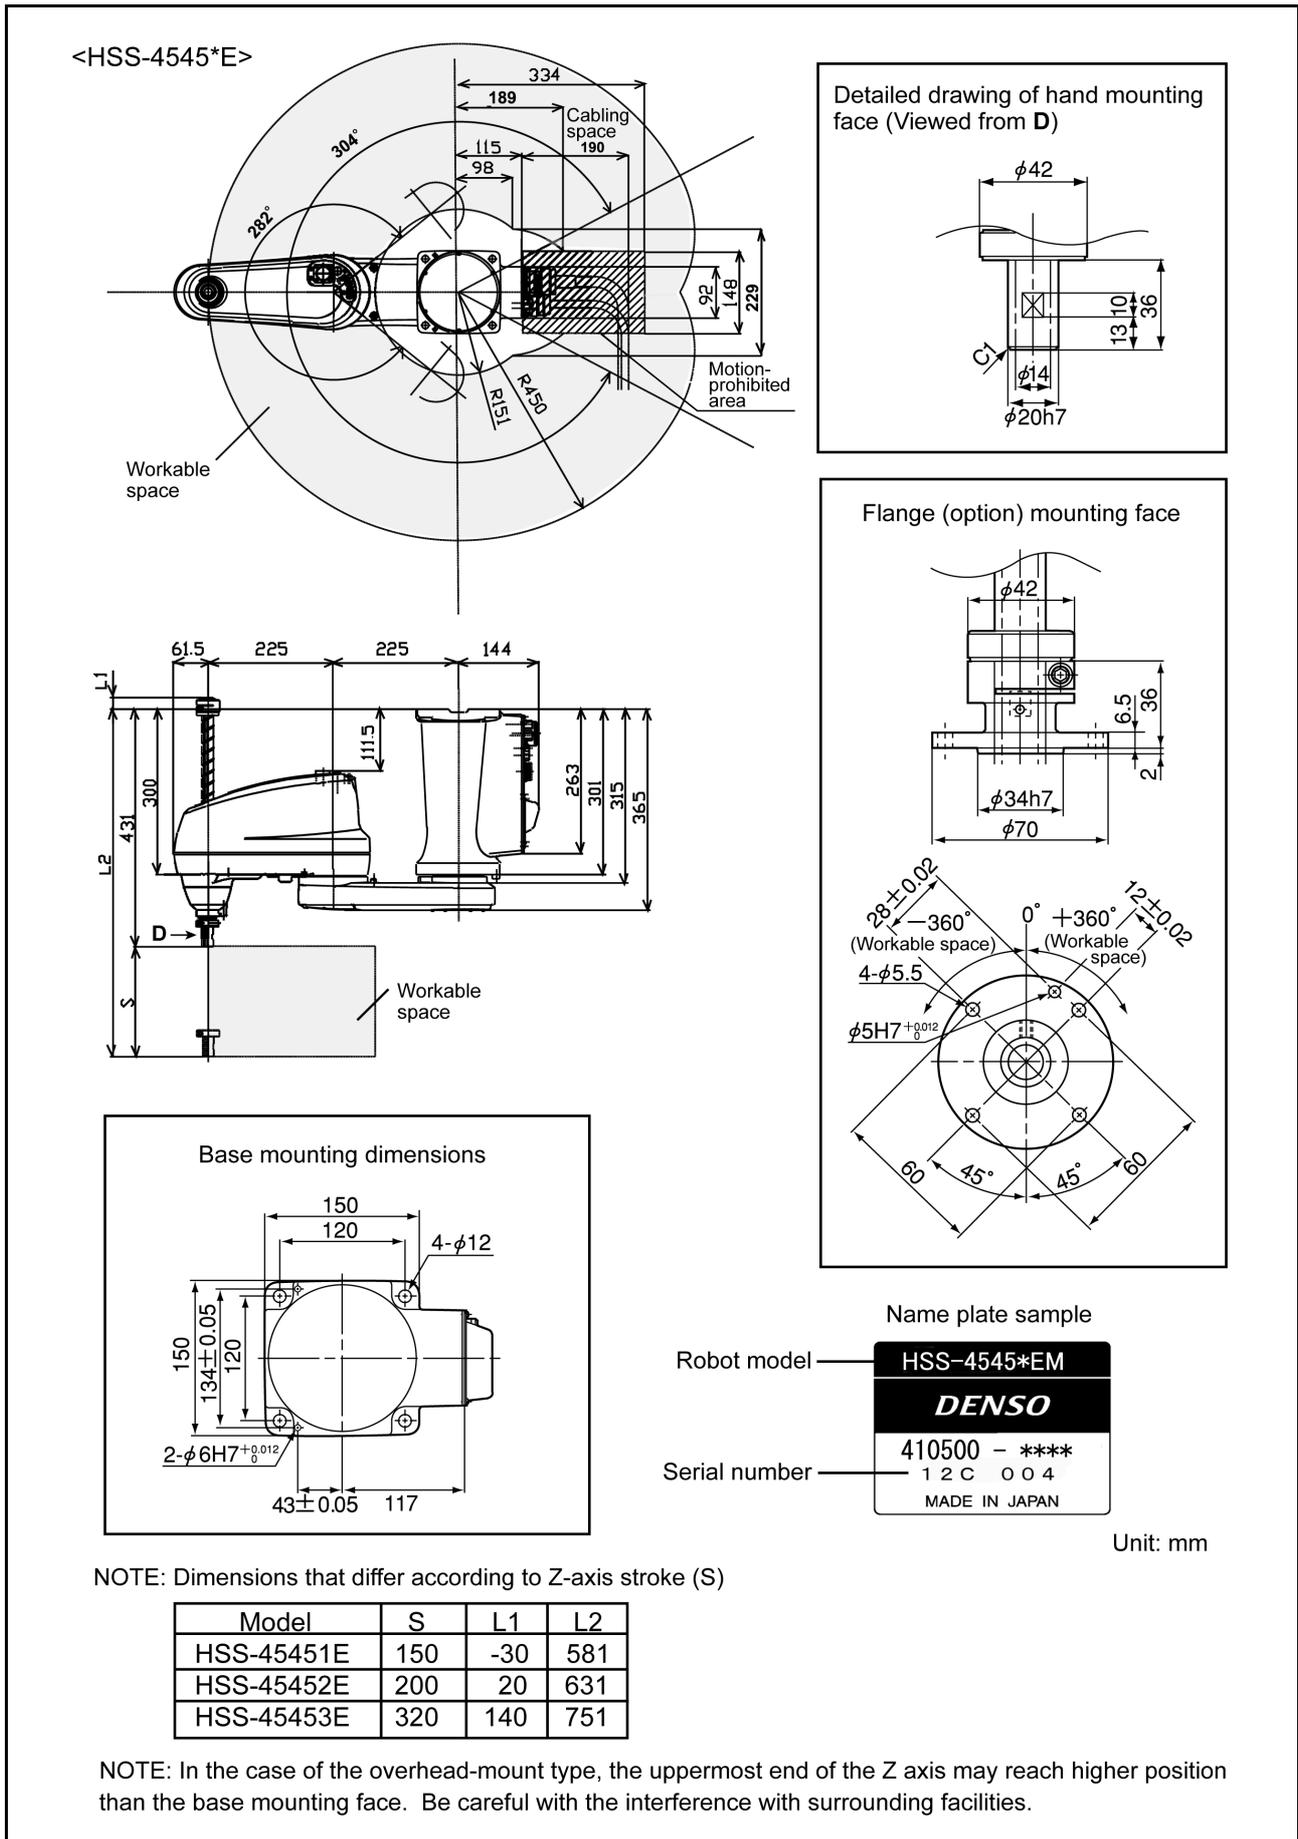

(3) Outer dimensions and workable space  
 (HSS-4555\*E, Arm length 550 mm, Overhead-mount, Standard type)

<HSS-4555\*E>

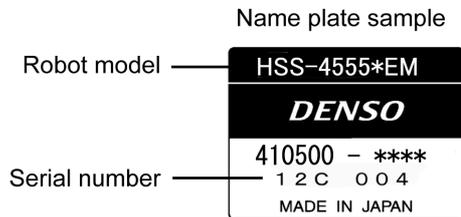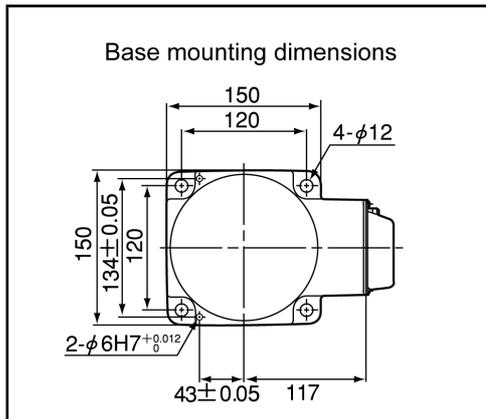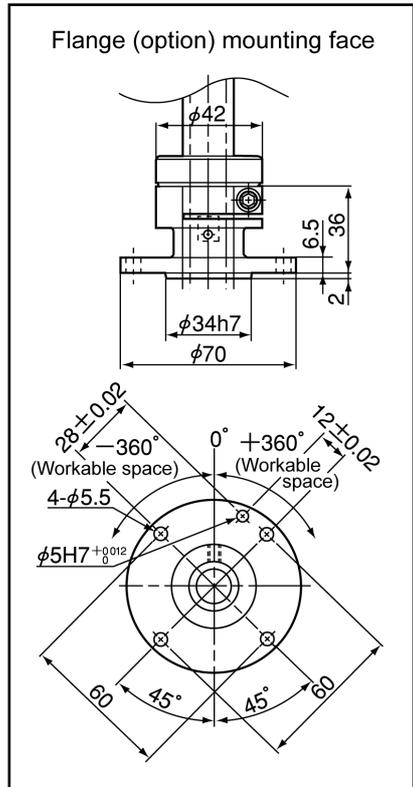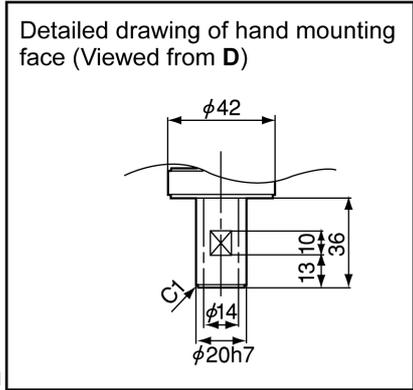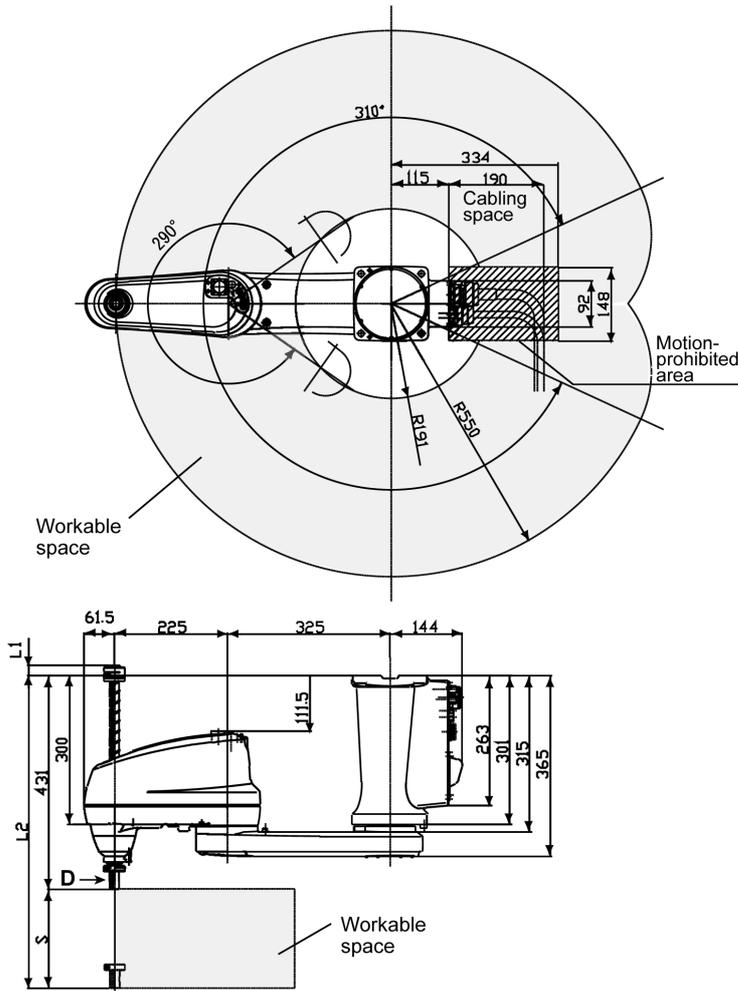


Unit: mm

NOTE: Dimensions that differ according to Z-axis stroke (S)

Model	S	L1	L2
HSS-45551E	150	-30	581
HSS-45552E	200	20	631
HSS-45553E	320	140	751






NOTE: In the case of the overhead-mount type, the uppermost end of the Z axis may reach higher position than the base mounting face. Be careful with the interference with surrounding facilities.

(4) Outer dimensions and workable space  
(HSS-4545\*E-W, Arm length 450 mm, Overhead-mount, Dust-proof & splash-proof type)

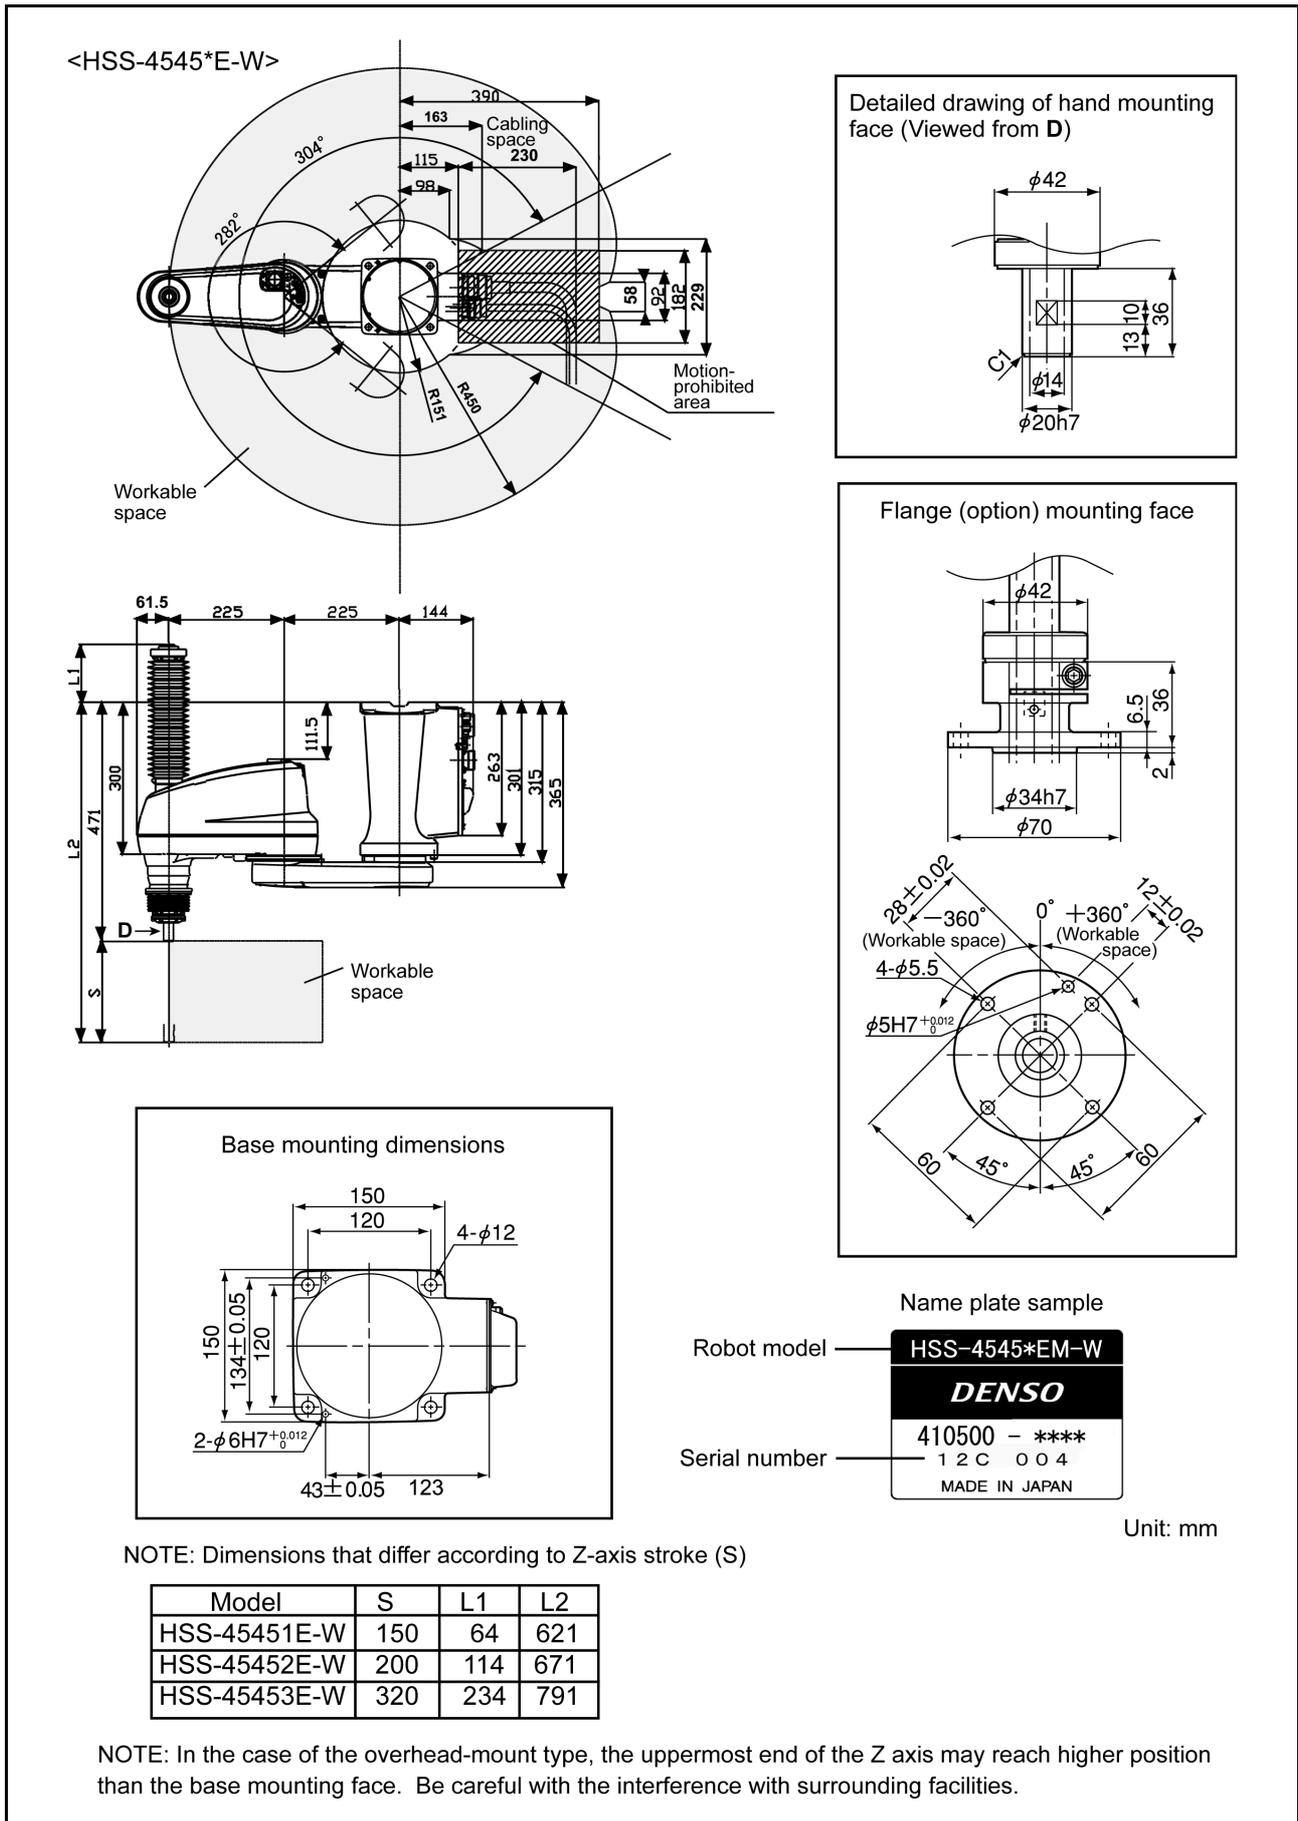

(5) Outer dimensions and workable space  
 (HSS-4555\*E-W, Arm length 550 mm, Overhead-mount, Dust-proof & splash-proof type)

<HSS-4555\*E-W>

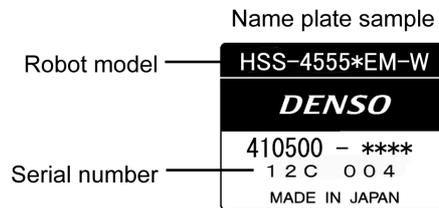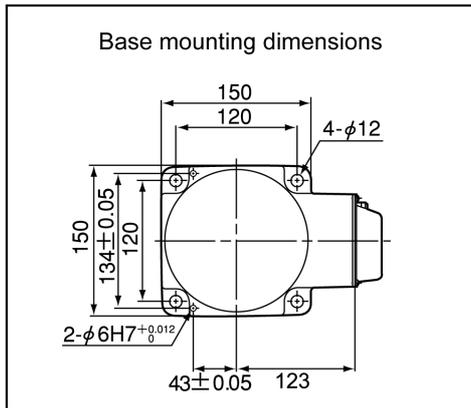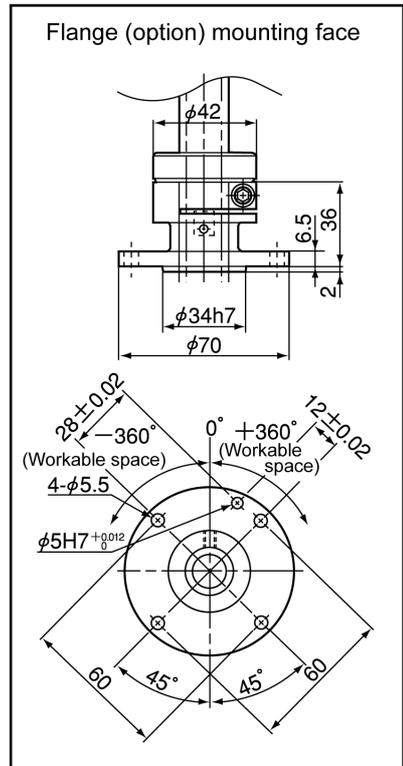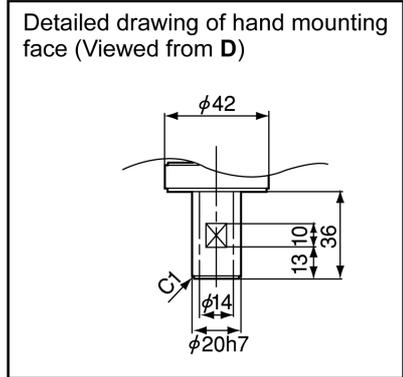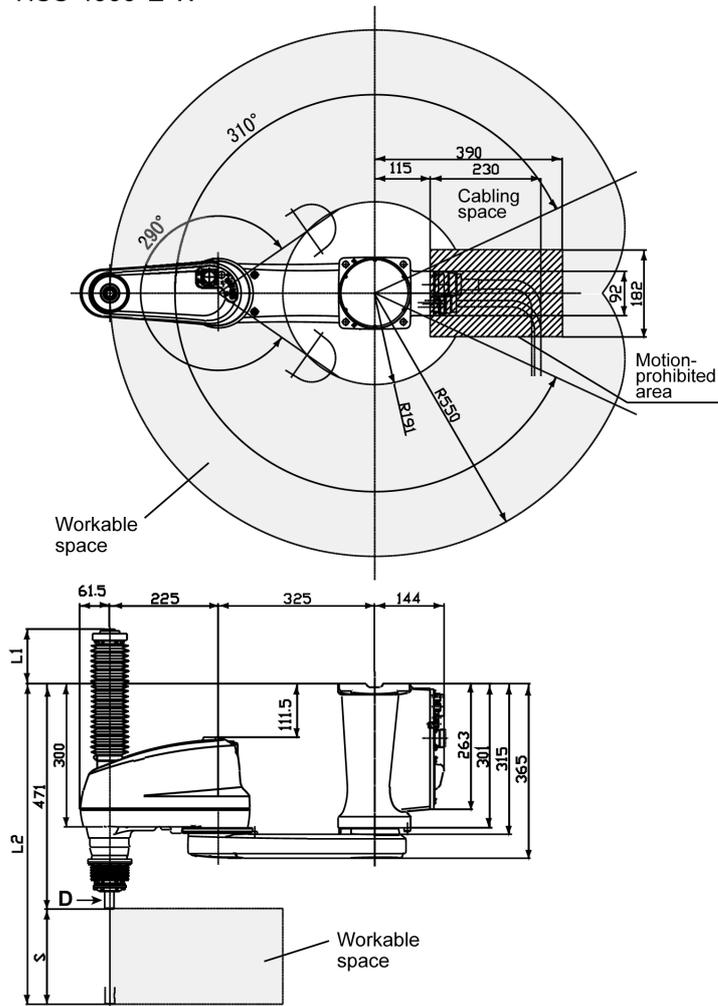

Unit: mm

NOTE: Dimensions that differ according to Z-axis stroke (S)


Model	S	L1	L2
HSS-45551E-W	150	64	621
HSS-45552E-W	200	114	671
HSS-45553E-W	320	234	791

NOTE: In the case of the overhead-mount type, the uppermost end of the Z axis may reach higher position than the base mounting face. Be careful with the interference with surrounding facilities.

### 3.1.3 Robot Positioning Time (HS/HSS-E)


1. The graphs given on the following pages show the positioning times used to calculate the cycle time.
2. Positioning time refers to the time length required from the start of robot operation to the arrival at the target positioning point.
3. After the robot moves to and passes the target positioning point, vibration will be dampened and the robot will be positioned at the target positioning point as shown in the figure below. This vibration dampening time is not considered in those graphs.

- Caution (1)** The vibration dampening time depends on factors such as the weight of the hand. If the robot is to be used in such a way that it overshoots or if the vibration damping time is of great concern, then test the robot carefully beforehand.
- (2)** If acceleration begins before residual vibration of the robot stops, an overcurrent error (code starts from ERROR6120 where the first digit represents the axis number) may be displayed. In this case, take one of the following measures:
- Lower the deceleration of the preceding operation with a DECEL command to reduce residual vibration.
  - Keep the robot in stand-by with a DELAY command until residual vibration stops.
  - Lower acceleration with an ACCEL command.
- (3)** Run the robot with the optimum payload setting in accordance with weight of the hand and workpiece. If not, a robot failure may result.
- (4)** In the positioning time graphs, the Z-axis stroke is represented near the upper end. Near the lower end, the horizontal movement time along the J1/J2 axis increases. (Refer to Section 3.1.4 "Notes for setting the positioning speed .")

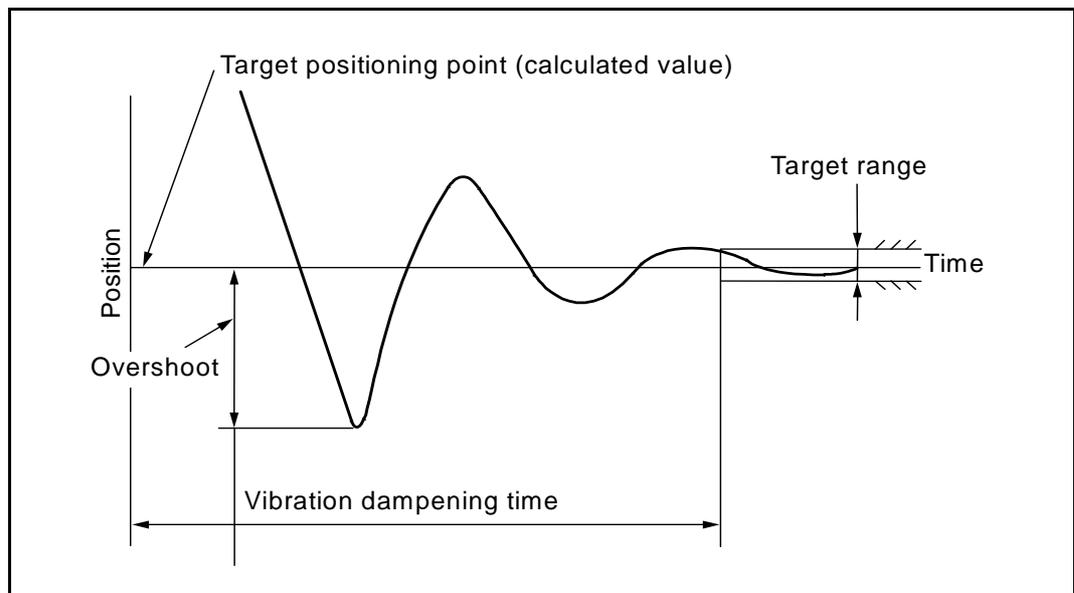


Vibration Dampening Time


(1) HS-4535\*E

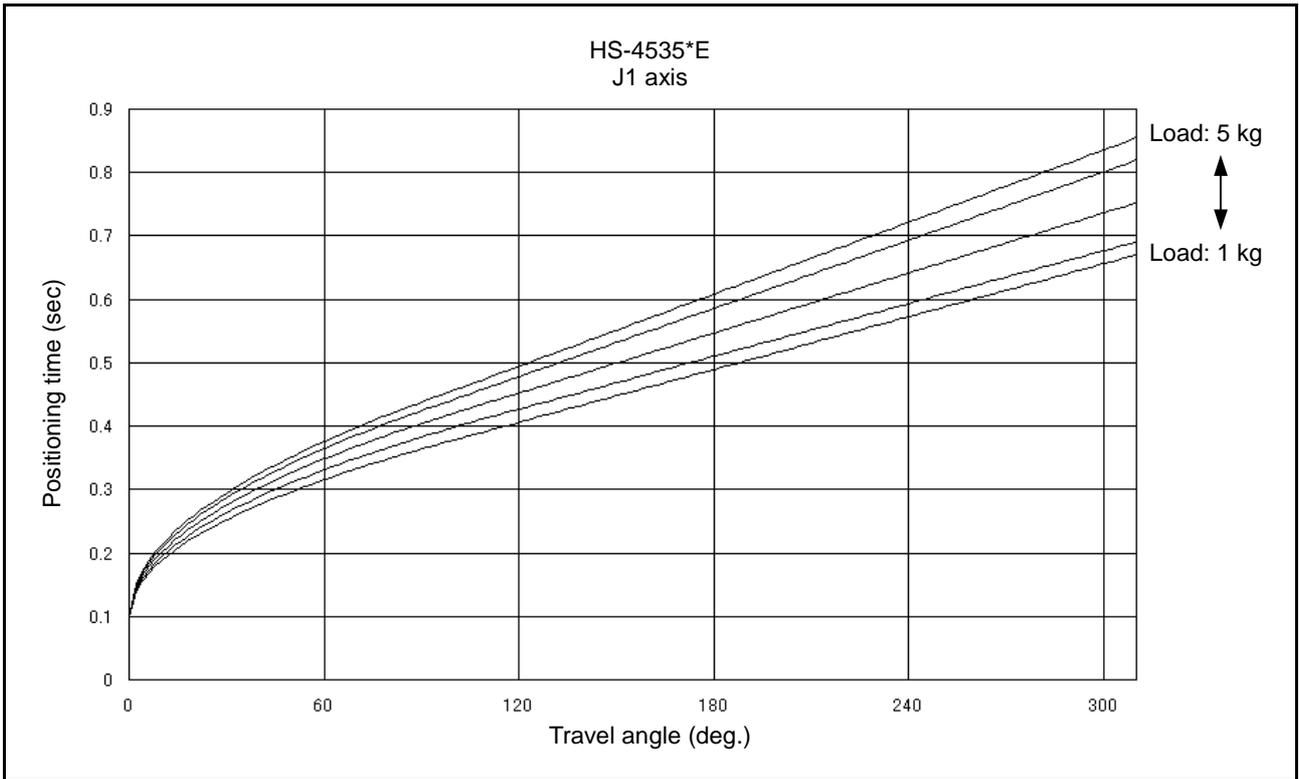


**J1 axis (PTP control) on the HS-4535\*E**

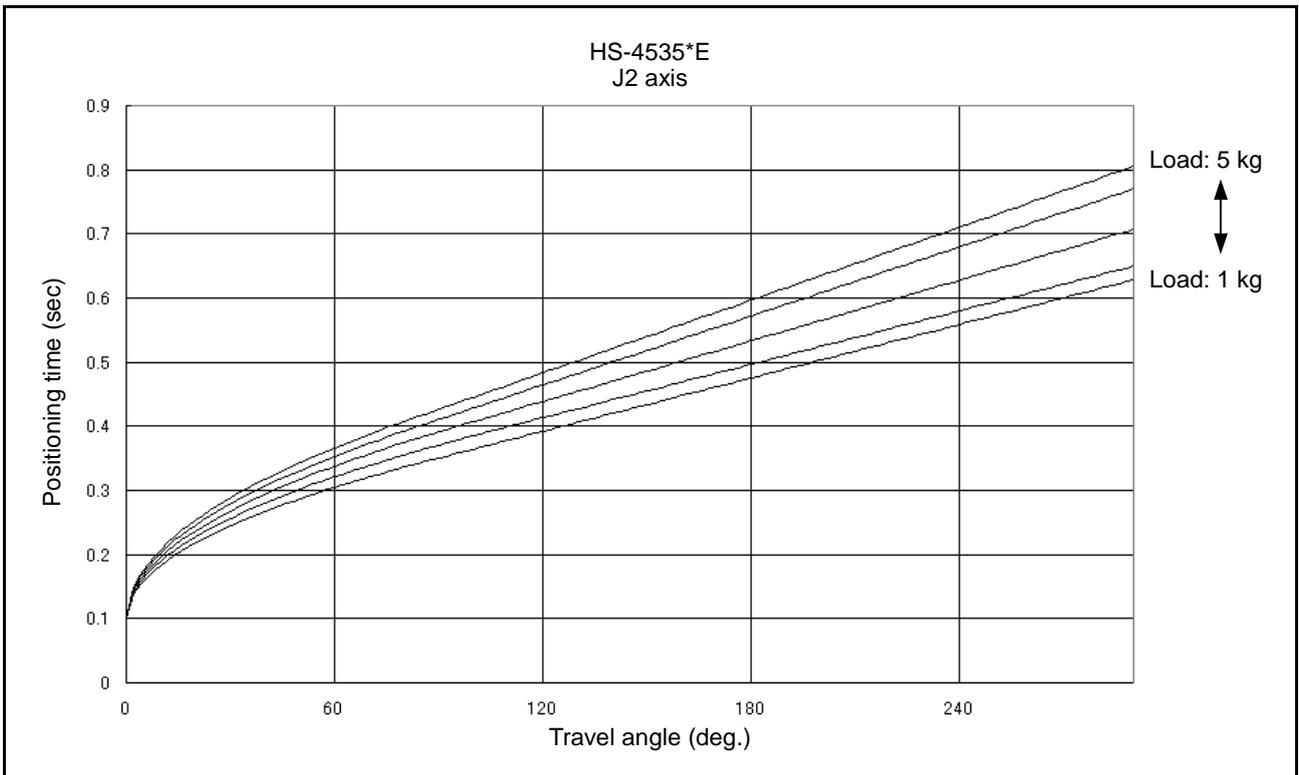


**J2 axis (PTP control) on the HS-4535\*E**

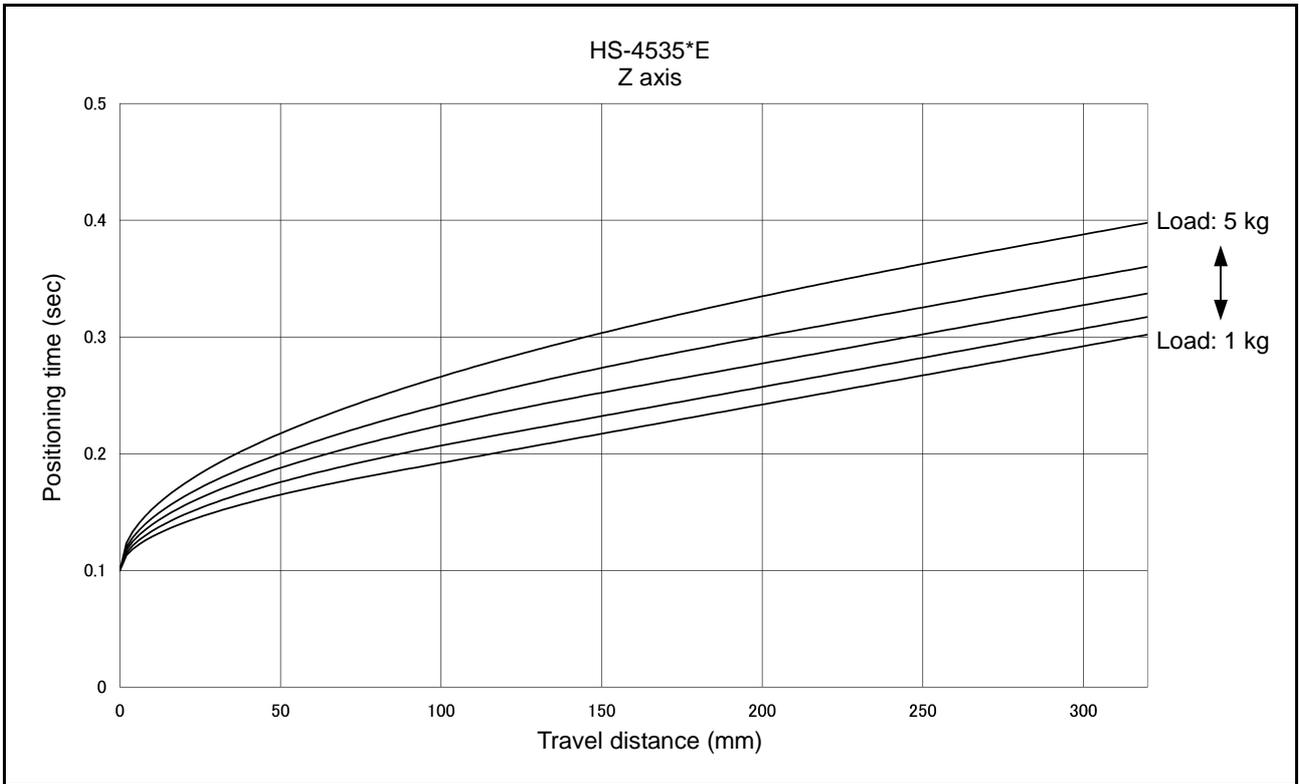

**Z axis (PTP control) on the HS-4535\*E**

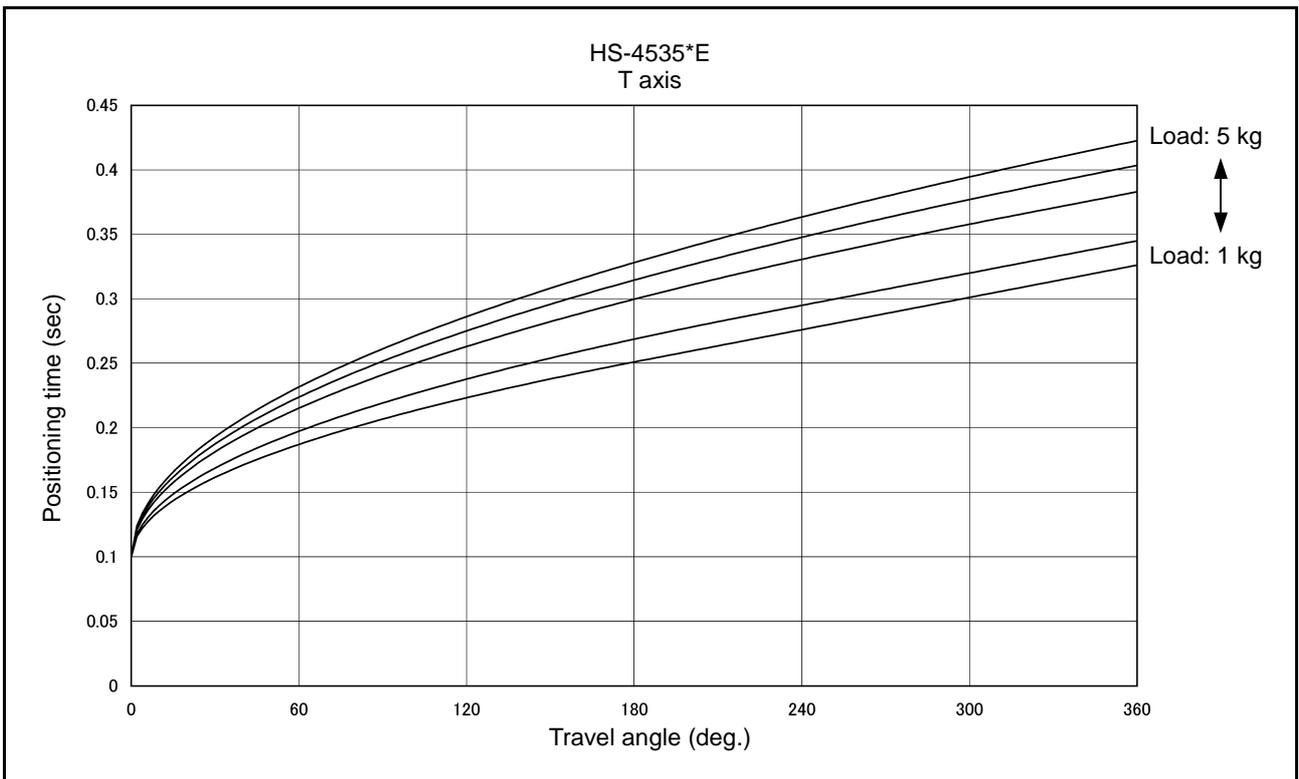


**T axis (PTP control) on the HS-4535\*E**

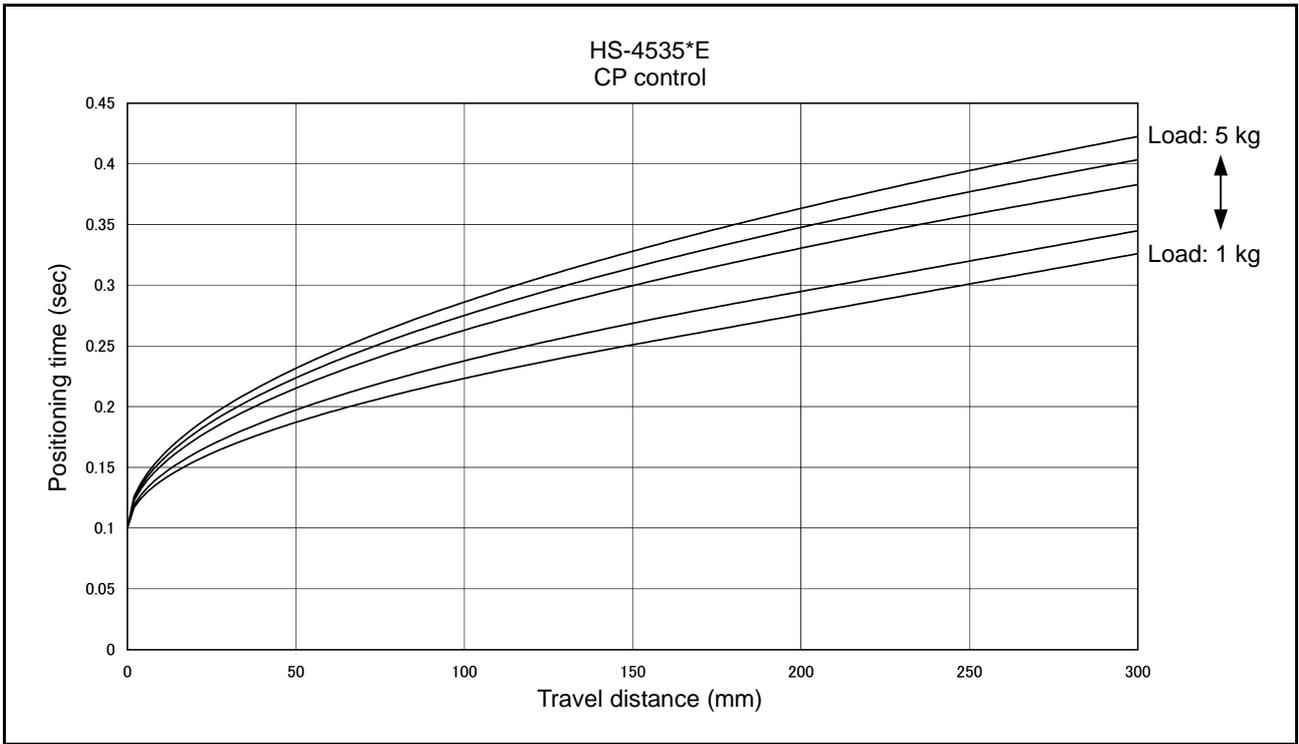


**CP control of all axes on the HS-4535\*E**


(2) HS/HSS-4545\*E

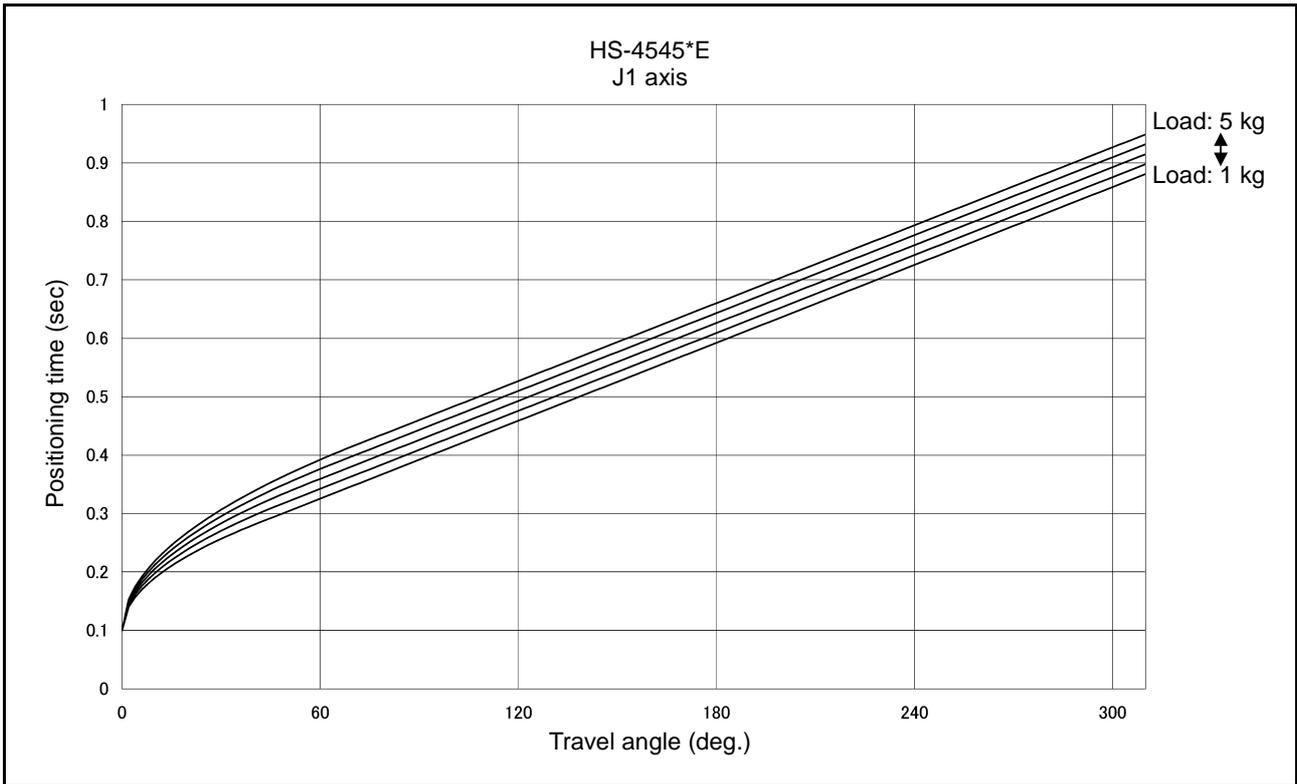


J1 axis (PTP motion) on the HS/HSS-4545\*E

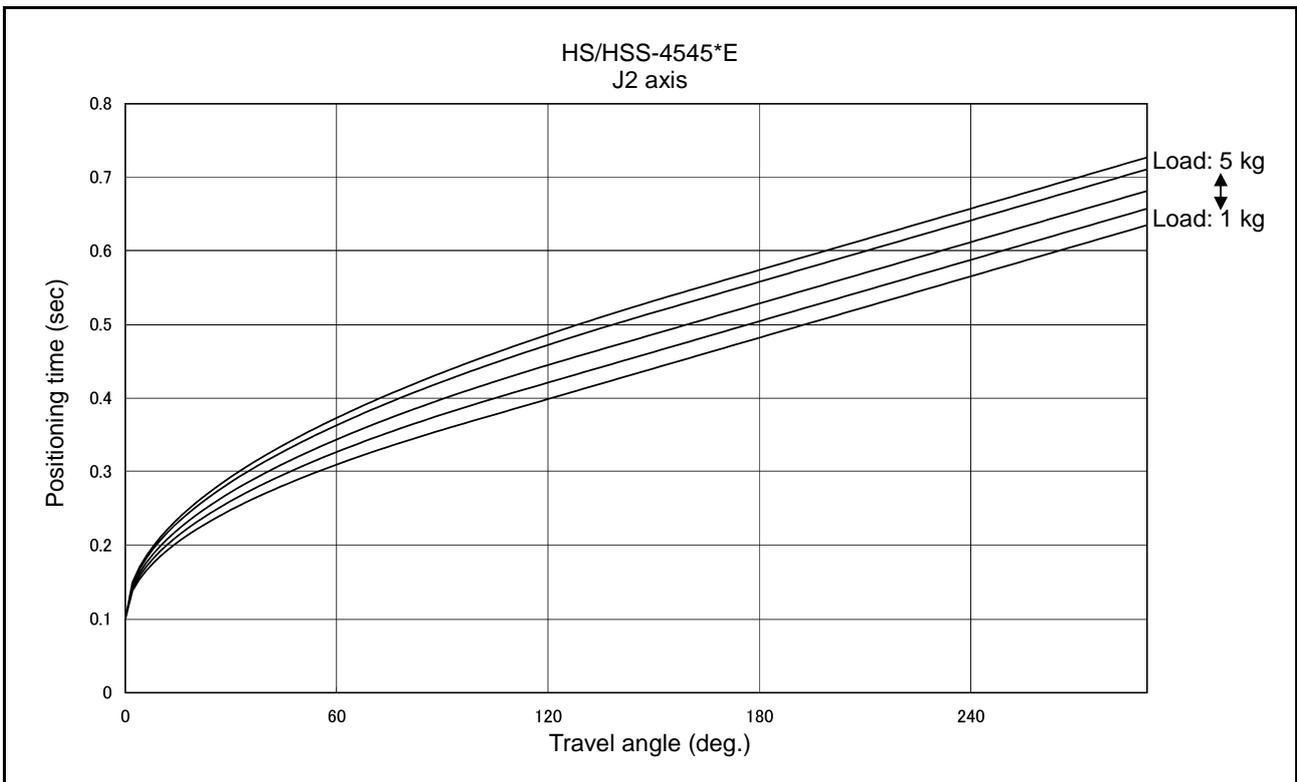


J2 axis (PTP control) on the HS/HSS-4545\*E

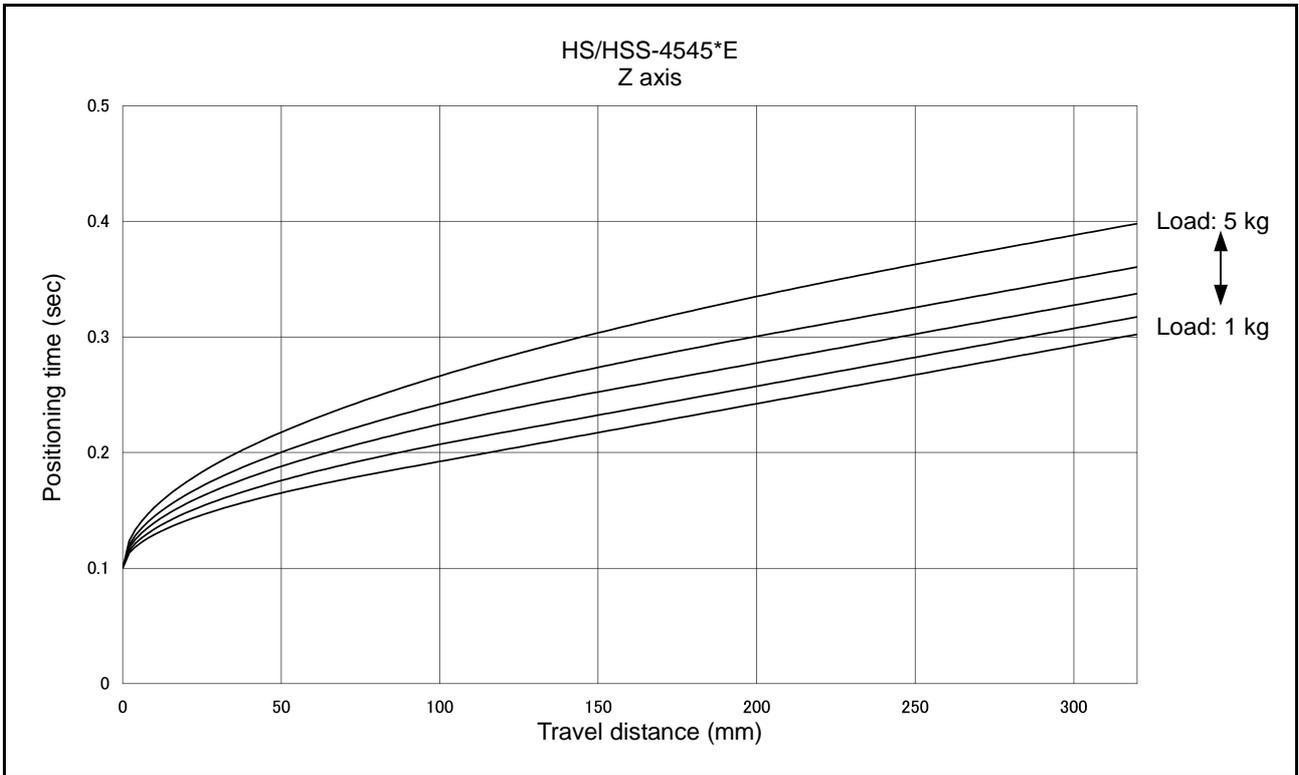

**Z axis (PTP control) on the HS/HSS-4545\*E**

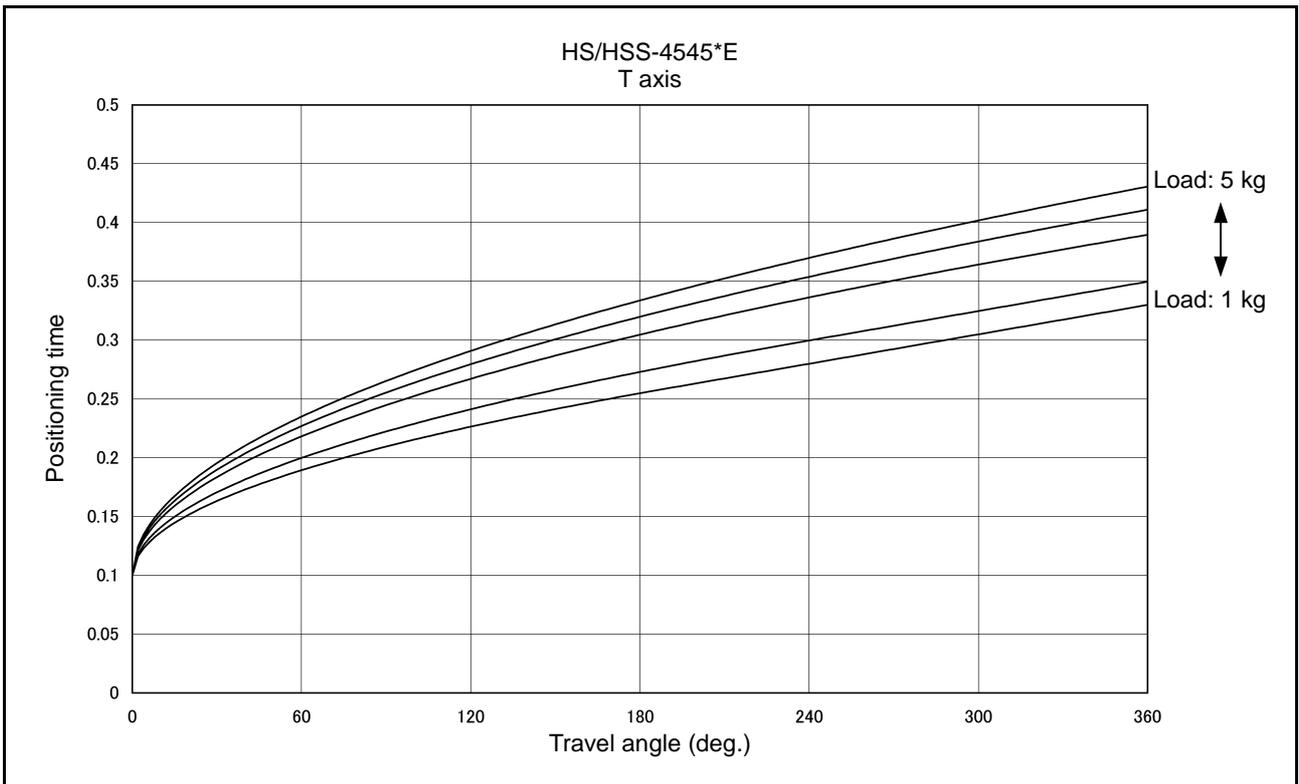


**T axis (PTP control) on the HS/HSS-4545\*E**

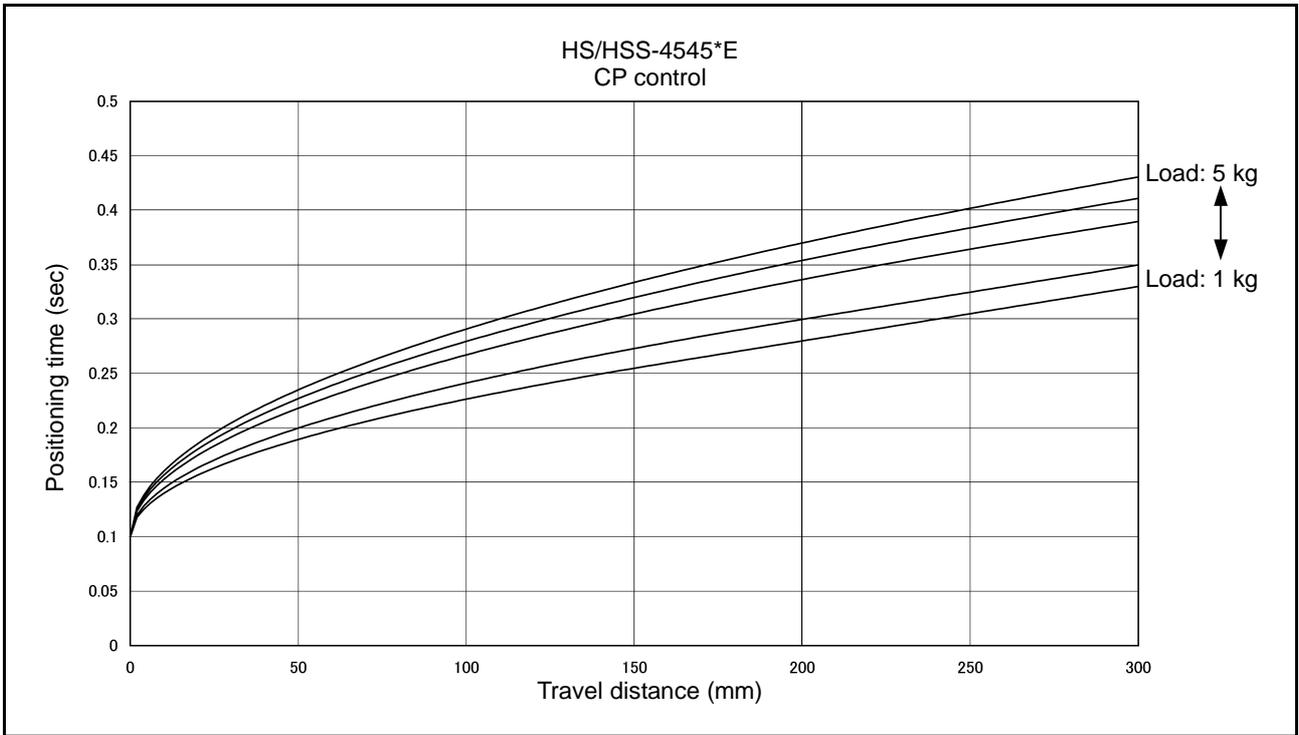


All axes (CP control) on the HS/HSS-4545\*E


(3) HS/HSS-4555\*E

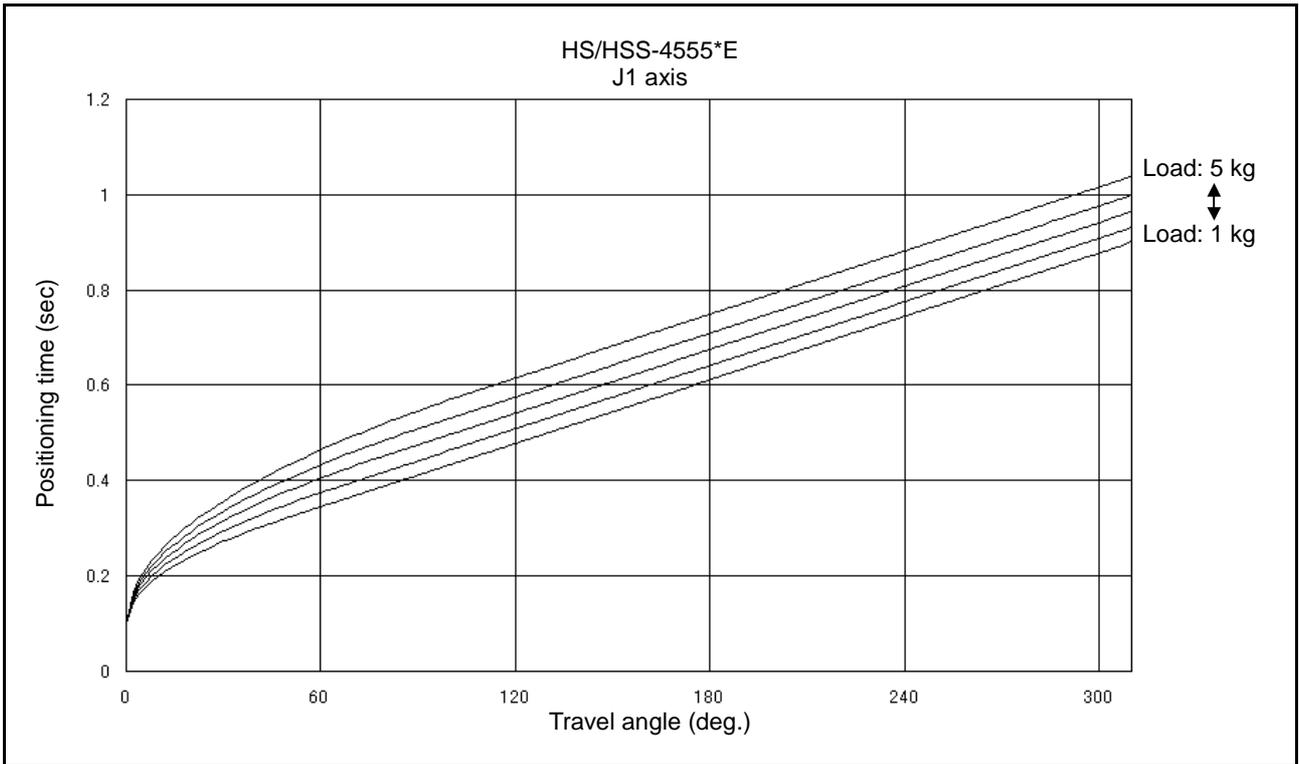


**J1 axis (PTP control) on the HS/HSS-4555\*E**

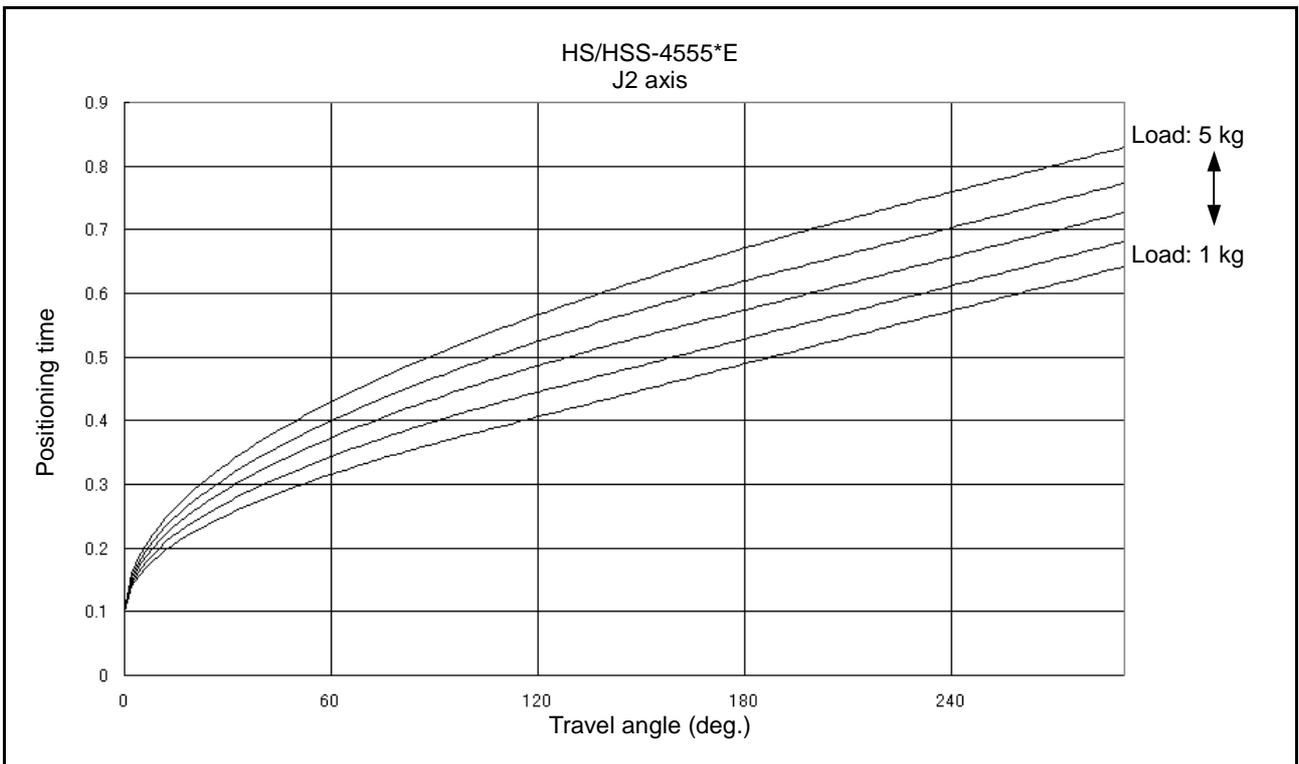


**J2 axis (PTP control) on the HS/HSS-4555\*E**

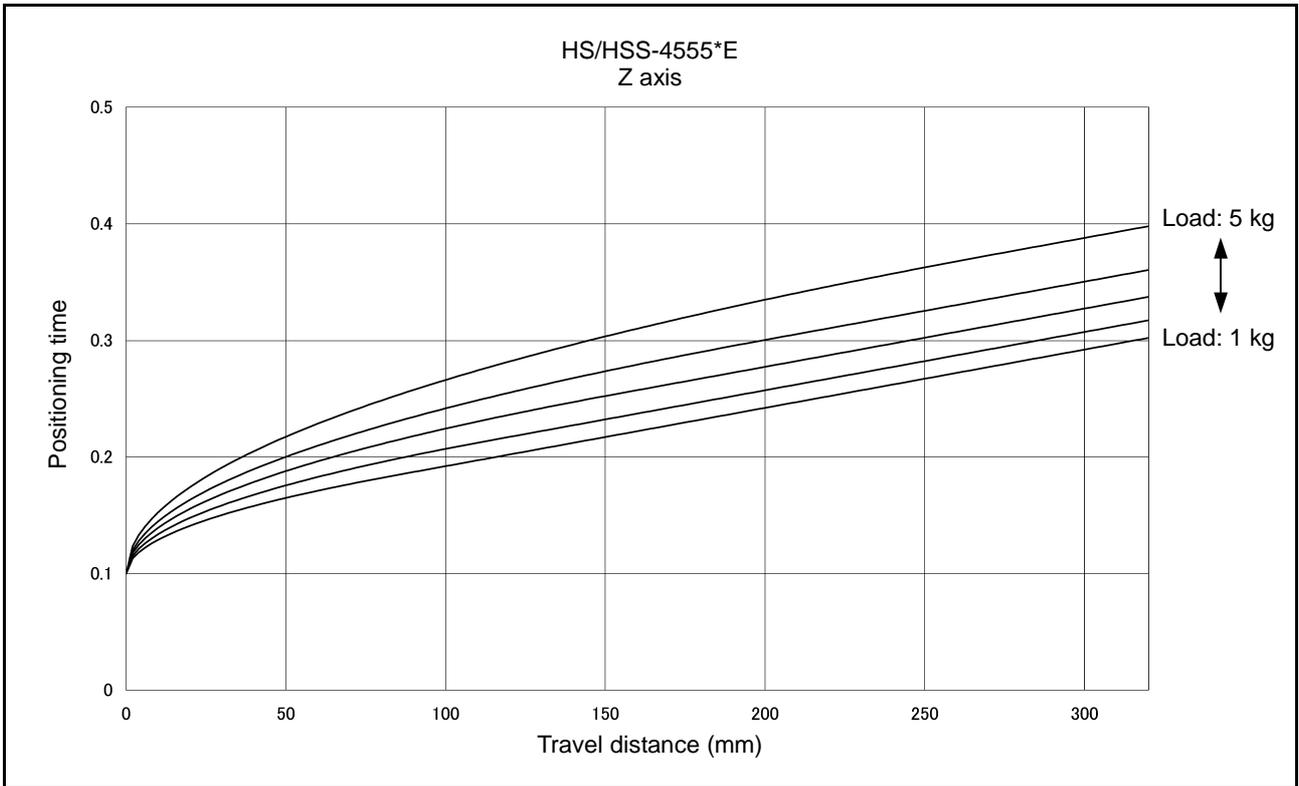

**Z axis (PTP control) on the HS/HSS-4555\*E**

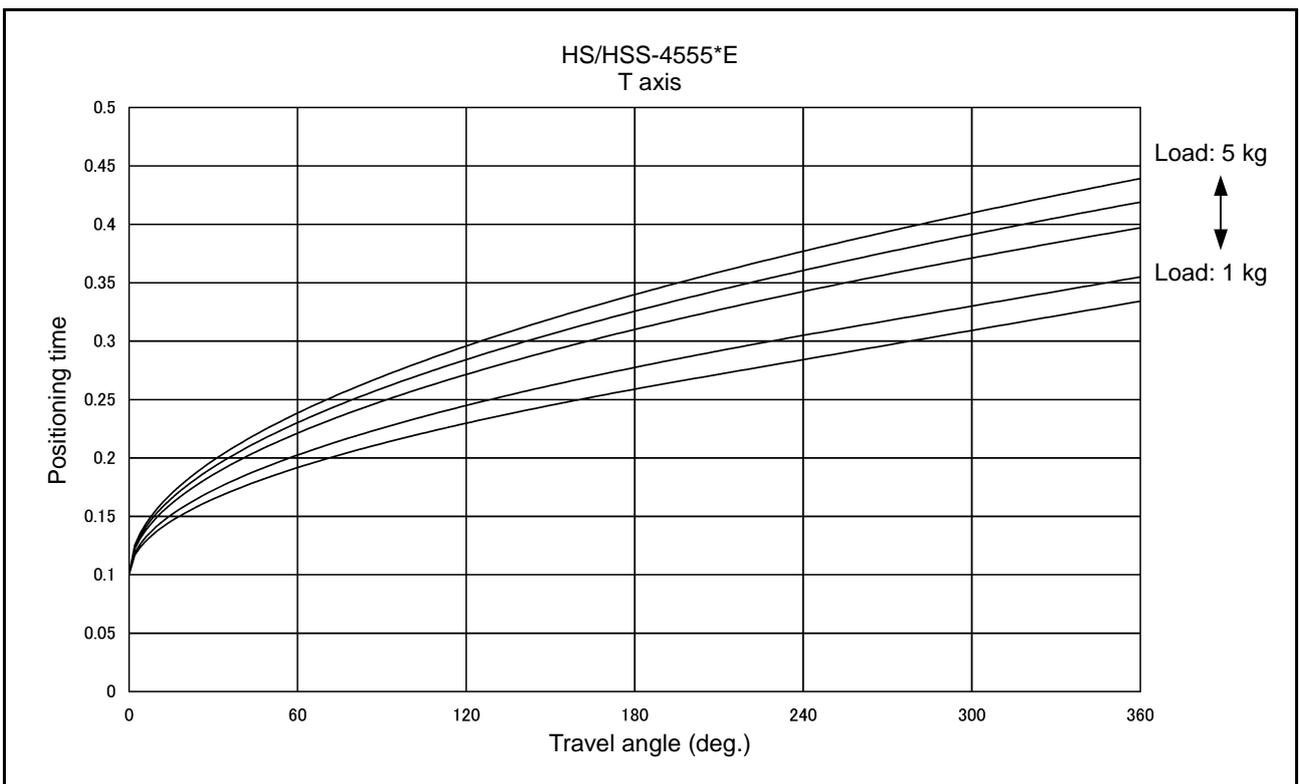

**T axis (PTP control) on the HS/HSS-4555\*E**

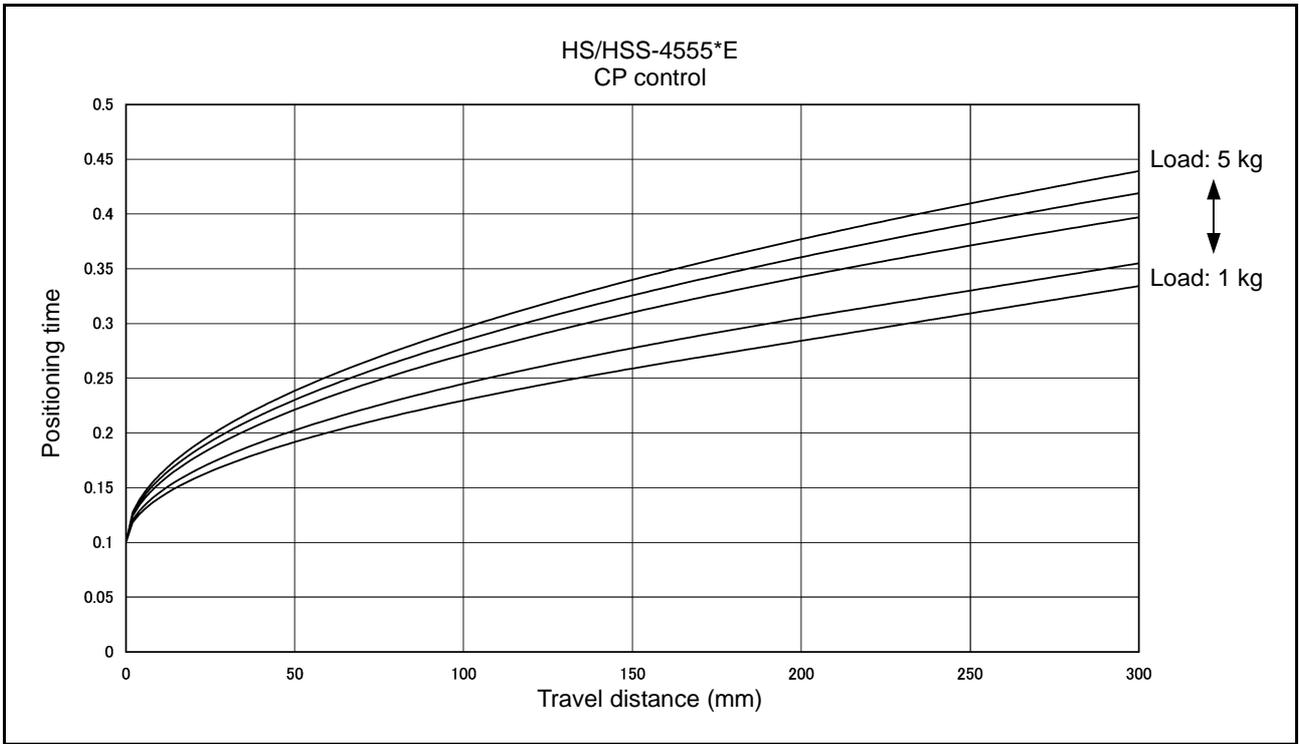

**All axes (CP control) on the HS/HSS-4555\*E**

### 3.1.4 Notes for setting the positioning speed (HS/HSS-E)

■ To be applied to all models of the HS-E series (Floor-mount type)

- (1) To horizontally traverse the robot arm at high speeds, teach the robot so that Z axis comes to be as close as possible to its upper end.
- (2) To stabilize positioning of Z axis near its lower end, the following maximum speed limiting control is automatically provided for J1 and J2 axes depending on the Z-axis coordinate value, only when the robot is moved under PTP control (MV, MVP, DRV, APR).

The positioning time of J1 and J2 axes becomes longer according to the maximum speed limit shown below.


$$\frac{\text{[Movement time in J1/J2 positioning time graphs (sec.)]}}{\text{Max. speed limit}} \times 100 \text{ (sec.)}$$

For example, when the robot arm moves by SP100 from the start point (Z-axis coordinate 26 mm) to the target point (Z-axis coordinated -74 mm), the maximum speed limits are as follows:

- 91 when Z-axis coordinate is 26 mm
- 50 when Z-axis coordinate is -74 mm

At this time, the maximum speed is the smaller value (at the lowest end) of 50.

Max. speed limit (Converted to SP value)

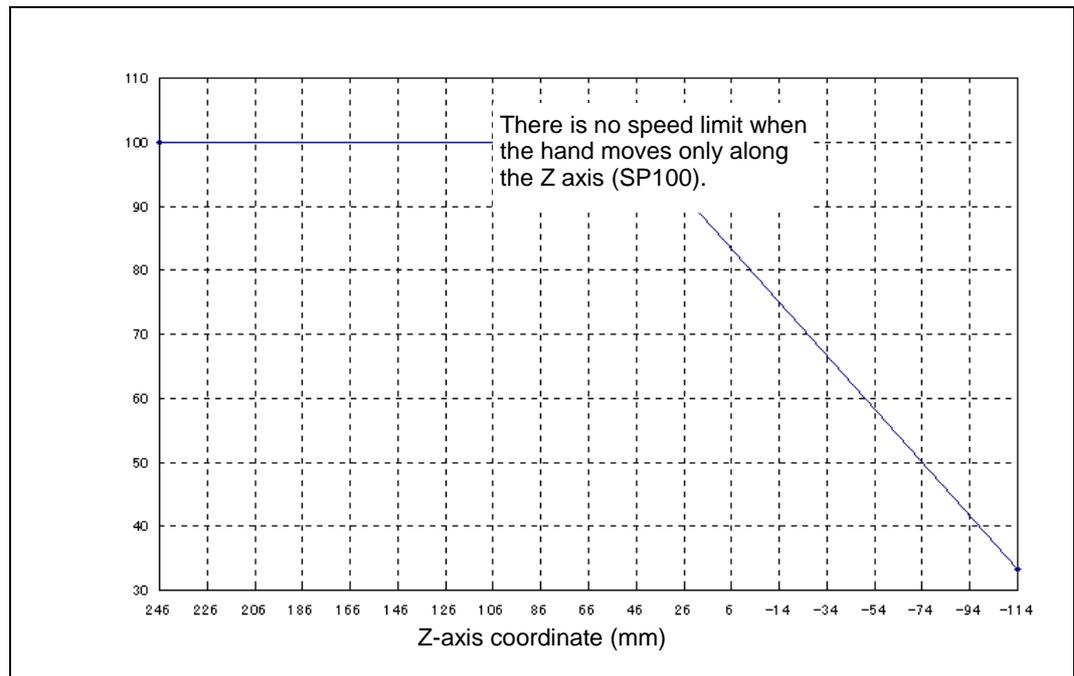

HS-E Series: Maximum Speed Limit on the J1 and J2 (PTP control)

■ To be applied to all models of the HSS-E series (Overhead-mount type)

- (1) To horizontally traverse the robot arm at high speeds, teach the robot so that Z axis comes to be as close as possible to its upper end.
- (2) To stabilize positioning of Z axis near its lower end, the following maximum speed limiting control is automatically provided for J1 and J2 axes depending on the Z-axis coordinate value, only when the robot is moved under PTP control (MV, MVP, DRV, APR).


The positioning time of J1 and J2 axes becomes longer according to the maximum speed limit shown below.

$$\frac{\text{[Movement time in J1/J2 positioning time graphs (sec.)]}}{\text{Max. speed limit}} \times 100 \text{ (sec.)}$$

For example, when the robot arm moves by SP100 from the start point (Z-axis coordinate -651 mm) to the target point (Z-axis coordinated -751 mm), the maximum speed limits are as follows:

- 91 when Z-axis coordinate is -651 mm
- 50 when Z-axis coordinate is -751 mm

At this time, the maximum speed is the smaller value (at the lowest end) of 50.

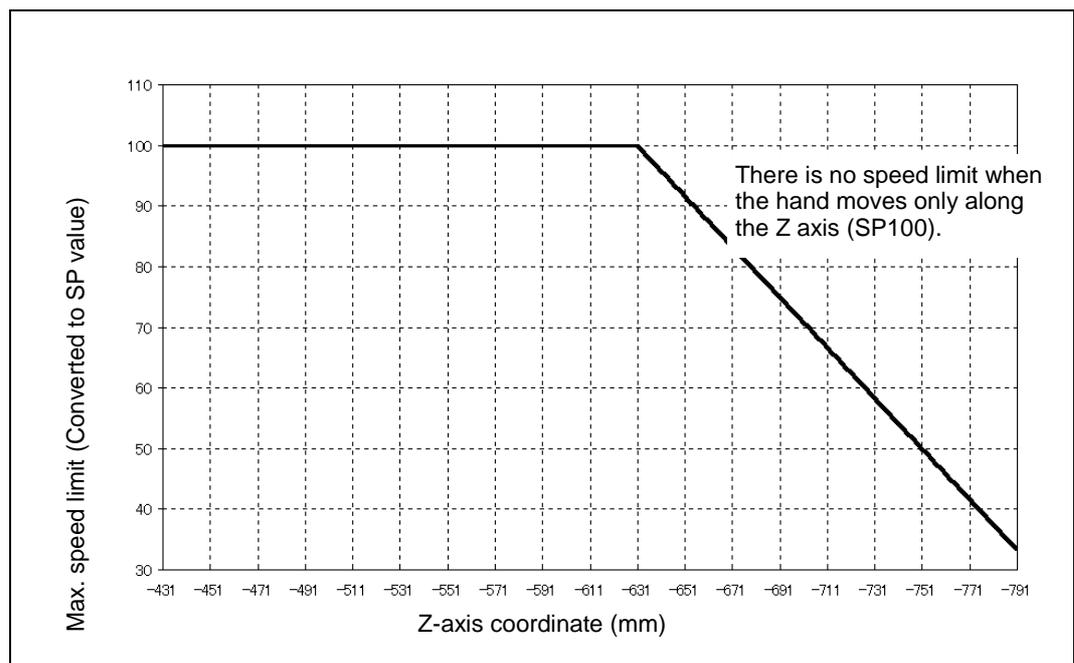

**HSS-E: Series Maximum Speed Limit on the J1 and J2 (PTP control)**

### 3.1.5 Air piping and signal wiring (HS/HSS-E)

The HS/HSS-E series is equipped with 4 air pipes ( $\phi 4 \times 2$  and  $\phi 6 \times 2$ ) for air chuck and 19 signal lines in the robot unit.

**HS-E series (Standard type)**

**View in direction of arrow (A)**

Brake release switch

AIR1 AIR2 AIR3 AIR4

BRAKE SW CN21

Air piping joints (M5)

Connector (CN21) for hand control signal wires

**CN21 pin layout**

**View in direction of arrow (B)**

Connector (CN20) for hand control signal wires

**CN20 pin layout**

Grounding terminal (M5)

(A)

(B)

Air No.	Air piping joint	Maximum allowable pressure
AIR 1, 2	$\phi 4$ , PT1/8	0.59 MPa
AIR 3, 4	$\phi 6$ , PT1/4	

Note 1: Pins #1 to #19 on CN21 and those on CN20 are connected with each other. The maximum rated current per line is 1A.


Note 2: Use the attached connector set for CN20 and CN21.

Connector set part No.	Part No.	Model and name	Appearance
410889-0070	410877-0170 (for CN20)	SRCN6A25-24S (Round connector) (Japan Aviation Electronics Industry Ltd.)	
	410877-0420 (for CN21)	JMSP2119M (Straight plug) (DDK Electronics, Inc.)	


#### Air Piping and Signal Wiring (Standard type)

**HS-E series (Dust-proof, splash-proof type or cleanroom type)**

View in direction of arrow (A)

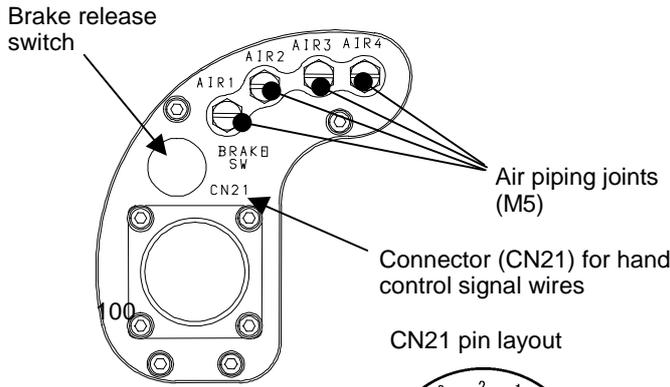


CN21 pin layout

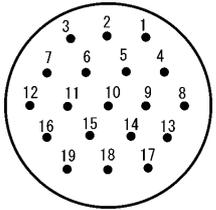



**Notes for cleanroom type**

- \*1 Recommended air inlet volume: 70 liters/min.  
The cleanroom type requires ventilation inside the robot. Exhaust air from the air vent provided in the bottom of the robot base.
- \*2 Dimension D at use points  
HS-4535\*E-P: 250 mm  
HS-4545\*E-P: 350 mm  
HS-4555\*E-P: 400 mm

View in direction of arrow (B)

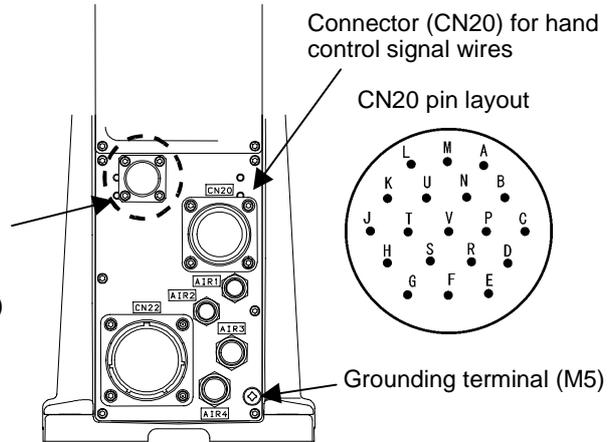

CN20 pin layout

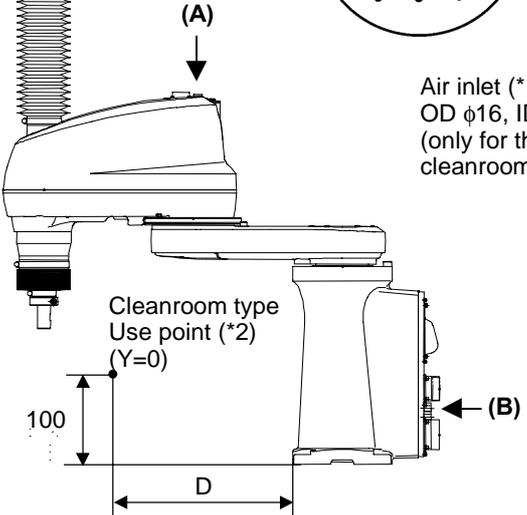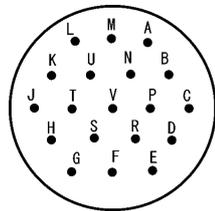

Air No.	Air piping joint	Maximum allowable pressure
AIR 1, 2	φ4, PT1/8	0.59 MPa
AIR 3, 4	φ6, PT1/4	

Note 1: Pins A to V on CN20 and pins #1 to #19 on CN21 are connected with each other as shown below. The maximum rated current per line is 1A.

CN20	A	B	C	D	E	F	G	H	J	K	L	M	N	P	R	S	T	U	V
CN21	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19

Note 2: Use the attached connector set for CN20 and CN21.

Connector set part No.	Part No.	Model and name	Appearance
410889-0080	410877-0120 (for CN20)	H/M3106A22-14S (Straight plug) (HIROSE ELECTRIC CO., LTD.)	
	410877-0130 (for CN20)	H/MS3057-12A (Cord clamp) (HIROSE ELECTRIC CO., LTD.)	Applicable wire diameter φ11.4 to 15.9
	410877-0140 (for CN20)	H/MS3057-12A1 (Cord clamp) (HIROSE ELECTRIC CO., LTD.)	Applicable wire diameter φ 8 to 11.6
	410877-0440 (for CN21)	EBSP2119M (Straight plug) (DDK Electronics, Inc.)	

**Air Piping and Signal Wiring (Dust-proof, splash-proof type or cleanroom type)**

### 3.1.6 Engineering-design Notes for Robot Hands (HS/HSS-E)

Design a hand (end-effector) so that it will satisfy conditions (1) and (2) described below.

**⚠ Caution:** Strictly observe these engineering-design notes. Otherwise, the clamped sections of the robot unit will become loose, rattle or be out of position. In the worst case, the mechanical parts of the robot unit and the robot controller may be damaged.

#### (1) Mass of hand


The total mass of a hand or tool (including work-piece) should be less than the maximum allowable payload of the robot. Be sure to include the mass of wirings and piping used for a hand or tool.

**Total mass of hand or tool (incl. Work-piece)  $\leq$  Max. allowable payload**

**NOTE:** The maximum allowable payload refers to a mass of payload that you have preset.

#### (2) Hand center of gravity

The center of gravity of a hand or tool (including work-piece) should be located within the range specified in Figure below.

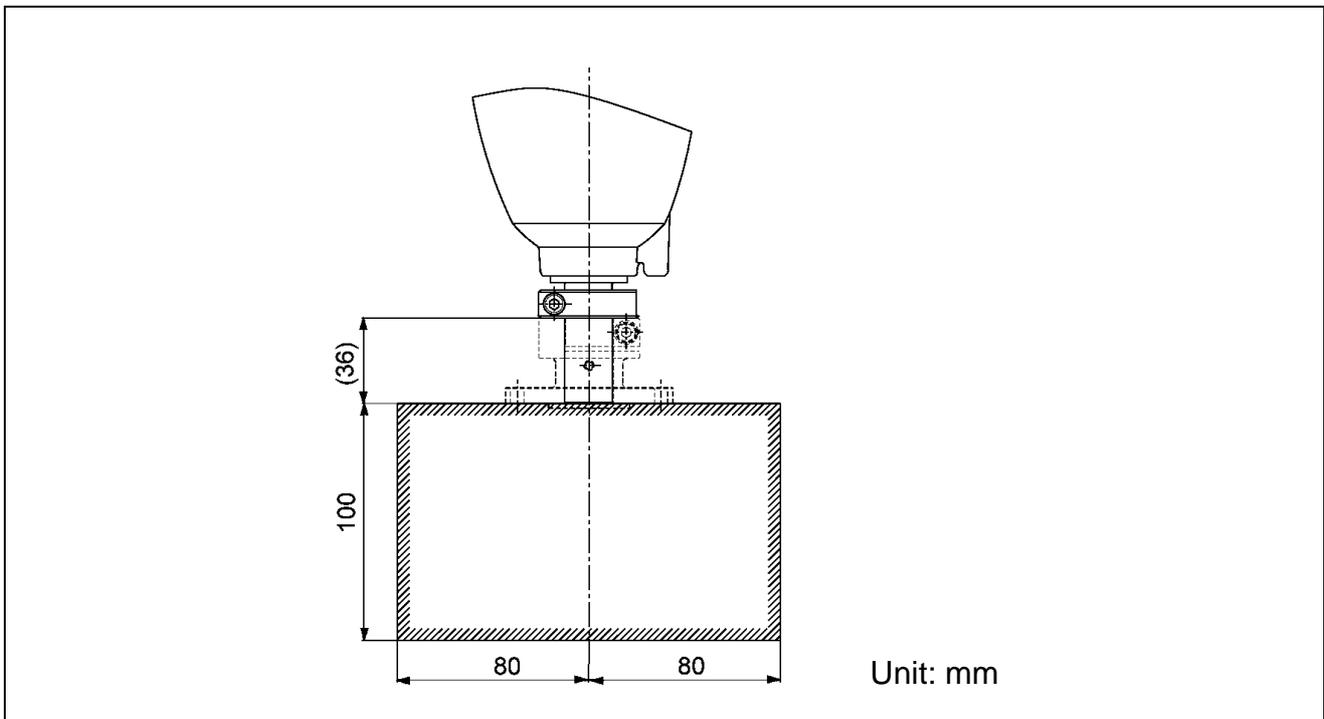

Hand center of gravity (HS/HSS-E)

### (3) Moment of inertia around the T axis

The moment of inertia of a hand or tool (including work-piece) around the T axis should be less than the maximum allowable moment of inertia around the T axis of the robot.

**Hand's moment of inertia (incl. Work-piece) around the T axis  $\leq$  Max. allowable moment of inertia**


Calculate the moment of inertia around the T axis according to the graph given below.

**NOTE:** You may program the reduced ratio of the speed and acceleration individually within the range specified below. If you set the reduced ratio of the programmed speed only, the controller automatically calculates that of the acceleration according to the formula below.

$$\text{Acceleration (\%)} = (\text{Speed}/100)^2 \times 100$$






Application sample of hand's moment of inertia

- To run the robot at 100% of the programmed speed and acceleration: The moment of inertia around the T axis should be 0.03 kgm<sup>2</sup> or less.
- If the moment of inertia around the T axis is 0.04 kgm<sup>2</sup>: Run the robot at 90% or less of the programmed speed and at 81% or less of the programmed acceleration.

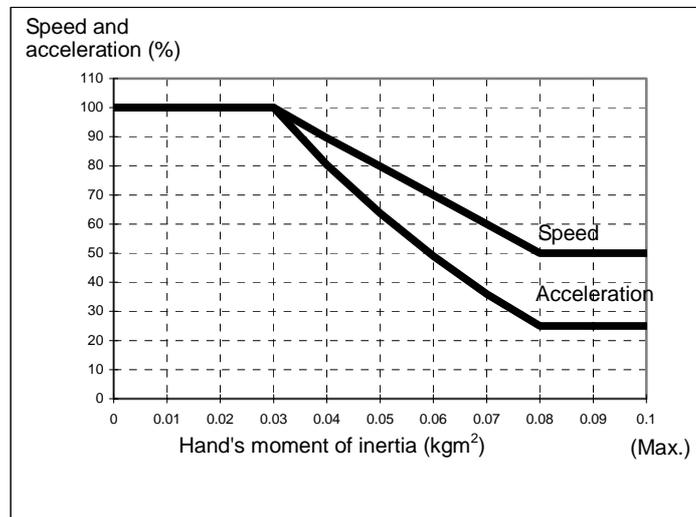


When calculating the hand's or tool's moment of inertia around the T axis, refer to the moment-of-inertia formulas on the next page.

**Moment-of-inertia Formulas**
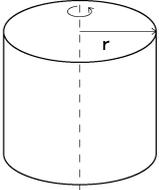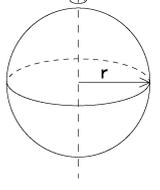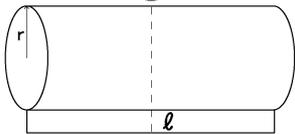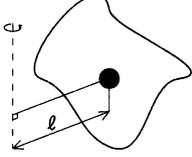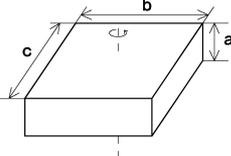
<p>1. Cylinder (1) (Axis of rotation = Center axis)</p>  $I = \frac{mr^2}{2}$	<p>4. Sphere (Axis of rotation = Center axis)</p>  $I = \frac{2mr^2}{5}$
<p>2. Cylinder (2) (The axis of rotation passes through the center of gravity.)</p>  $I = \frac{m}{4} \left( r^2 + \frac{l^2}{3} \right)$	<p>5. Center of gravity not on the axis of rotation. I<sub>g</sub>: Moment of inertia around center of gravity</p>  $I = I_g + m l^2$ <p>[kgm<sup>2</sup>]</p>
<p>3. Rectangular parallelepiped (The axis of rotation passes through the center of gravity.)</p>  $I = \frac{m}{12} (b^2 + c^2)$	<p>                 I: Moment of inertia [kgm<sup>2</sup>]                  m: Mass [kg]                  r: Radius [m]                  a, b, c, l: Length [m]             </p>

Calculation example : When calculating the moment of inertia of a complicated shape, divide it into simple parts as much as possible for easier calculations.  
As shown in the figure below, divide the hand into three parts ( (1), (2), (3) ).

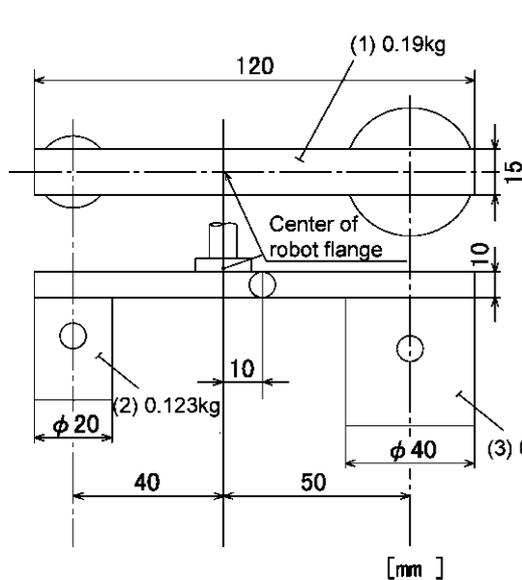

Moment of inertia around T-axis of (1): I<sub>1</sub> (from 3 and 5 in the above table)

$$I_1 = \frac{0.19}{12} (0.12^2 + 0.015^2) + 0.19 \times 0.01^2 = 2.51 \times 10^{-4} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of (2): I<sub>2</sub> (from 1 and 5 in the above table)

$$I_2 = \frac{0.123 \times 0.01^2}{2} + 0.123 \times 0.04^2 = 2.03 \times 10^{-4} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of (3): I<sub>3</sub> (from 1 and 5 in the above table)

$$I_3 = \frac{0.98 \times 0.02^2}{2} + 0.98 \times 0.05^2 = 2.65 \times 10^{-3} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of entire hand: I

$$I = I_1 + I_2 + I_3 = 0.003 \text{ [kgm}^2 \text{]}$$

**Calculation Example of Hand's Moment of Inertia Around the T Axis**

## 3.2 HM/HMS-E series

### 3.2.1 Specifications (HM/HMS-E2 series)

The table below lists the specifications of the HM/HMS-E2 series robot unit.

**NOTE:** The second arm of the HM-E series robot was modified, and also, the model name of the robot was changed to the HM-E2 series from the HM-E series at August 2003.

#### (1) HM-E2 Series Robot Unit (floor-mount, standard type)

Item		Specifications							
Model name of robot set (Note 1)		HM-4060 *E2	HM-4A60 *E2	HM-4070* E2	HM-4A70* E2	HM-4085 *E2	HM-4A85 *E2	HM-40A0 *E2	HM-4AA0 *E2
Model name of robot unit		HM-4060 *E2M	HM-4A60 *E2M	HM-4070* E2M	HM-4A70* E2M	HM-4085 *E2M	HM-4A85 *E2M	HM-40A0 *E2M	HM-4AA0 *E2M
Overall arm length		250(J1: 1st axis) + 350 (J2: 2nd axis) = 600 mm		350(J1: 1st axis) + 350 (J2: 2nd axis) = 700 mm		350(J1: 1st axis) + 500 (J2: 2nd axis) = 850 mm		500(J1: 1st axis) + 500 (J2: 2nd axis) = 1000 mm	
Motion angle and stroke	J1 (1st axis)	±165°							
	J2 (2nd axis)	±143°		±147°					
	Z-axis (3rd axis) vertical stroke*	200 mm if * = 2, 300 mm if * = 3, 400 mm if * = 4							
	Wrist rotation angle T (4th axis)	±360°							
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)							
Maximum payload		10 kg	20 kg	10 kg	20 kg	10 kg	20 kg	10 kg	20 kg
Composite speed	At the center of the hand mounting flange	8,800 mm/s		9,700 mm/s		11,000 mm/s		11,500 mm/s	
	Z	2,760 mm/s				2,300 mm/s		2,110 mm/s	
	T	2220° /s	1540° /s	2220° /s	1540° /s	2220° /s	1540° /s	2220° /s	1540° /s
Position repeatability (Note 2)	J1 + J2	±0.02 mm				±0.025 mm			
	Z	±0.01 mm							
	T	±0.005°							
Maximum force-fit		98N (one second or less)							
Maximum allowable moment of inertia around T axis		0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)
Position detection		Absolute encoder							
Drive motor and brake		AC servomotors for all axes Air balanced cylinder for Z axis (3rd axis) Brakes for Z axis (3rd axis) and T axis							
User air piping		4 systems (φ6)							
User signal lines		24 (for proximity sensor signals, etc.)							
Air source	Operating pressure	0.05 to 0.35 MPa							
	Maximum allowable pressure	0.59 MPa							
Weight		Approx. 50 kg							

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.

(Note 2) Value at the constant ambient temperature

## (2) HM-E2-W Series Robot Unit (floor-mount, dust-proof &amp; splash type)

Item		Specifications							
Model name of robot set (Note 1)		HM-4060 *E2-W	HM-4A60 *E2-W	HM-4070* E2-W	HM-4A70* E2-W	HM-4085 *E2-W	HM-4A85 *E2-W	HM-40A0 *E2-W	HM-4AA0 *E2-W
Model name of robot unit		HM-4060 *E2M-W	HM-4A60 *E2M-W	HM-4070* E2M-W	HM-4A70* E2M-W	HM-4085 *E2M-W	HM-4A85 *E2M-W	HM-40A0 *E2M-W	HM-4AA0 *E2M-W
Overall arm length		250(J1: 1st arm) + 350 (J2: 2nd arm) = 600 mm		350(J1: 1st arm) + 350 (J2: 2nd arm) = 700 mm		350(J1: 1st arm) + 500 (J2: 2nd arm) = 850 mm		500(J1: 1st arm) + 500 (J2: 2nd arm) = 1000 mm	
Motion angle and stroke	J1 (1st axis)	±165°							
	J2 (2nd axis)	±140°		±146°		±147°			
	Z-axis (3rd axis) vertical stroke*	200 mm if * = 2, 300 mm if * = 3, 400 mm if * = 4							
	Wrist rotation angle T (4th axis)	±360°							
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)							
Maximum payload		10 kg	20 kg	10 kg	20 kg	10 kg	20 kg	10 kg	20 kg
Composite speed	At the center of the hand mounting flange	7,900 mm/s		8,700 mm/s		9,900 mm/s		10,300 mm/s	
	Z	1,322 mm/s							
	T	2220° /s	1540° /s	2220° /s	1540° /s	2220° /s	1540° /s	2220° /s	1540° /s
Position repeatability (Note 2)	J1 + J2	±0.02 mm				±0.025 mm			
	Z	±0.01 mm							
	T	±0.005°							
Maximum force-fit		98N (one second or less)							
Maximum allowable moment of inertia around T axis		0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)
Position detection		Absolute encoder							
Drive motor and brake		AC servomotors for all axes Brakes for Z axis (3rd axis) and T axis							
User air piping		4 systems (φ6)							
User signal lines		24 (for proximity sensor signals, etc.)							
Air source	Operating pressure	0.05 to 0.35 MPa							
	Maximum allowable pressure	0.59 MPa							
Degree of protection		IP65							
Weight		Approx. 50 kg							

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.

(Note 2) Value at the constant ambient temperature

### (3) HMS-E2 Series Robot Unit (overhead-mount, standard type)

Item		Specifications			
Model name of robot set (Note 1)		HMS-4070*E2	HMS-4A70*E2	HMS-4085*E2	HMS-4A85*E2
Model name of robot unit		HMS-4070*E2M	HMS-4A70*E2M	HMS-4085*E2M	HMS-4A85*E2M
Overall arm length		350(J1: 1st axis) + 350 (J2: 2nd axis) = 700 mm		350(J1: 1st axis) + 500 (J2: 2nd axis) = 850 mm	
Motion angle and stroke	J1 (1st axis)	±165°			
	J2 (2nd axis)	±145°		±142°	
	Z-axis (3rd axis) vertical stroke*	200 mm if * = 2, 300 mm if * = 3, 400 mm if * = 4			
	Wrist rotation angle T (4th axis)	±360°			
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)			
Maximum payload		10 kg	20 kg	10 kg	20 kg
Composite speed	At the center of the hand mounting flange	9,700 mm/s		11,000 mm/s	
	Z	2,760 mm/s		2,300 mm/s	2,110 mm/s
	T	2220° /s	1540° /s	2220° /s	1540° /s
Position repeatability (Note 2)	J1 + J2	±0.02 mm		±0.025 mm	
	Z	±0.01 mm			
	T	±0.005°			
Maximum force-fit		98N (one second or less)			
Maximum allowable moment of inertia around T axis		0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)
Position detection		Absolute encoder			
Drive motor and brake		AC servomotors for all axes Air balanced cylinder for Z axis (3rd axis) Brakes for Z axis (3rd axis) and T axis			
User air piping		4 systems (φ6)			
User signal lines		24 (for proximity sensor signals, etc.)			
Air source	Operating pressure	0.05 to 0.35 MPa			
	Maximum allowable pressure	0.59 MPa			
Weight		Approx. 50 kg			

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.

(Note 2) Value at the constant ambient temperature

**(4) HMS-E2-W Series Robot Unit (overhead-mount, dust-proof & splash type)**

Item		Specifications			
Model name of robot set (Note 1)		HMS-4070*E2-W	HMS-4A70*E2-W	HMS-4085*E2-W	HMS-4A85*E2-W
Model name of robot unit		HMS-4070*E2M-W	HMS-4A70*E2M-W	HMS-4085*E2M-W	HMS-4A85*E2M-W
Overall arm length		350(J1: 1st arm) + 350 (J2: 2nd arm) = 700 mm		350(J1: 1st arm) + 500 (J2: 2nd arm) = 850 mm	
Motion angle and stroke	J1 (1st axis)	±165°			
	J2 (2nd axis)	±142°			
	Z-axis (3rd axis) vertical stroke*	200 mm if * = 2, 300 mm if * = 3, 400 mm if * = 4			
	Wrist rotation angle T (4th axis)	±360°			
Axis combination		J1 (1st axis) + J2 (2nd axis) + Z (3rd axis) + T (4th axis)			
Maximum payload		10 kg	20 kg	10 kg	20 kg
Composite speed	At the center of the hand mounting flange	8,700 mm/s		9,900 mm/s	
	Z	1,322 mm/s			
	T	2220° /s	1540° /s	2220° /s	1540° /s
Position repeatability (Note 2)	J1 + J2	±0.02 mm		±0.025 mm	
	Z	±0.01 mm			
	T	±0.005°			
Maximum force-fit		98N (one second or less)			
Maximum allowable moment of inertia around T axis		0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)	0.25 kgm <sup>2</sup> (with 10 kg)	0.45 kgm <sup>2</sup> (with 20 kg)
Position detection		Absolute encoder			
Drive motor and brake		AC servomotors for all axes Brakes for Z axis (3rd axis) and T axis			
User air piping		4 systems (φ6)			
User signal lines		24 (for proximity sensor signals, etc.)			
Air source	Operating pressure	0.05 to 0.35 MPa			
	Maximum allowable pressure	0.59 MPa			
Degree of protection		IP65			
Weight		Approx. 50 kg			

(Note 1) The model name of robot set refers to the model of a complete set including a robot unit and robot controller. An asterisk (\*) in model names denotes the Z-axis stroke.


(Note 2) Value at the constant ambient temperature

### 3.2.2 Outer Dimensions and Workable Space of the Robot Unit (HM/HMS-E2)

The figure below shows the outer dimensions and workable space of the HM/HMS-E2 series.

**NOTE:** The second arm of the HM-E series robot was modified, and also, the model name of the robot was changed to the HM-E2 series from the HM-E series at August 2003.


#### (1) HM-E2 Series Robot Unit (floor-mount, standard type)

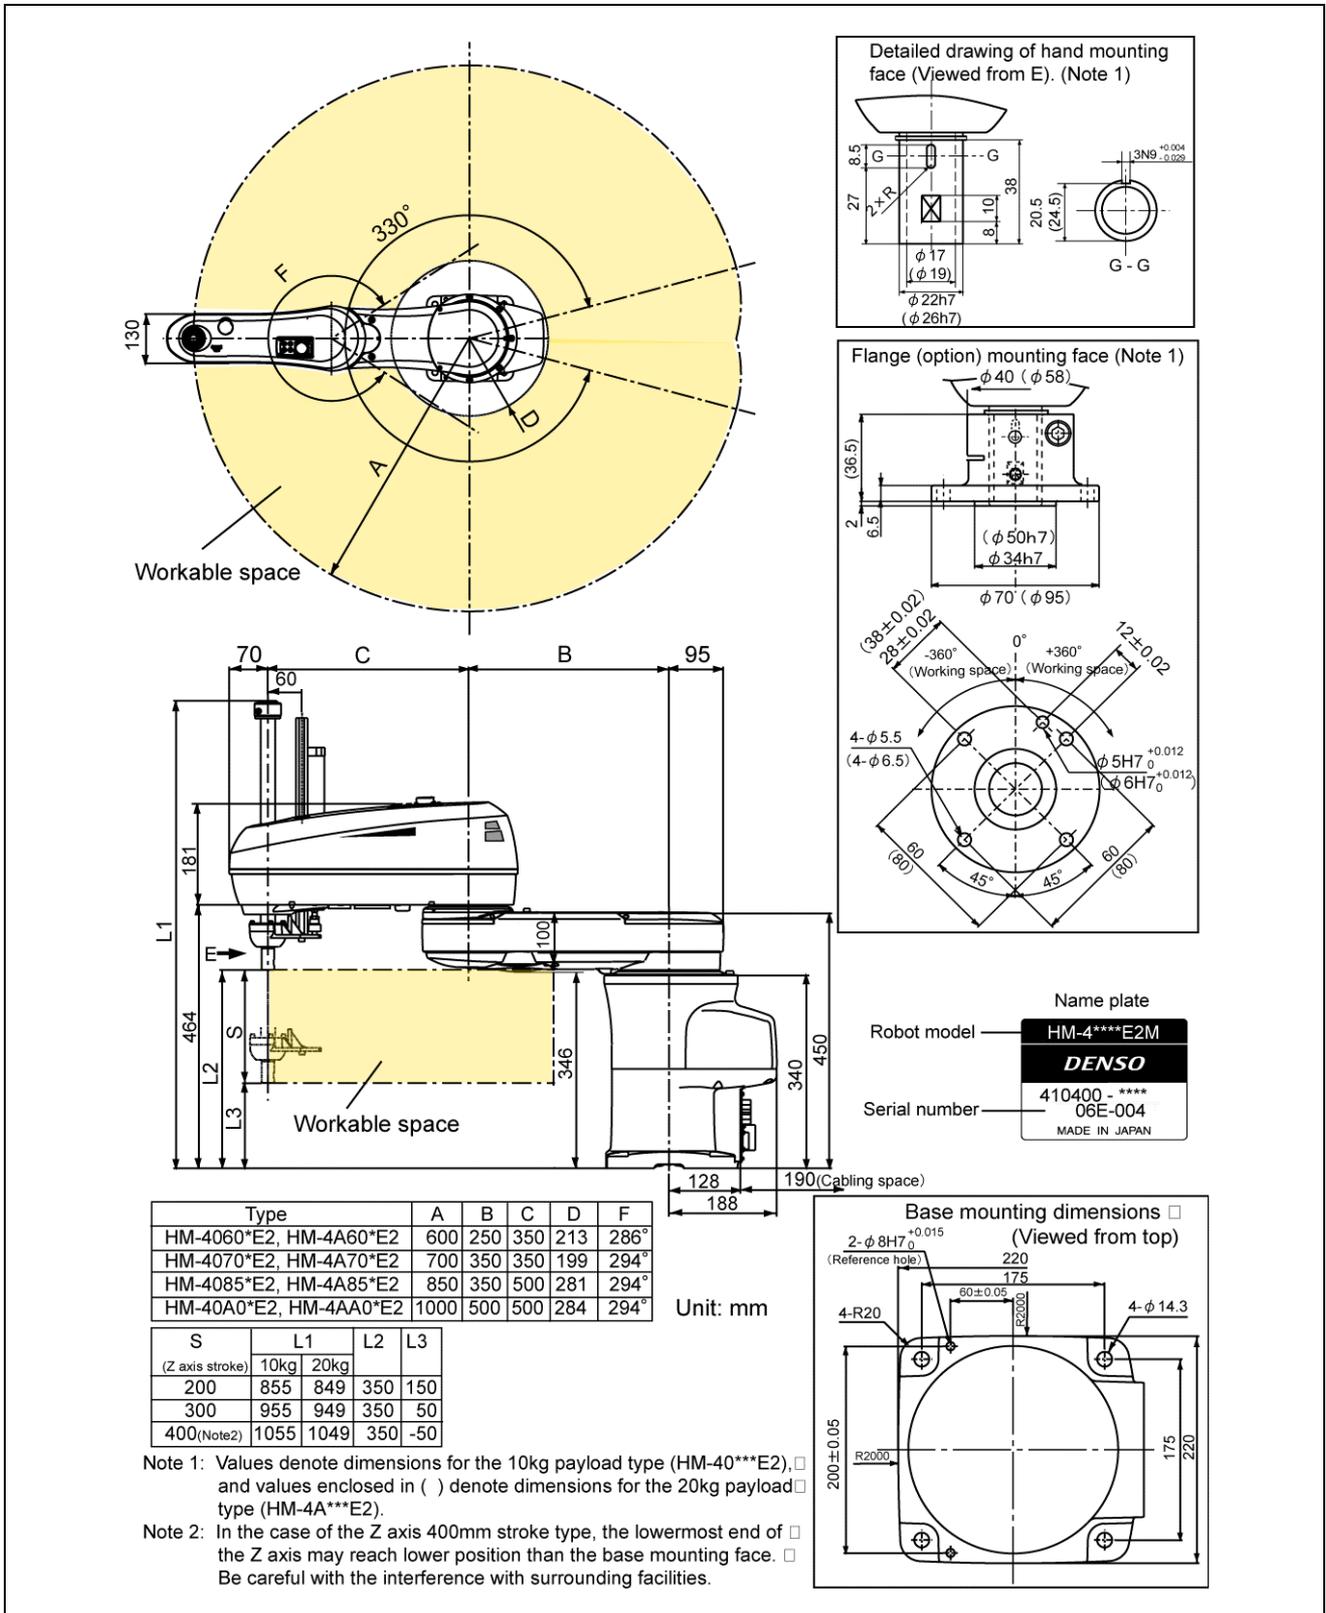


Outer dimensions and workable space (HM-E2)

(2) HM-E2-W Series Robot Unit (floor-mount, dust-proof & splash type)


Workable space

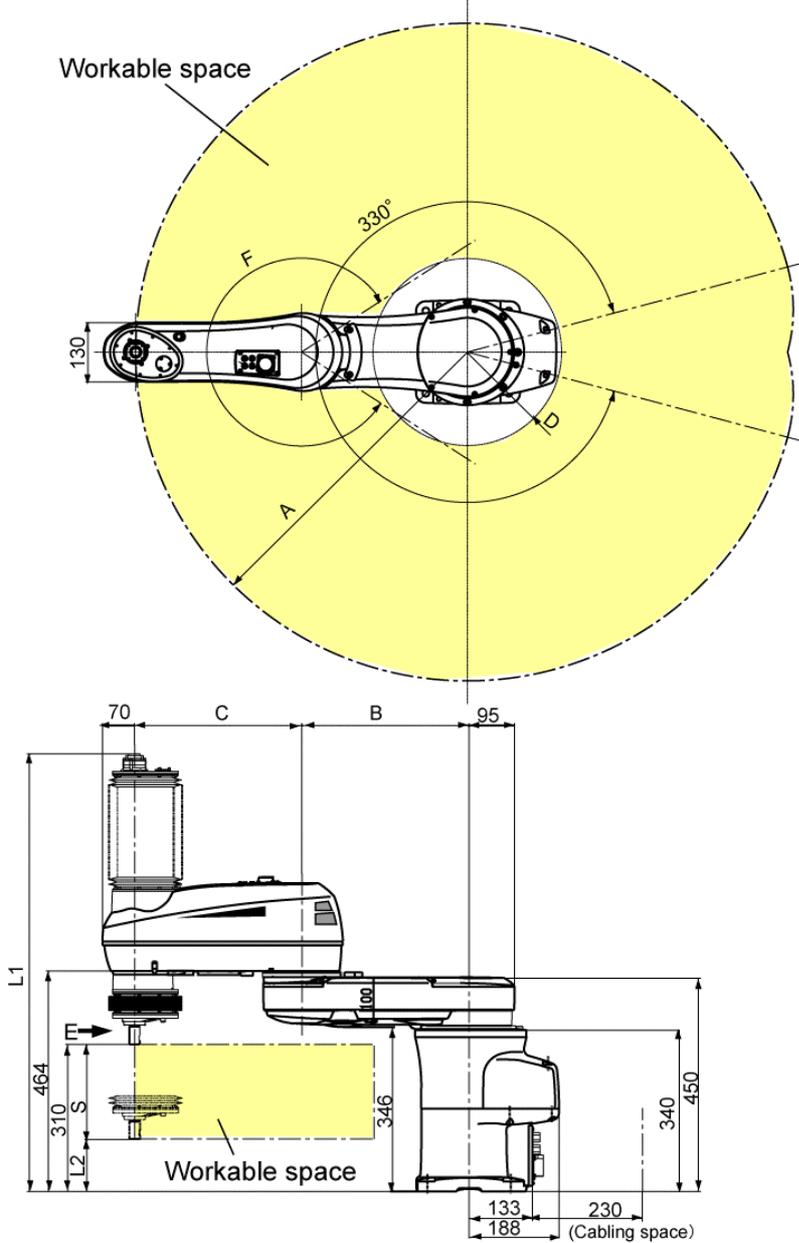

Detailed drawing of hand mounting face (Viewed from E). (Note 1)

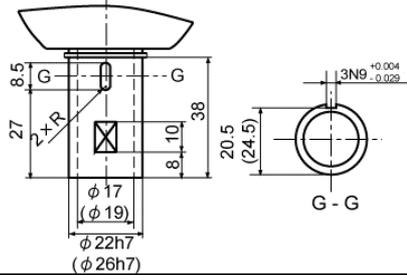

Flange (option) mounting face (Note 1)

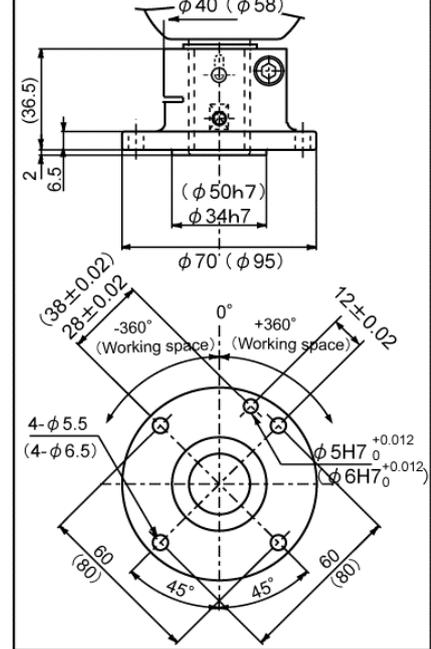

Name plate

Robot model	HM-4***E2M-W
<b>DENSO</b>	
Serial number	410400 - *** 06E-004
MADE IN JAPAN	

Unit: mm


Type	A	B	C	D	F
HM-4060*E2-W, HM-4A60*E2-W	600	250	350	226	280°
HM-4070*E2-W, HM-4A70*E2-W	700	350	350	205	292°
HM-4085*E2-W, HM-4A85*E2-W	850	350	500	281	294°
HM-40A0*E2-W, HM-4AA0*E2-W	1000	500	500	284	294°

S (Z axis stroke)	L1	L2
200	925	110
300	1025	10
400 (Note2)	1125	-90

Note 1: Values denote dimensions for the 10kg payload type (HM-40\*\*\*E2-W), and values enclosed in ( ) denote dimensions for the 20kg payload type (HM-4A\*\*\*E2-W).


Note 2: In the case of the Z axis 400mm stroke type, the lowermost end of the Z axis may reach lower position than the base mounting face. Be careful with the interference with surrounding facilities.

Base mounting dimensions (Viewed from top)

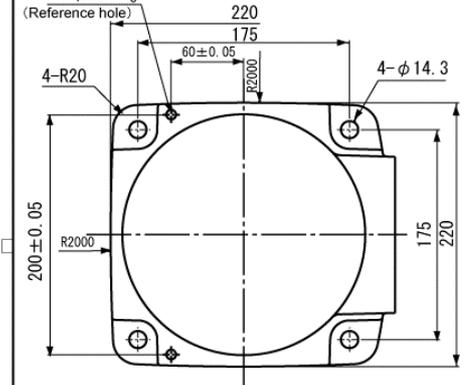

Outer dimensions and workable space (HM-E2-W)


### (3) HMS-E2 Series Robot Unit (overhead-mount, standard type)

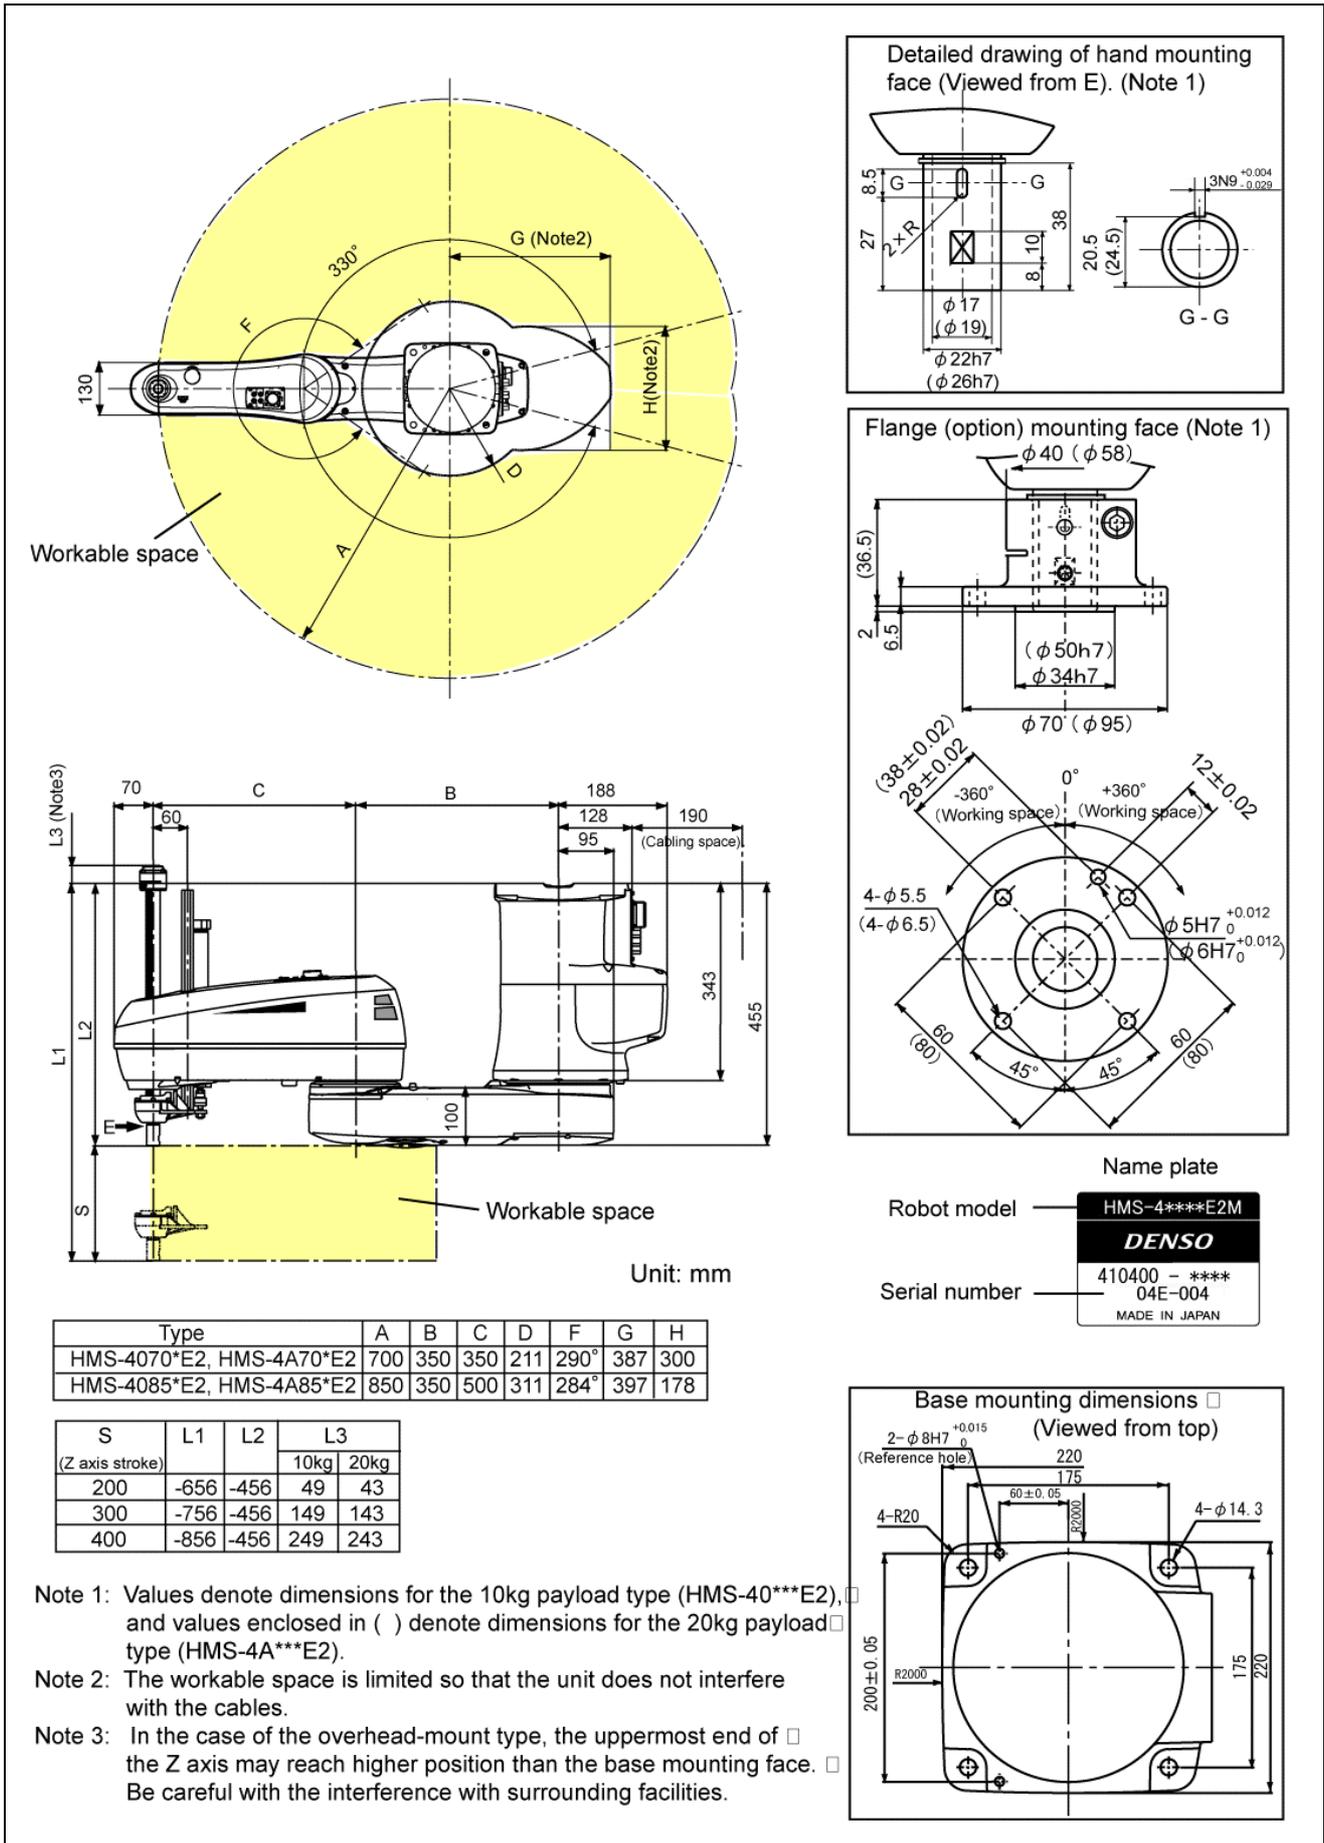

- Note 1: Values denote dimensions for the 10kg payload type (HMS-40\*\*\*E2), and values enclosed in ( ) denote dimensions for the 20kg payload type (HMS-4A\*\*\*E2).
- Note 2: The workable space is limited so that the unit does not interfere with the cables.
- Note 3: In the case of the overhead-mount type, the uppermost end of the Z axis may reach higher position than the base mounting face. Be careful with the interference with surrounding facilities.

Outer dimensions and workable space (HMS-E2)

(4) HMS-E2-W Series Robot Unit (overhead-mount, dust-proof & splash type)

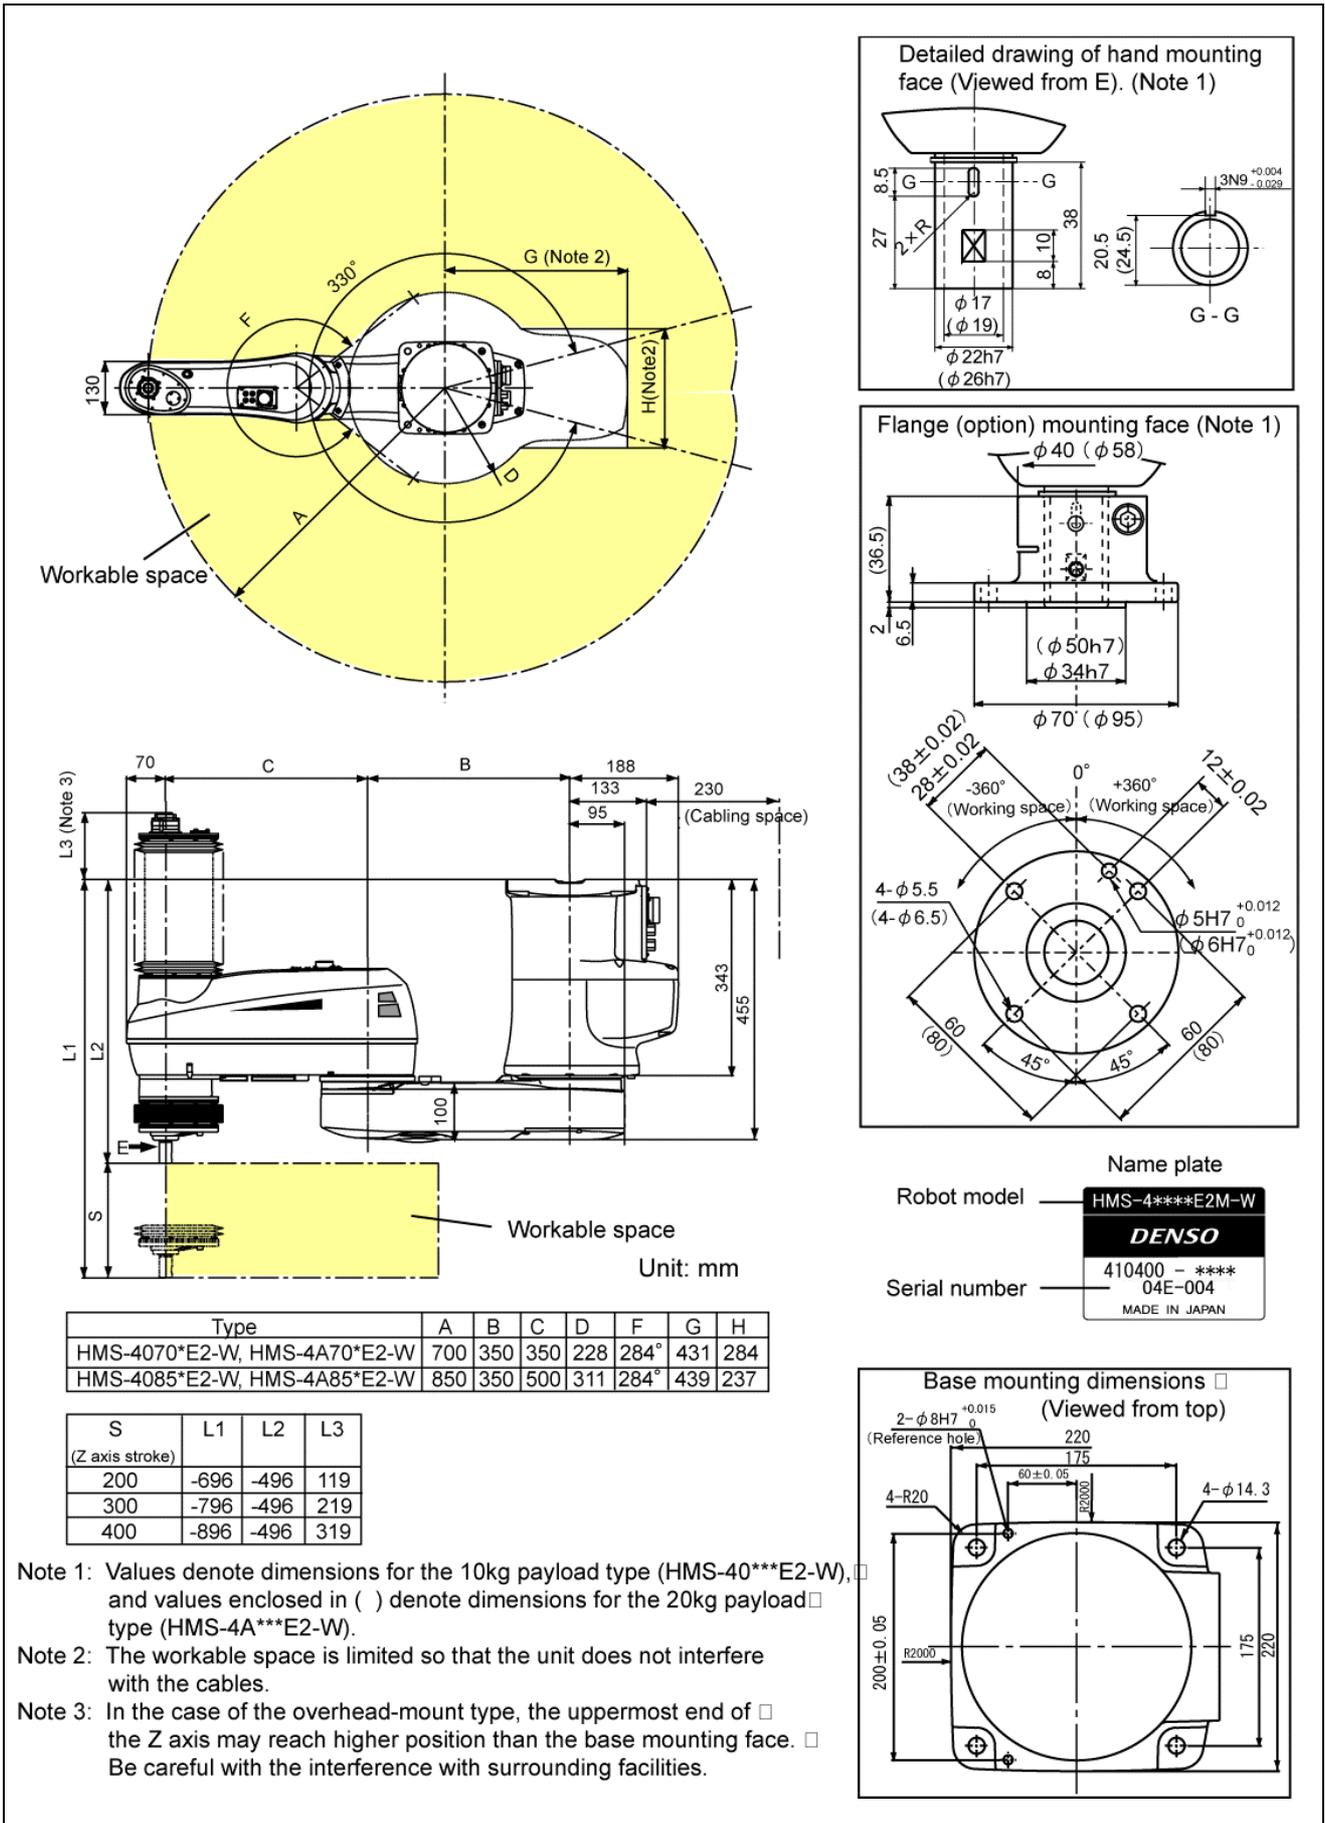

Note 1: Values denote dimensions for the 10kg payload type (HMS-40\*\*\*E2-W), and values enclosed in ( ) denote dimensions for the 20kg payload type (HMS-4A\*\*\*E2-W).

Note 2: The workable space is limited so that the unit does not interfere with the cables.


Note 3: In the case of the overhead-mount type, the uppermost end of the Z axis may reach higher position than the base mounting face. Be careful with the interference with surrounding facilities.

Outer dimensions and workable space (HMS-E2-W)

### 3.2.3 Robot Positioning Time (HM/HMS-E series)


1. The graphs given on the following pages show the positioning times used to calculate the cycle time.
2. Positioning time refers to the time length required from the start of robot operation to the arrival at the target positioning point.
3. After the robot moves to and passes the target positioning point, vibration will be dampened and the robot will be positioned at the target positioning point as shown in the figure below. This vibration dampening time is not considered in those graphs.

- Caution (1)** The vibration dampening time depends on factors such as the weight of the hand. If the robot is to be used in such a way that it overshoots or if the vibration dampening time is of great concern, then test the robot carefully beforehand.
- (2)** If acceleration begins before residual vibration of the robot stops, an overcurrent error (code starts from ERROR6120 where the first digit represents the axis number) may be displayed. In this case, take one of the following measures:
- Lower the deceleration of the preceding operation with a DECEL command to reduce residual vibration.
  - Keep the robot in stand-by with a DELAY command until residual vibration stops.
  - Lower acceleration with an ACCEL command.
- (3)** Run the robot with the optimum payload setting in accordance with weight of the hand and workpiece. If not, a robot failure may result.
- (4)** In the positioning time graphs, the Z-axis stroke is represented near the upper end. Near the lower end, the horizontal movement time along the J1/J2 axis increases. (Refer to Section 3.2.4 "Notes for setting the positioning speed .")

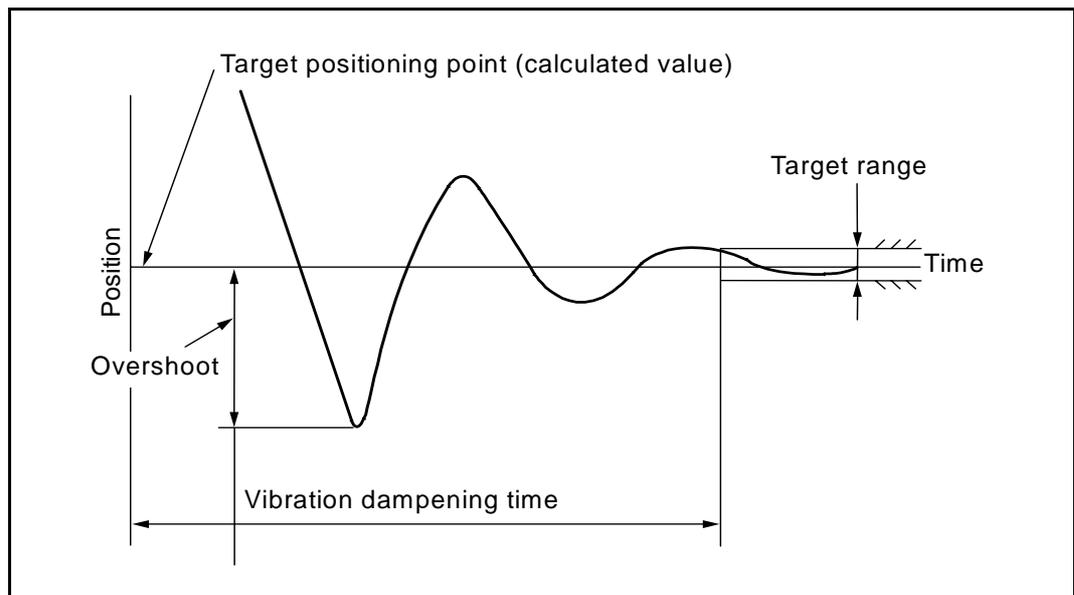


Vibration Dampening Time


(1) HM-40602E

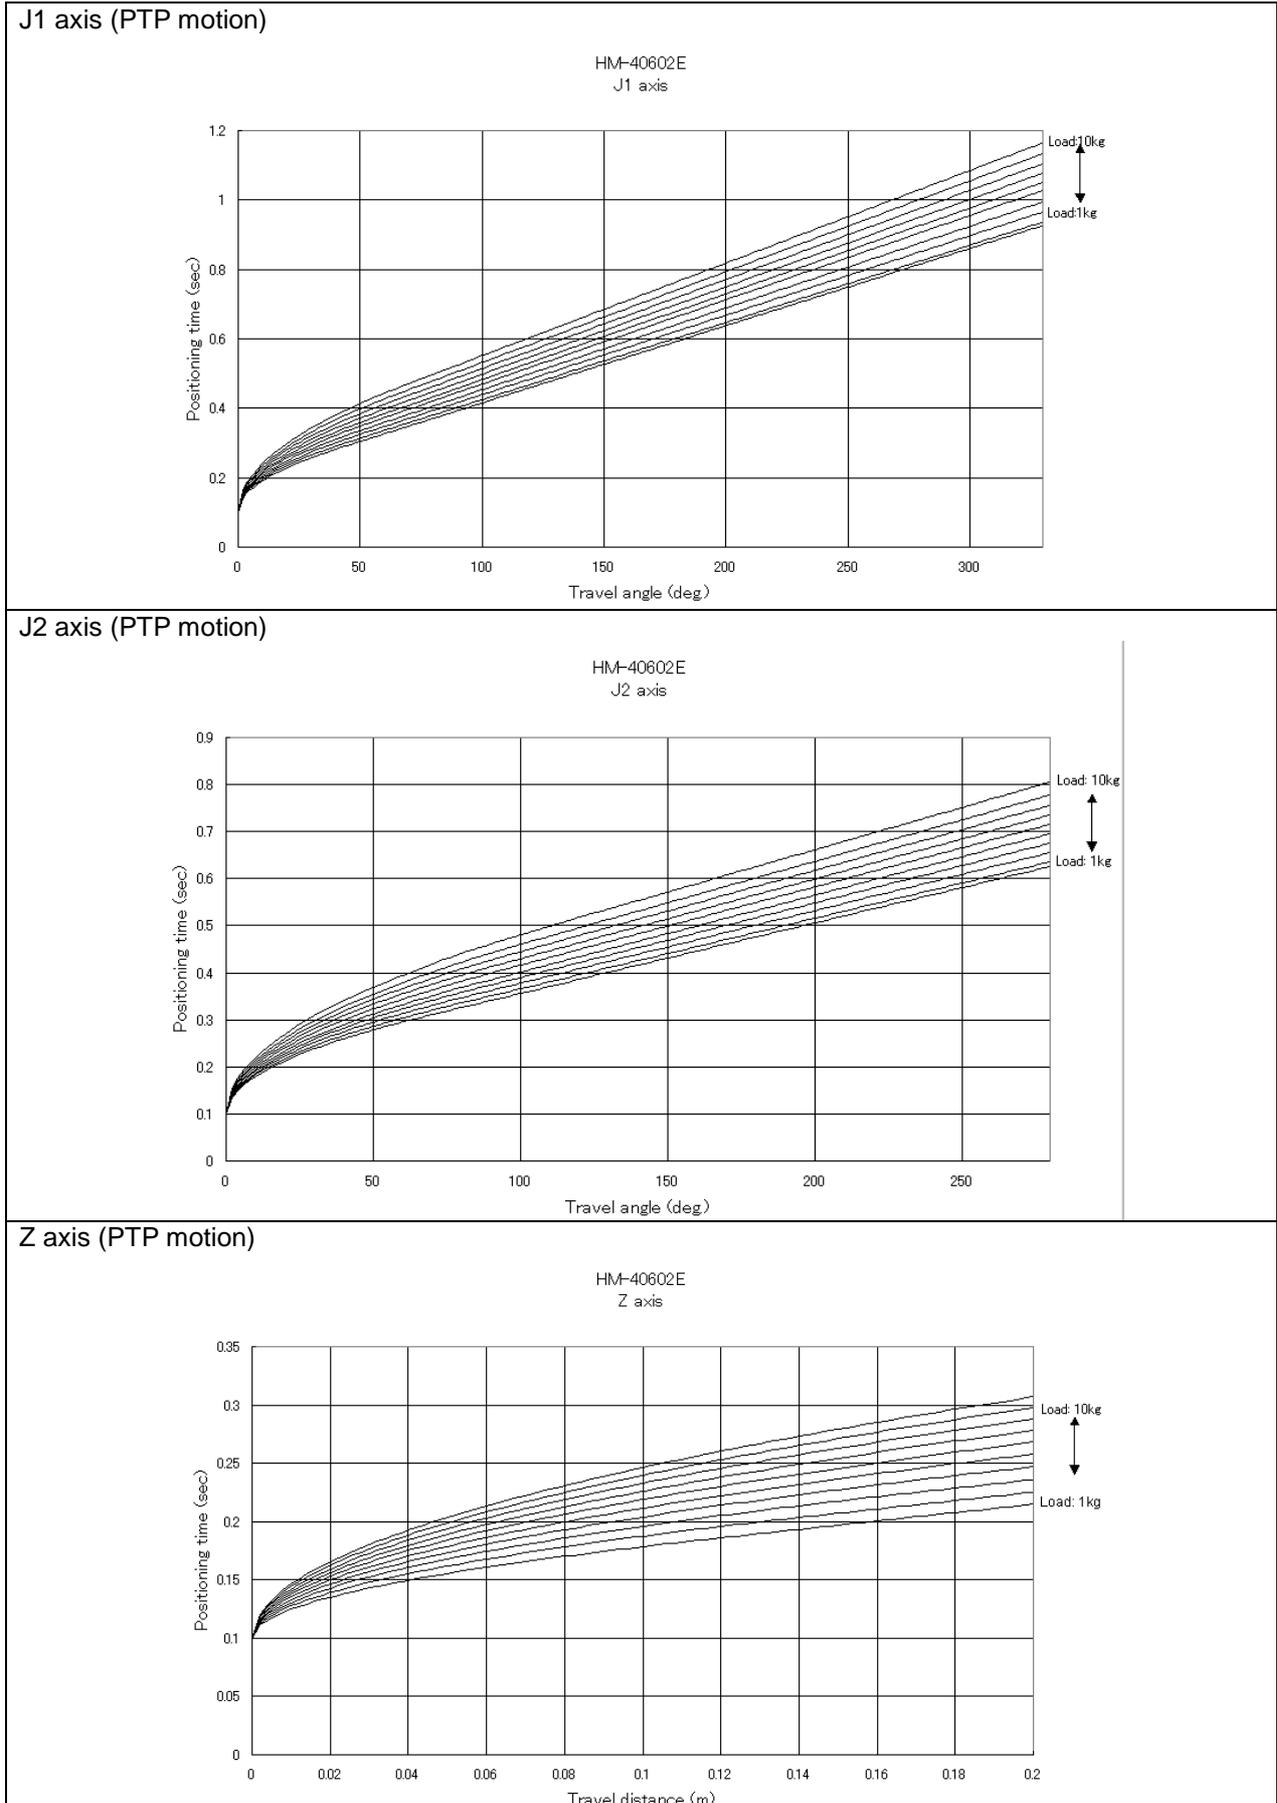

T axis (PTP motion)

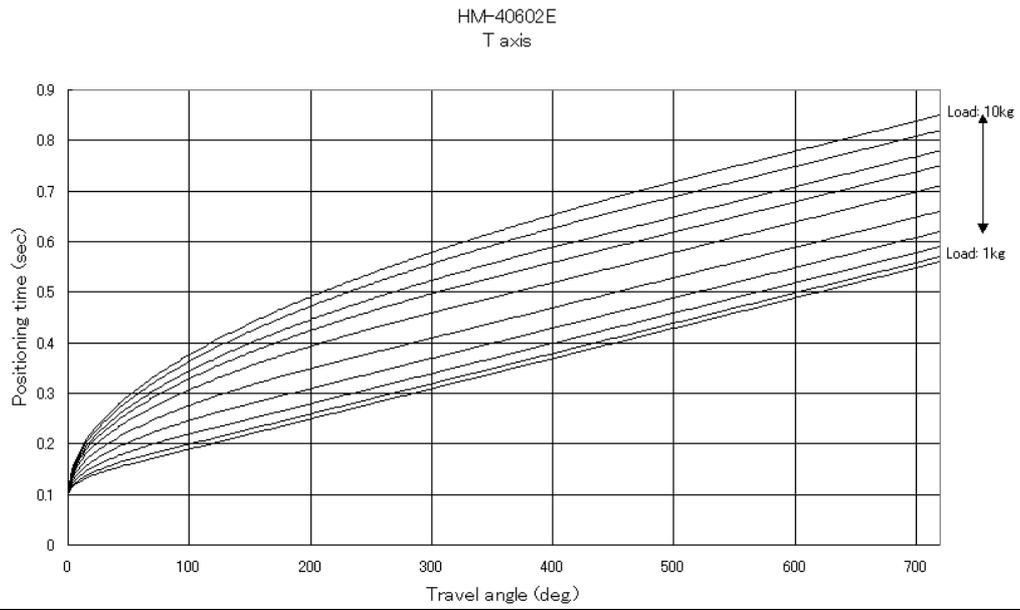


All axes (CP operation)

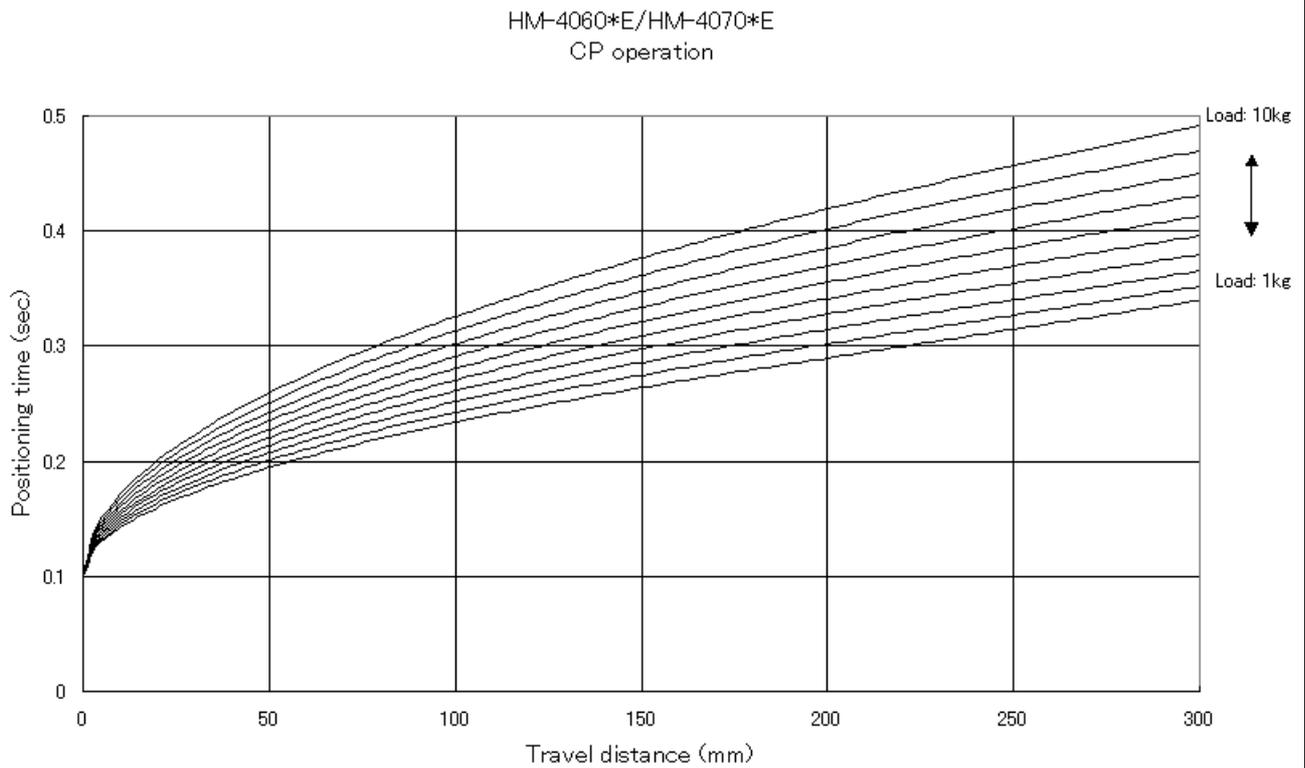


(2) HM-40603E


J1 axis (PTP motion)

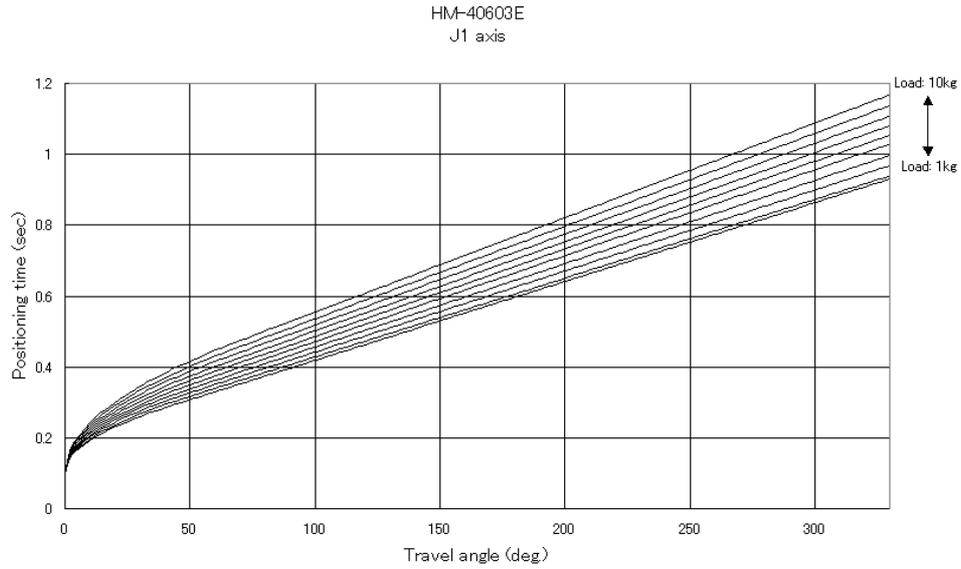


J2 axis (PTP motion)

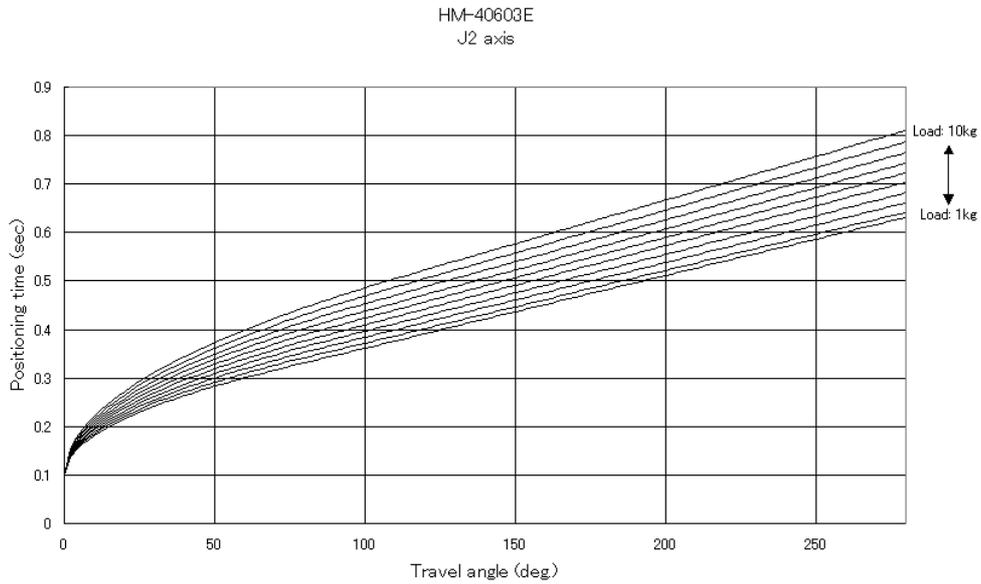


Z axis (PTP motion)

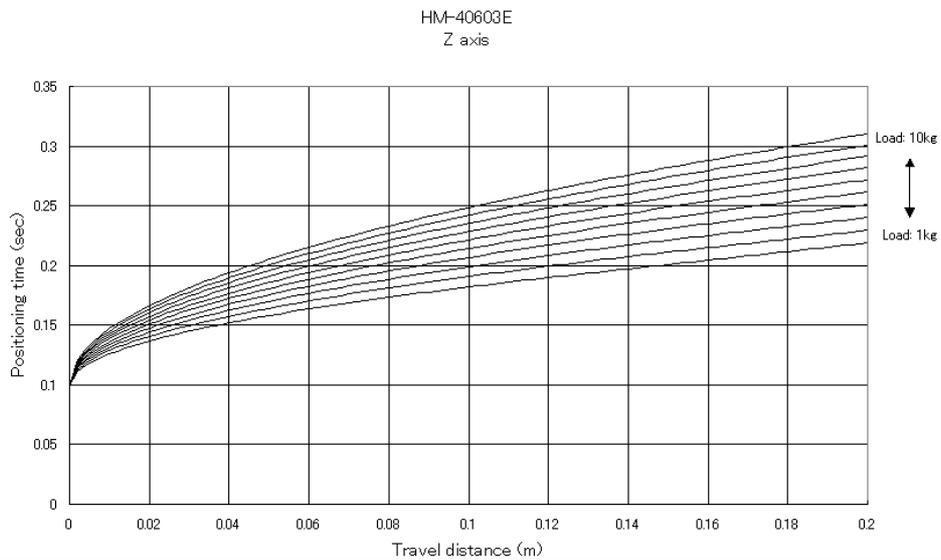

T axis (PTP motion)

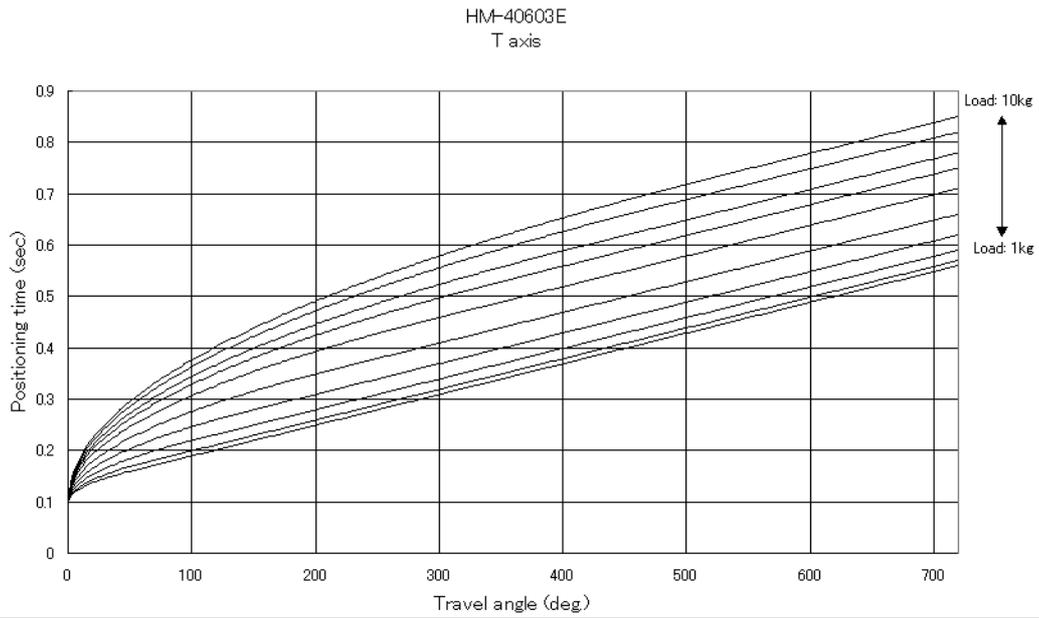


All axes (CP operation)

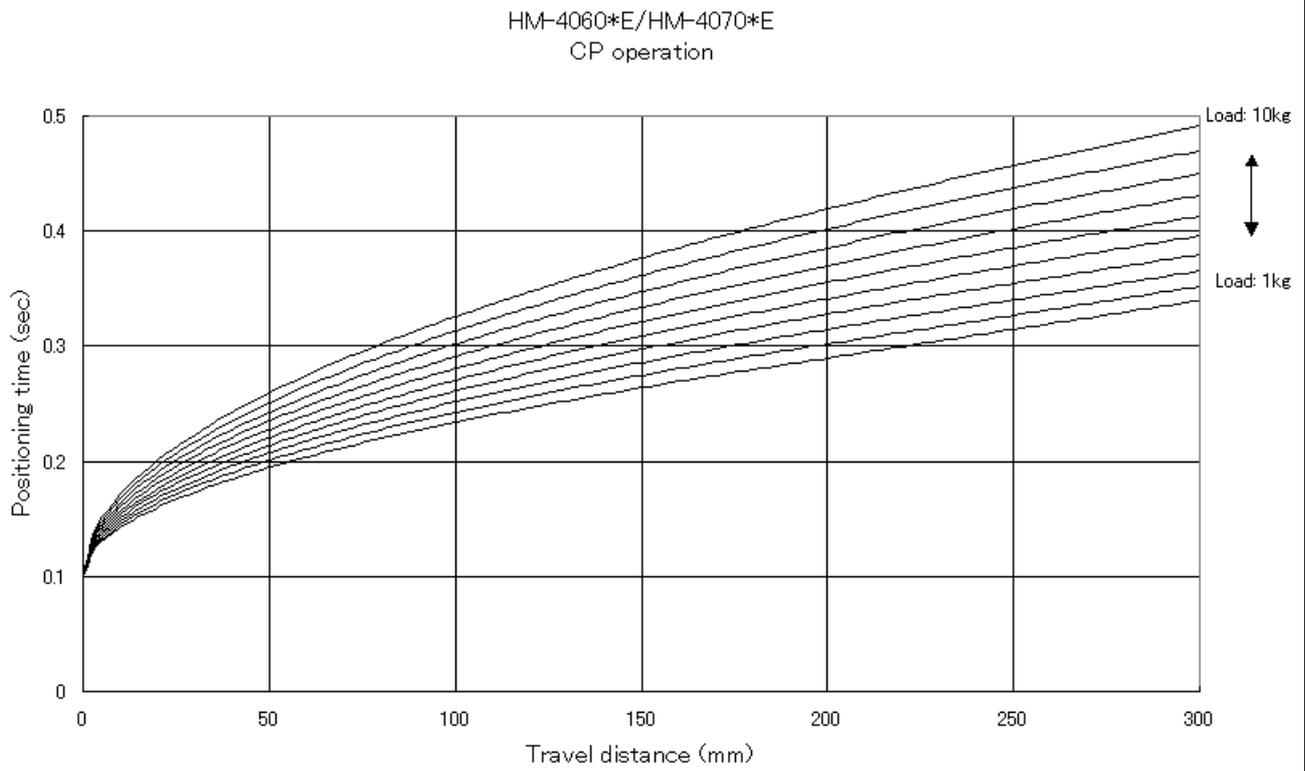


(3) HM-40604E


J1 axis (PTP motion)

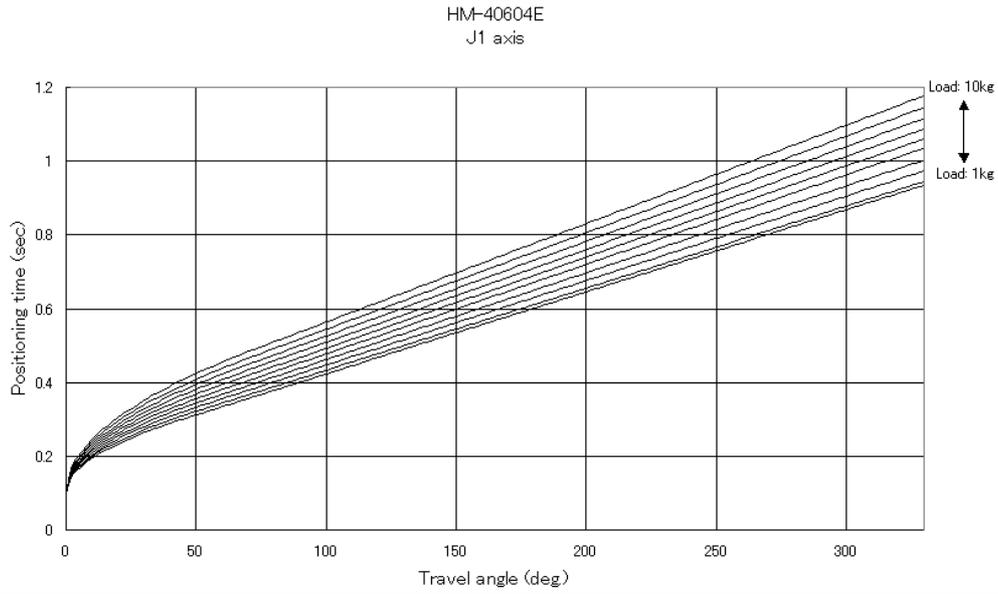


J2 axis (PTP motion)

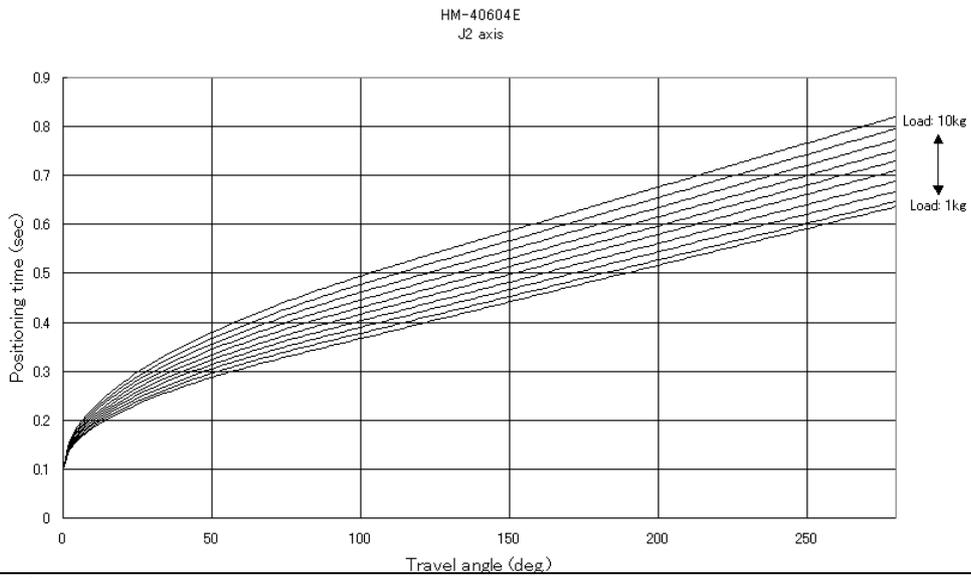


Z axis (PTP motion)

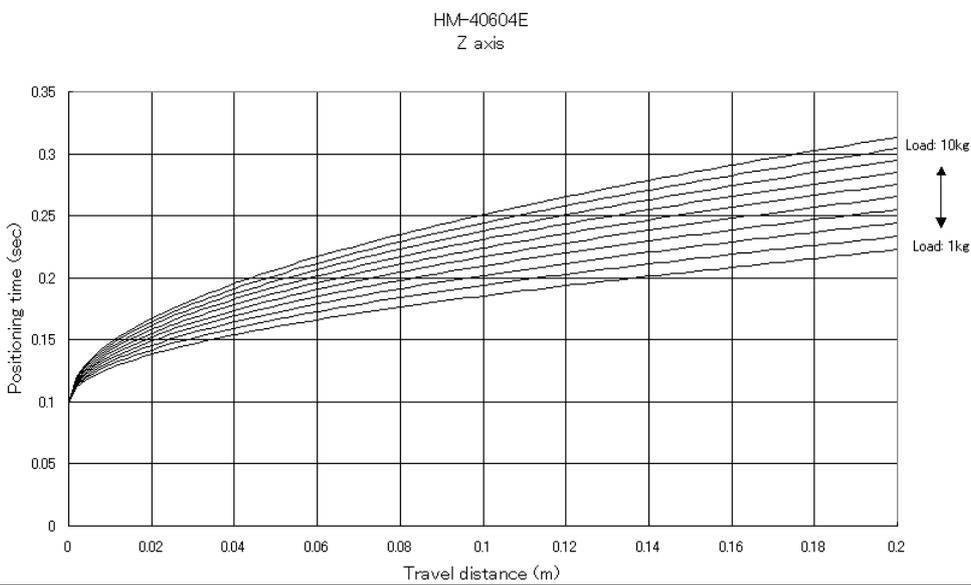

T axis (PTP motion)

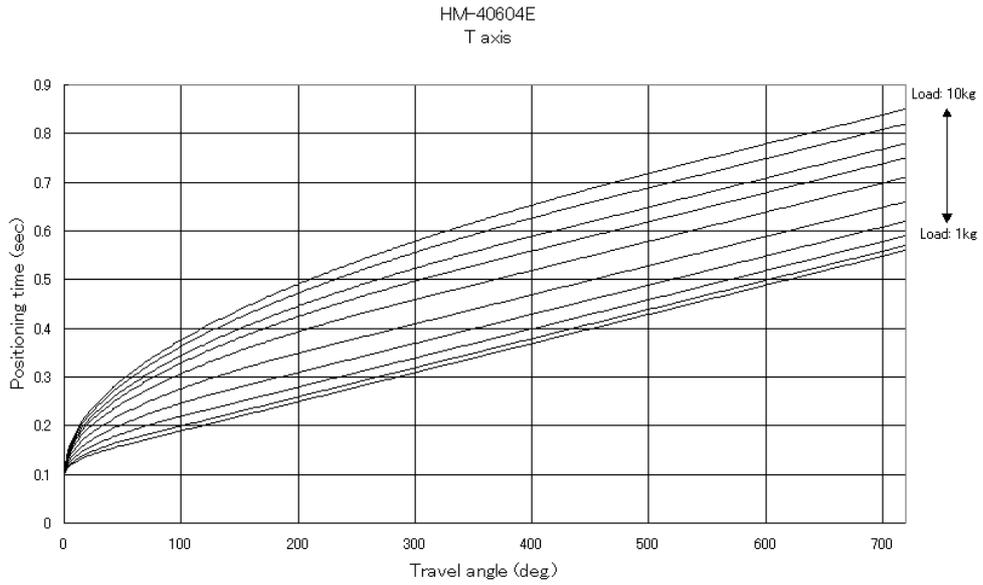


All axes (CP operation)

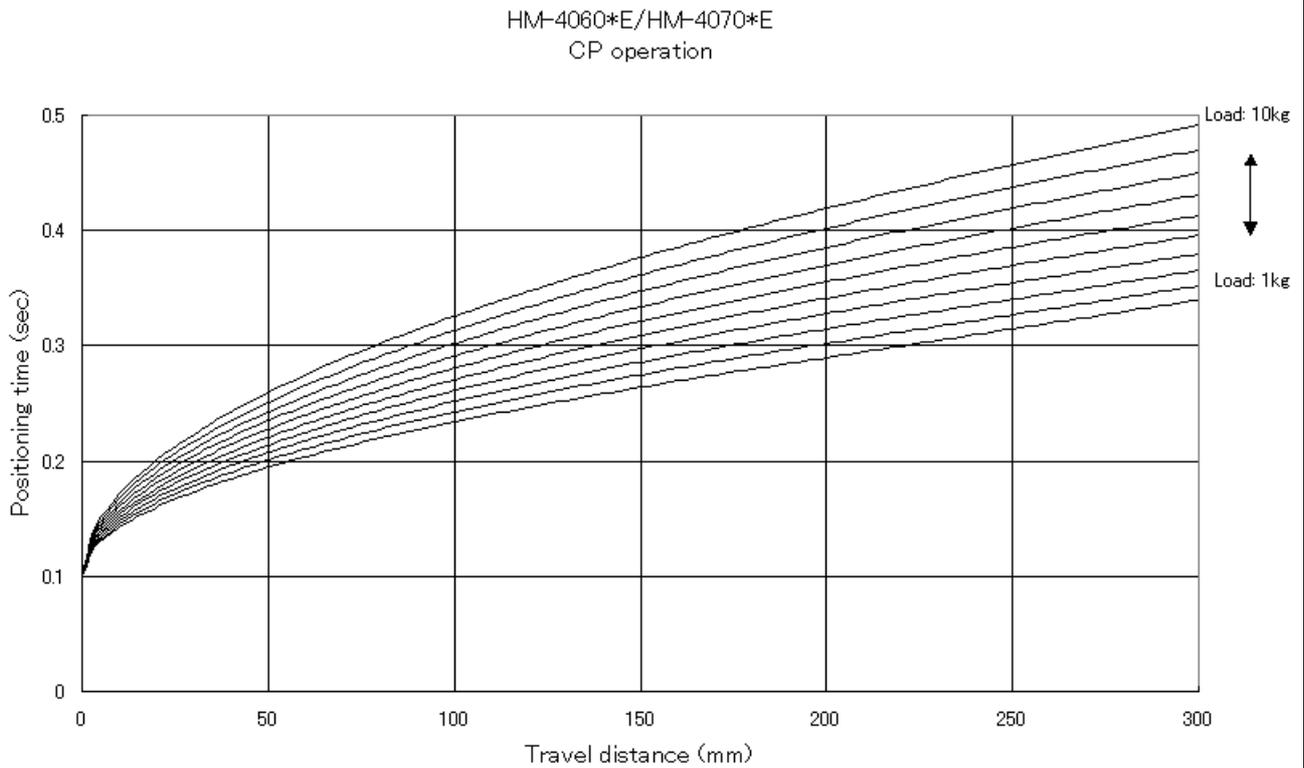


(4) HM/HMS-40702E


J1 axis (PTP motion)

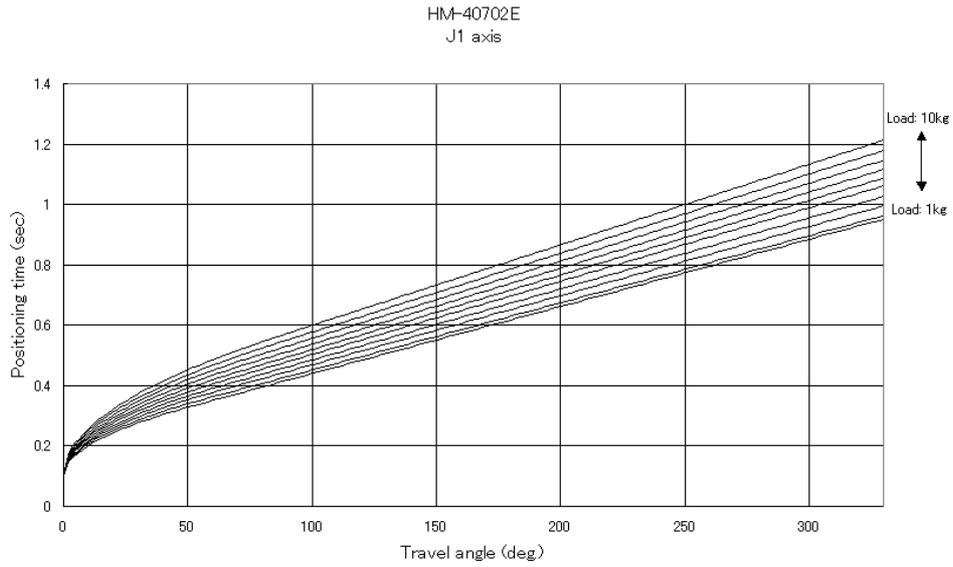


J2 axis (PTP motion)

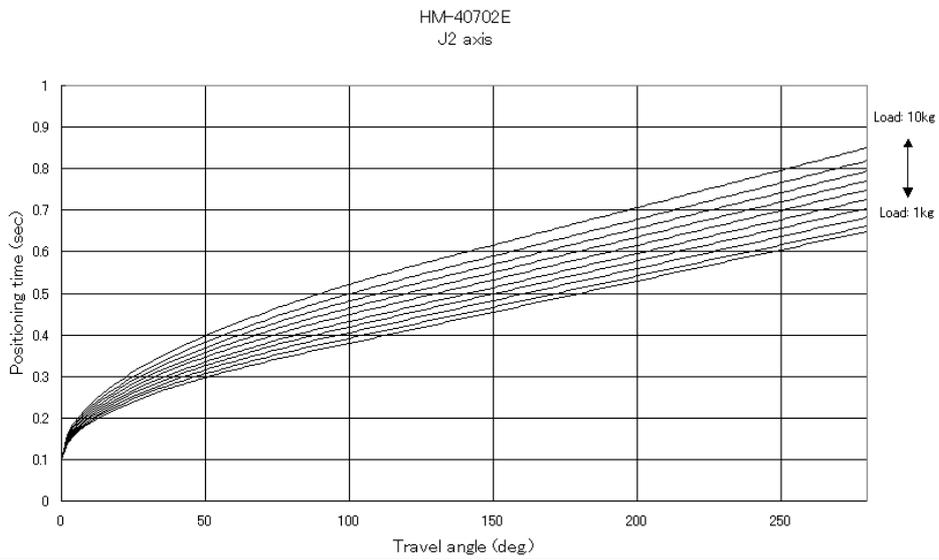


Z axis (PTP motion)

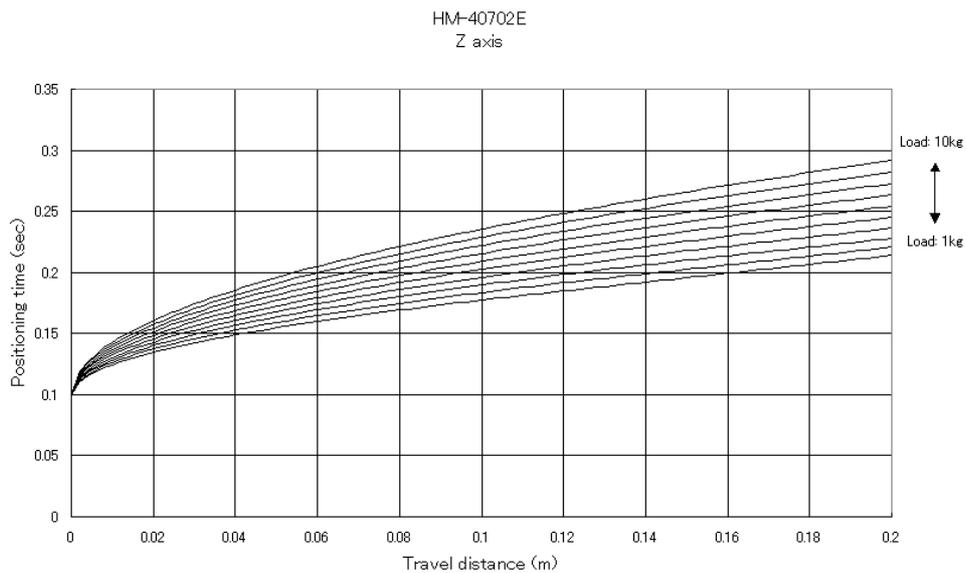

T axis (PTP motion)

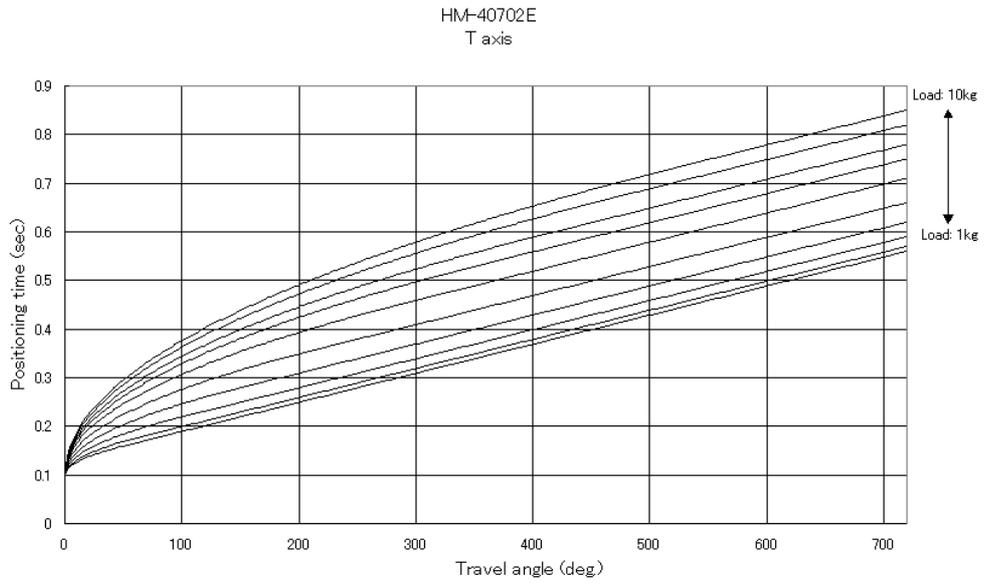


All axes (CP operation)

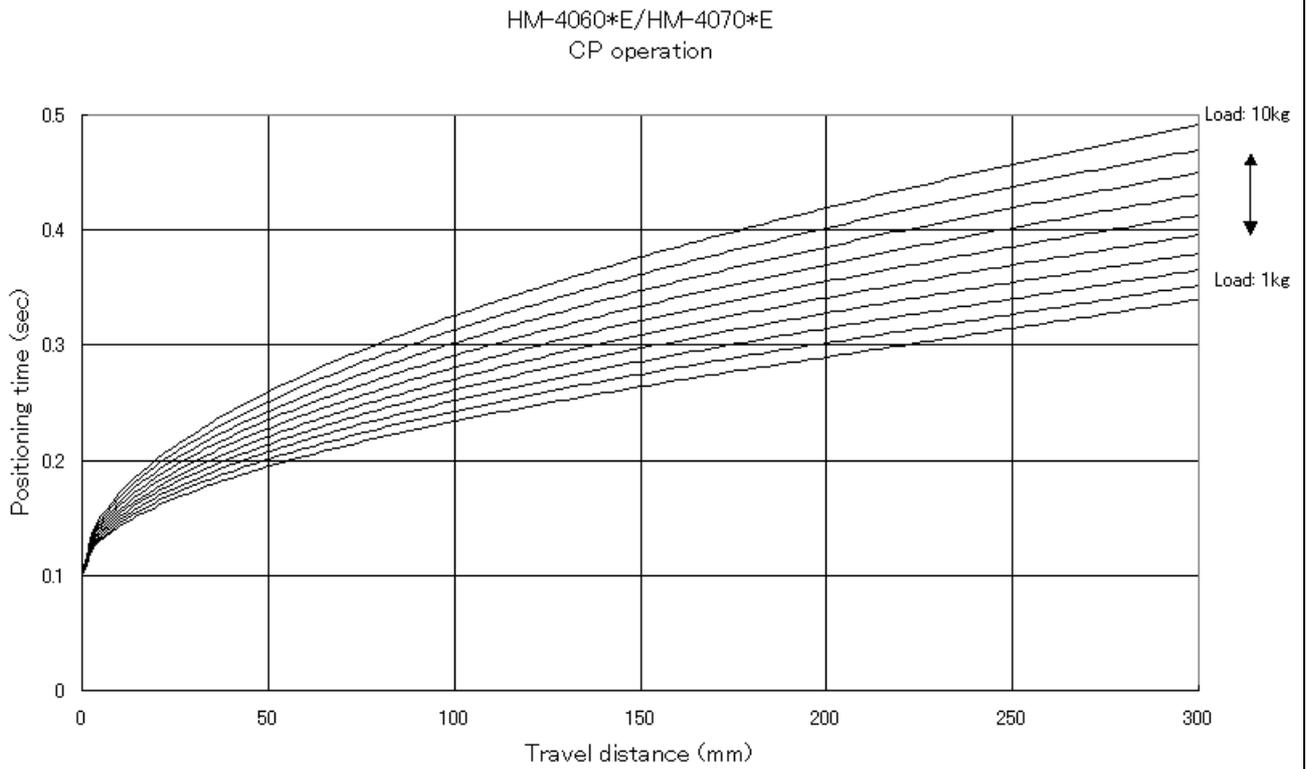


(5) HM/HMS-40703E


J1 axis (PTP motion)

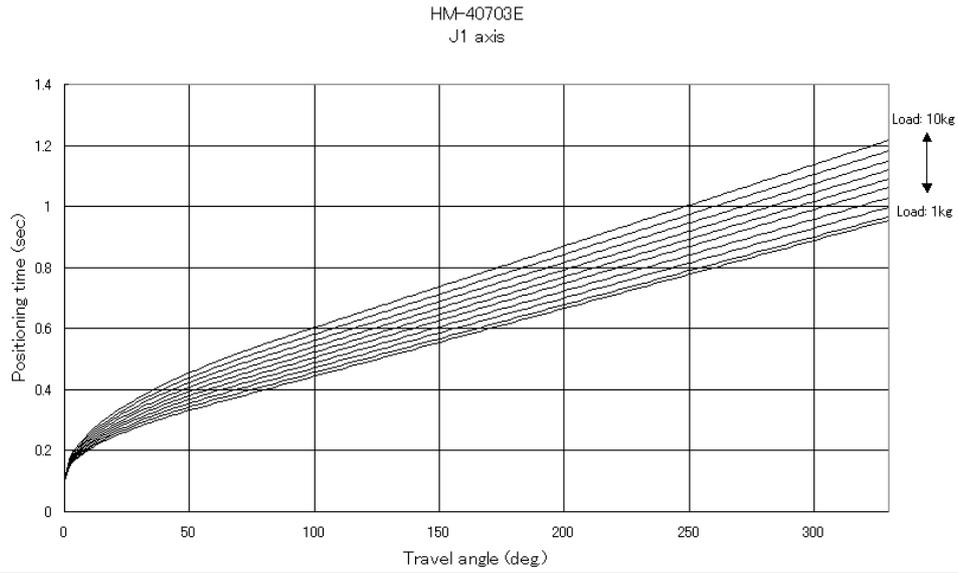


J2 axis (PTP motion)

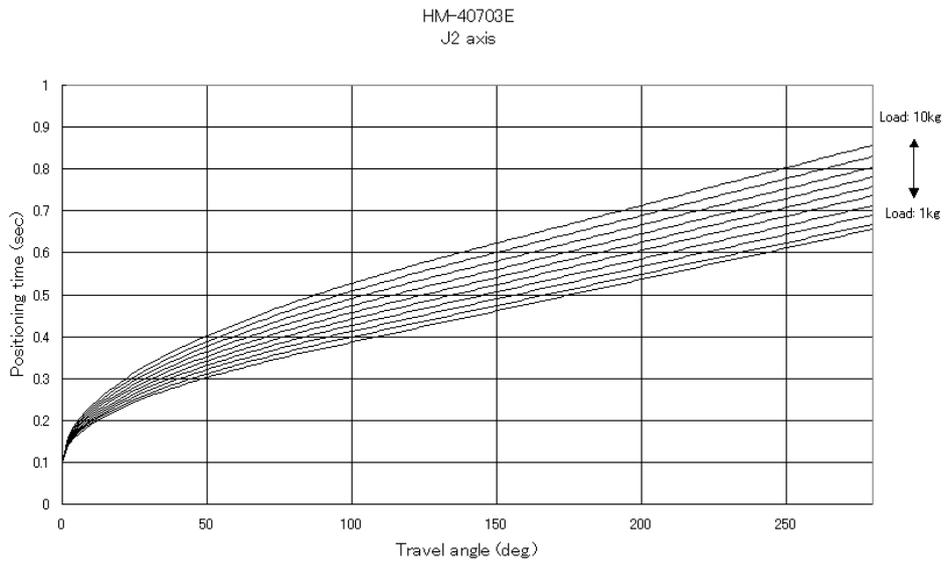


Z axis (PTP motion)

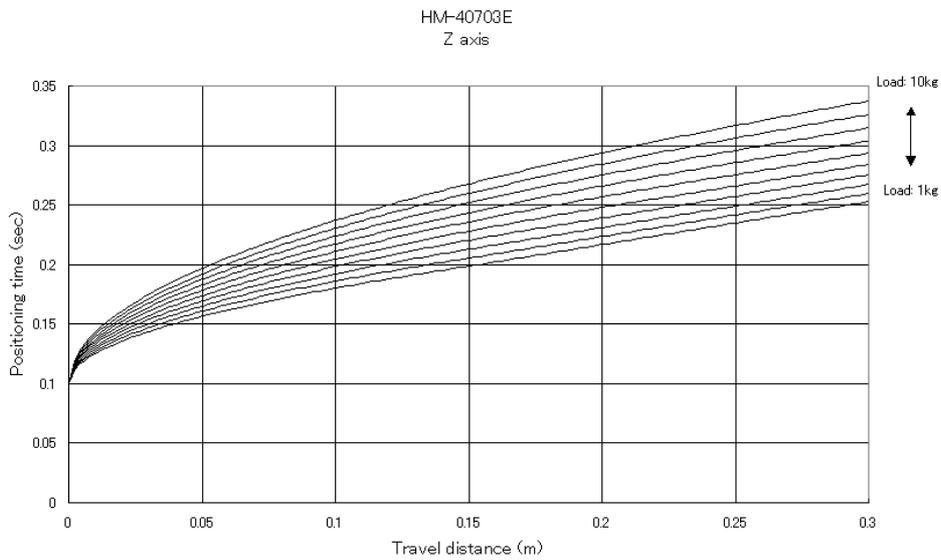

T axis (PTP motion)

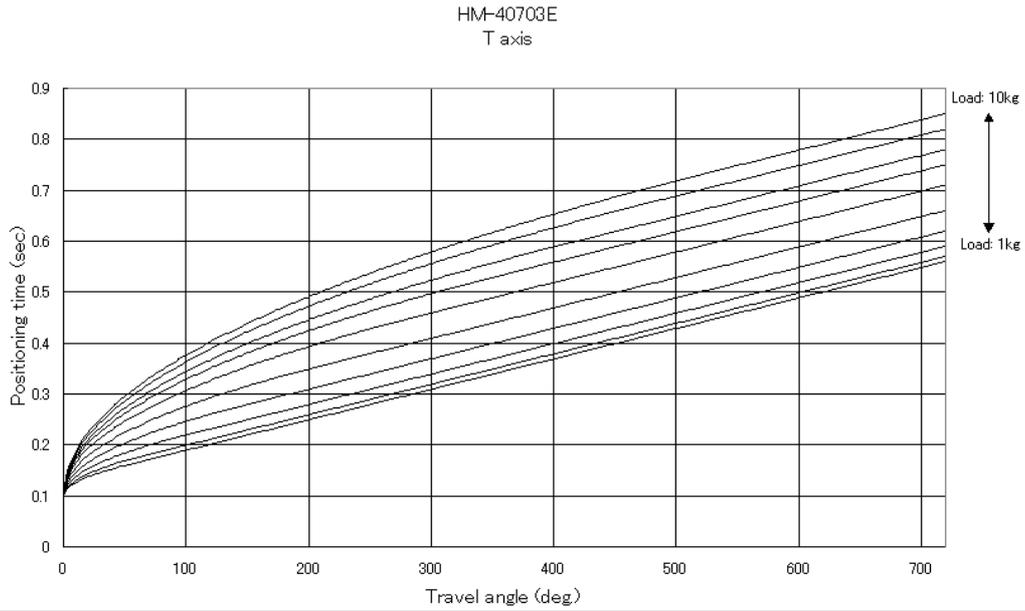


All axes (CP operation)

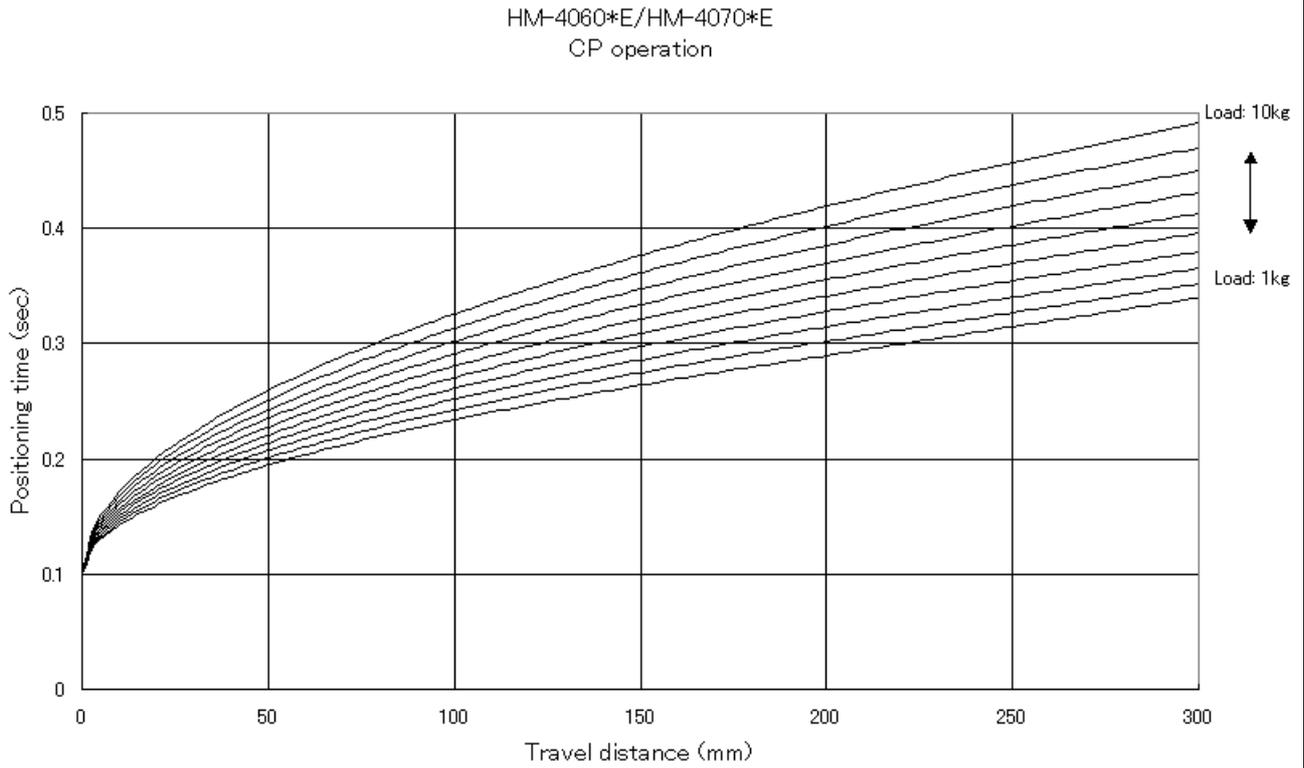


(6) HM/HMS-40704E


J1 axis (PTP motion)

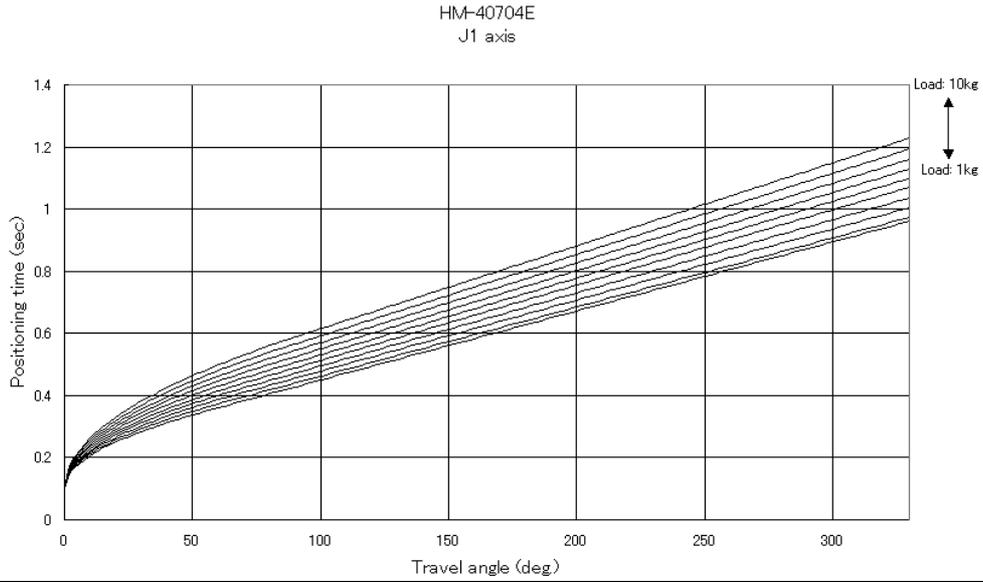


J2 axis (PTP motion)

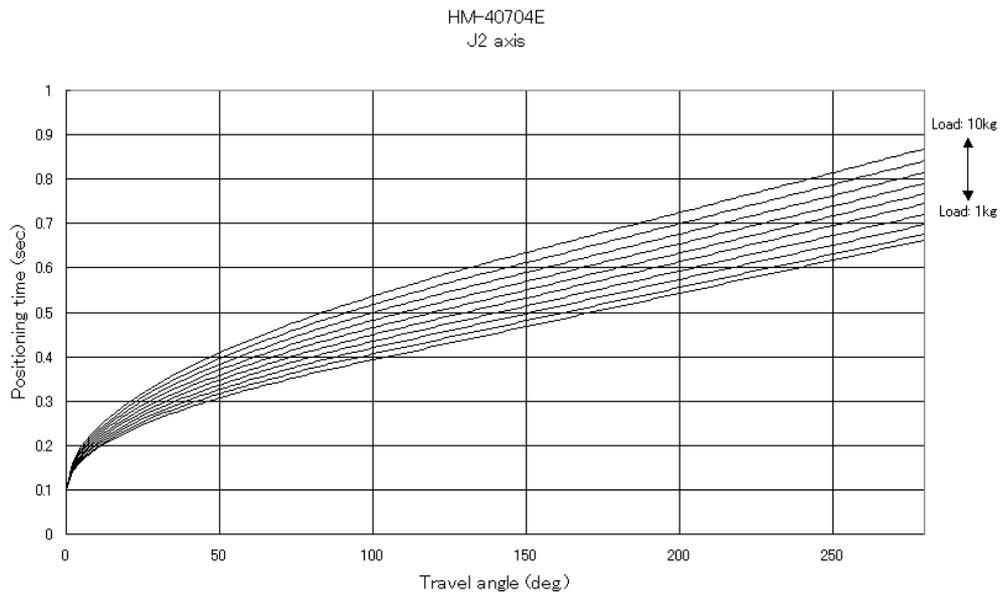


Z axis (PTP motion)

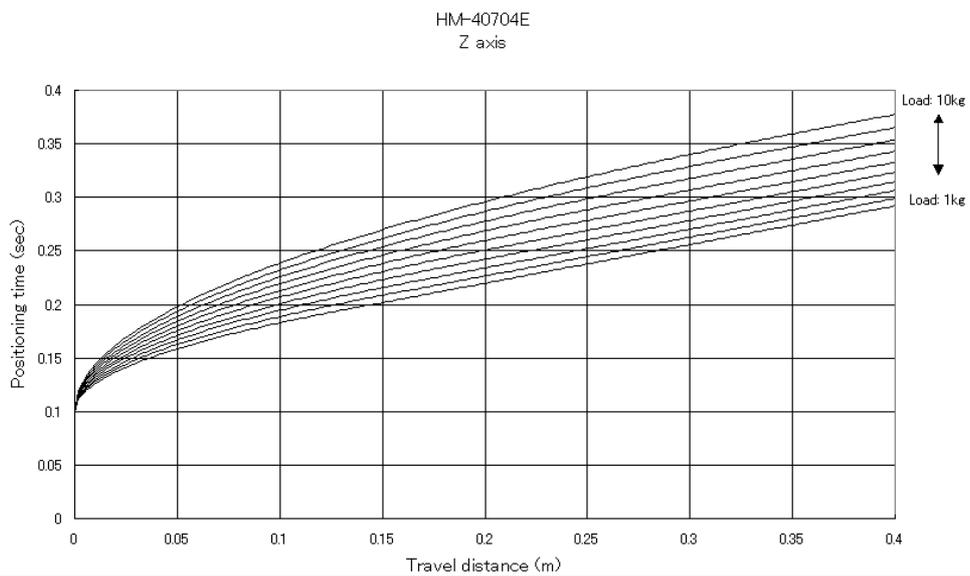

T axis (PTP motion)

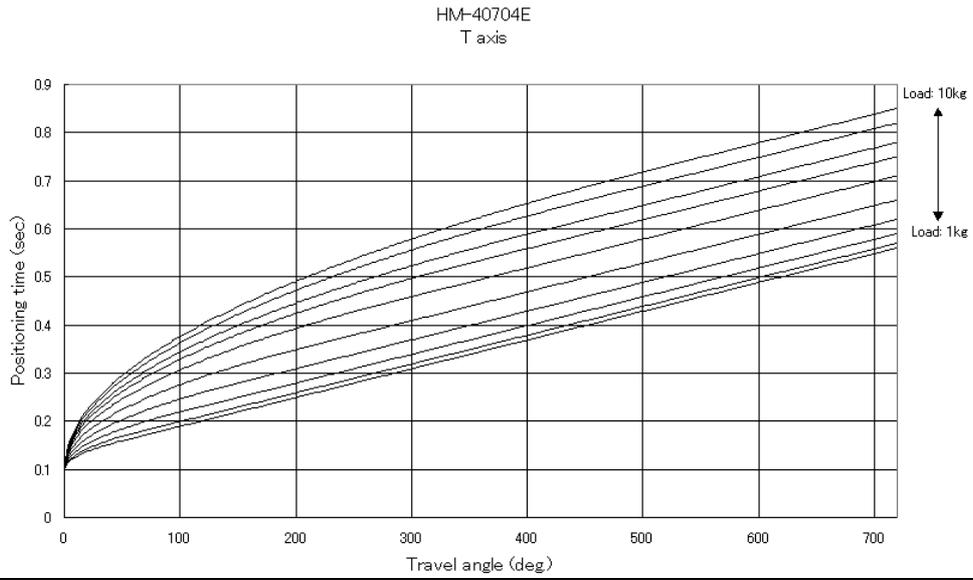


All axes (CP operation)

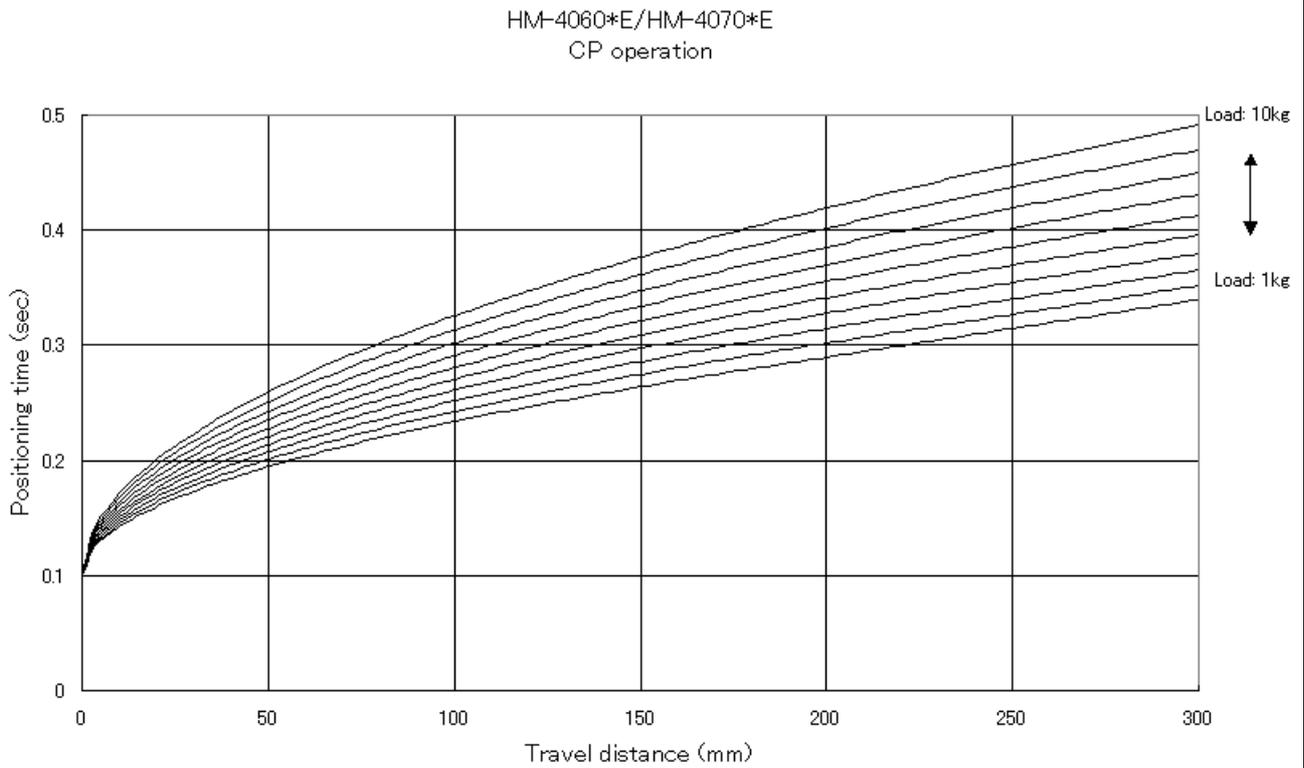


(7) HM/HMS-40852E


J1 axis (PTP motion)

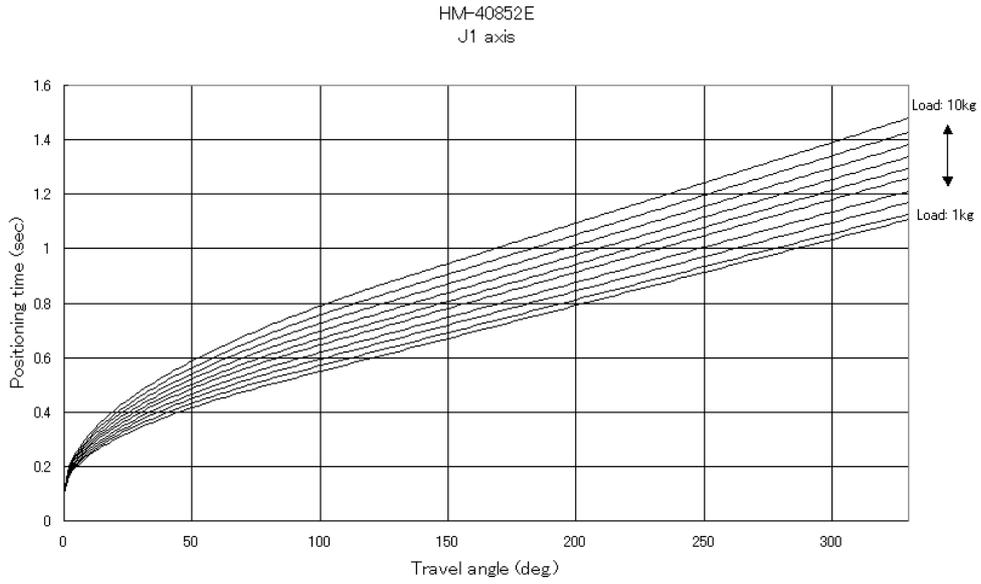


J2 axis (PTP motion)

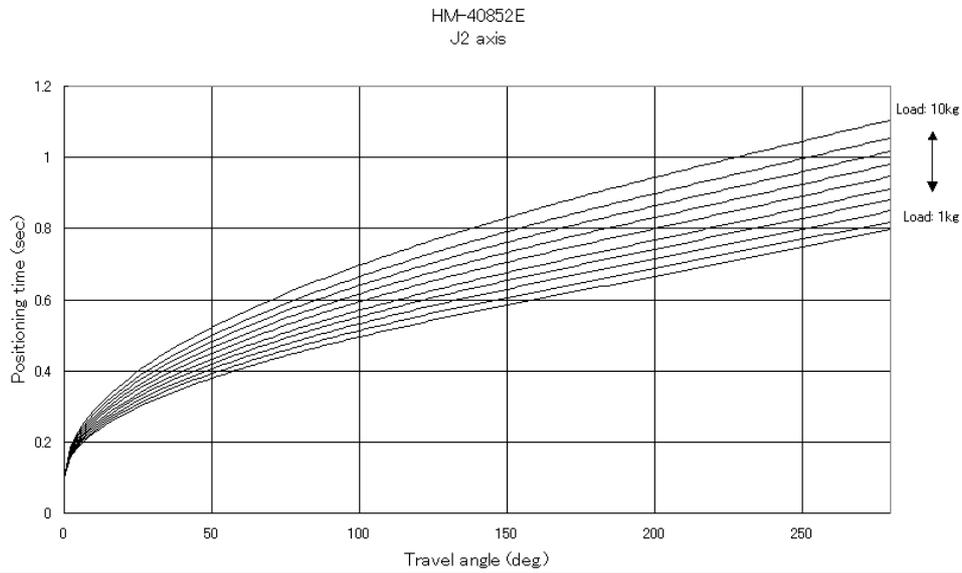


Z axis (PTP motion)

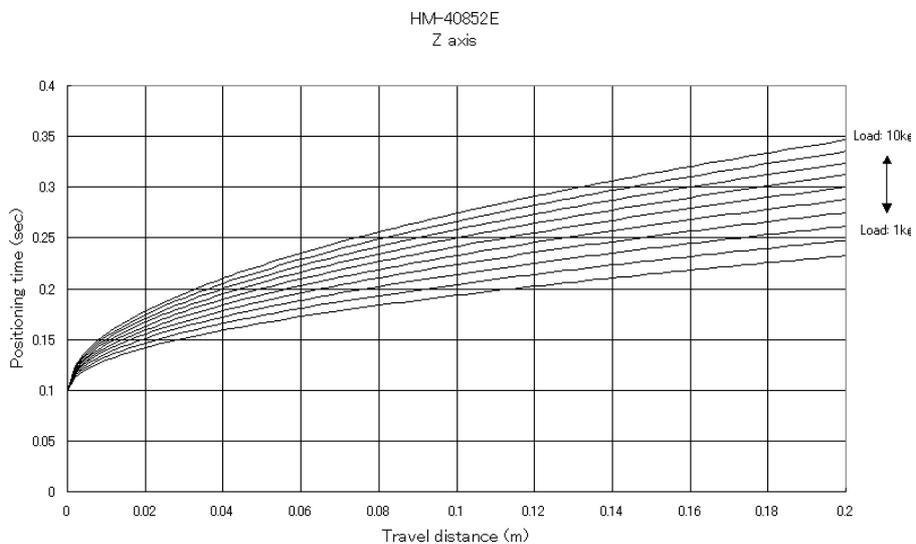

T axis (PTP motion)

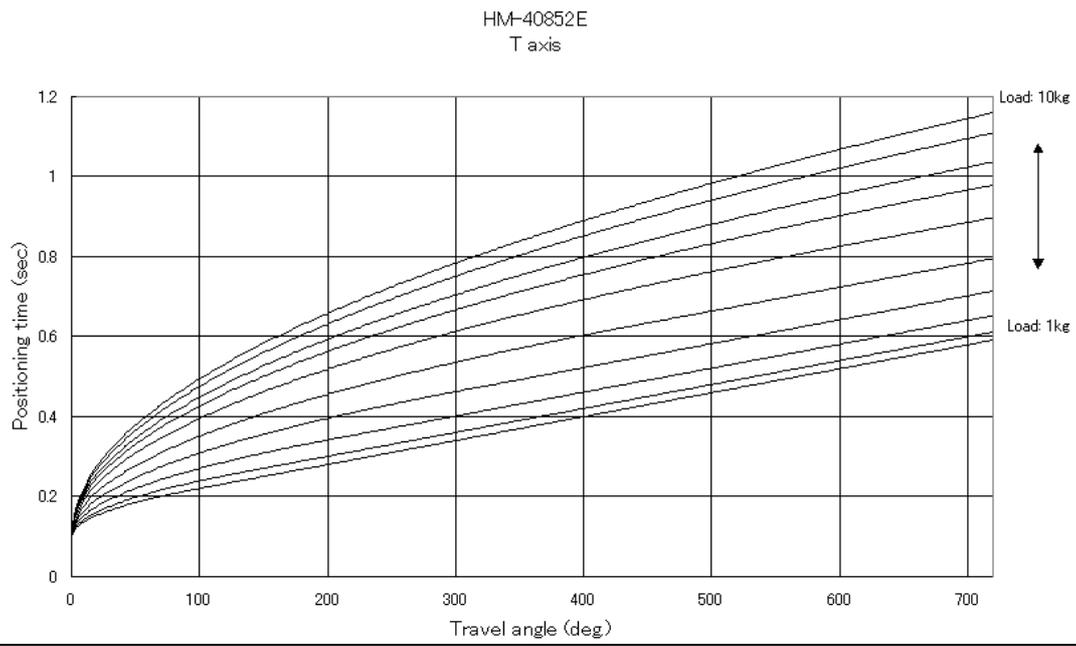


All axes (CP operation)

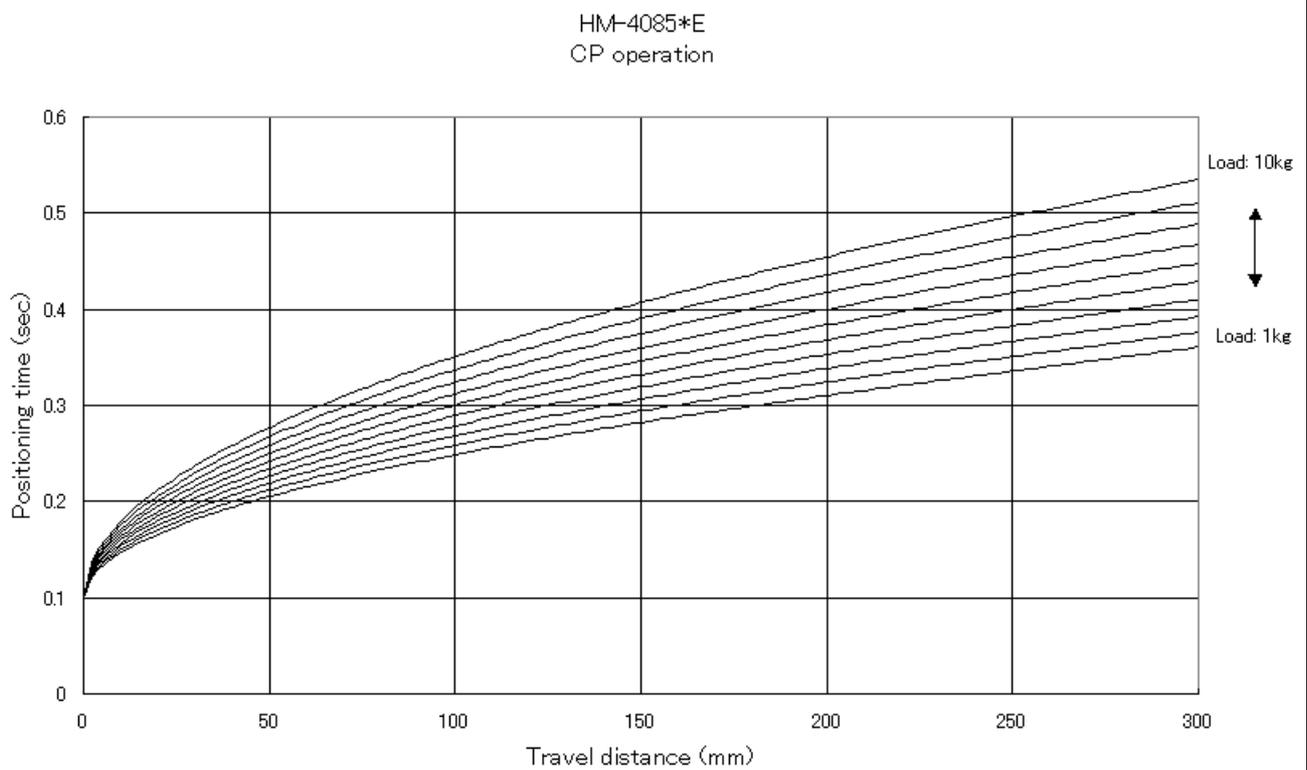


(8) HM/HMS-40853E


J1 axis (PTP motion)

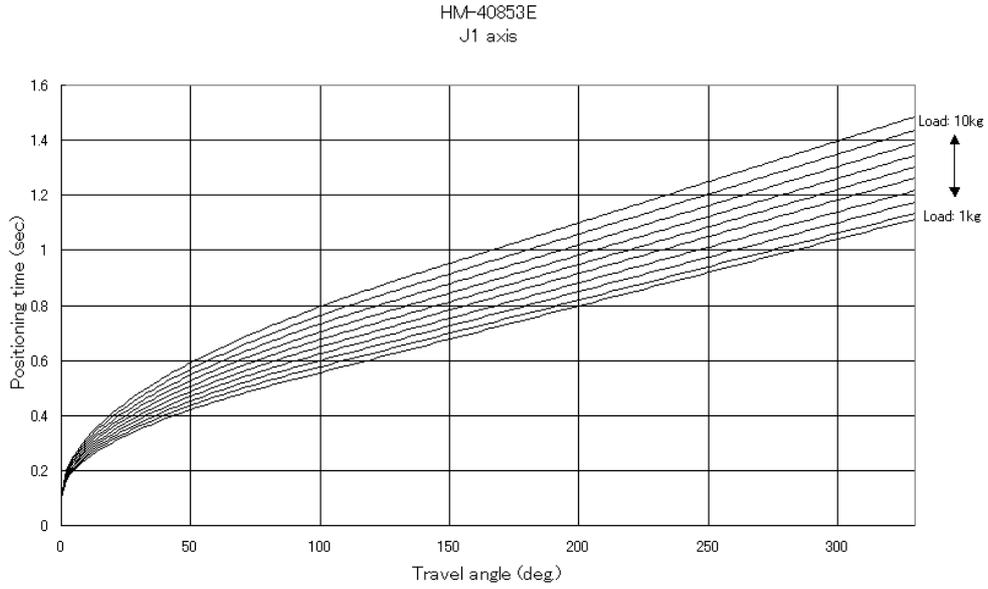


J2 axis (PTP motion)

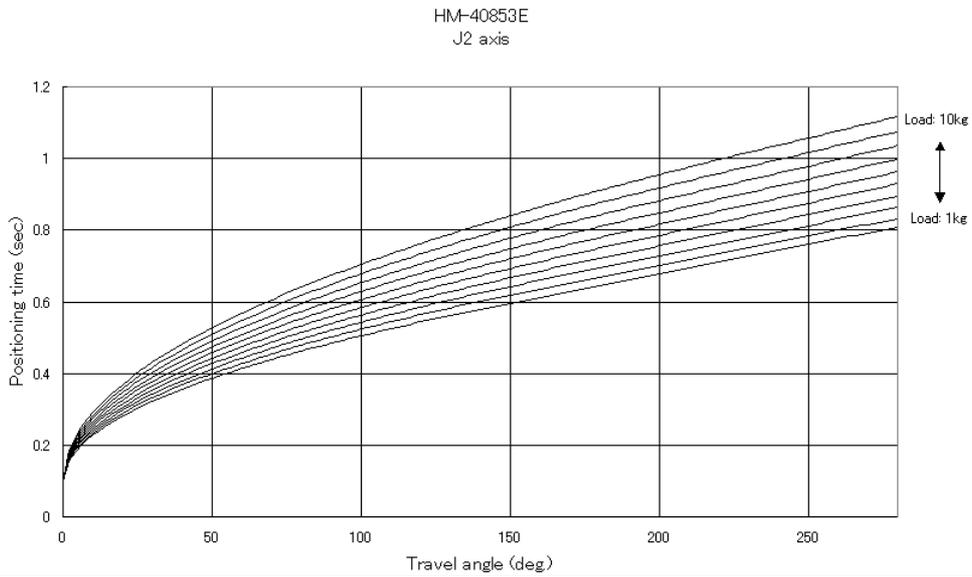


Z axis (PTP motion)

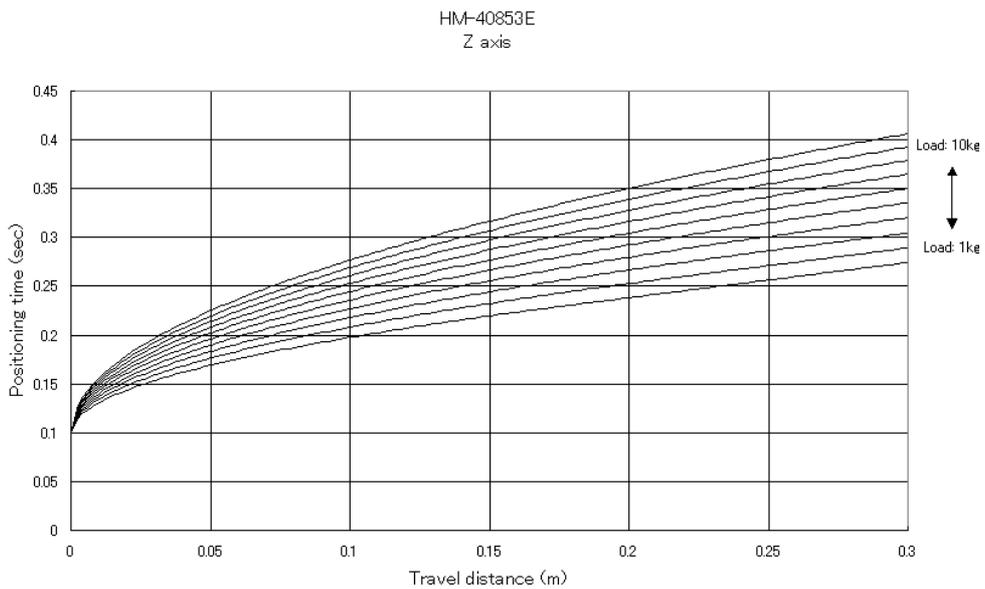

T axis (PTP motion)

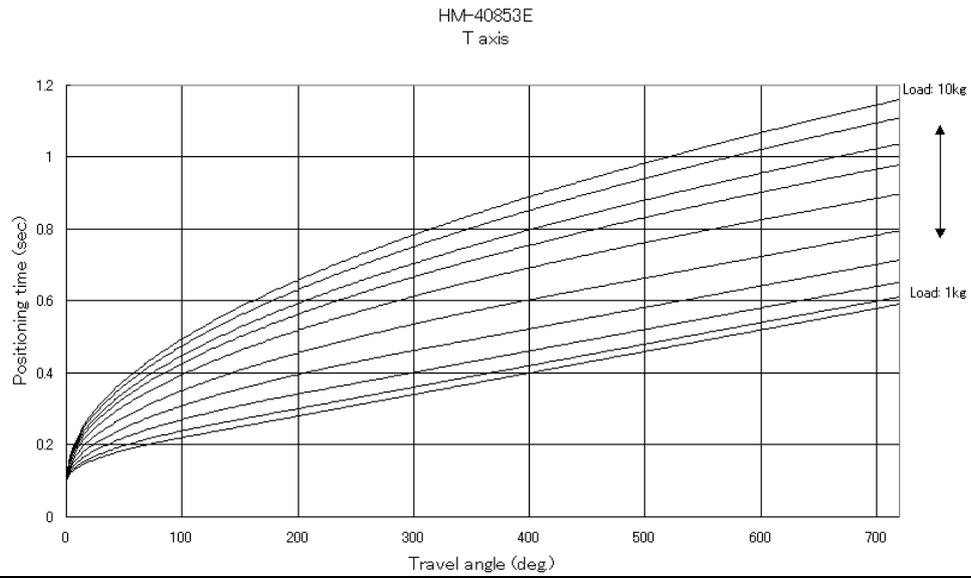


All axes (CP operation)

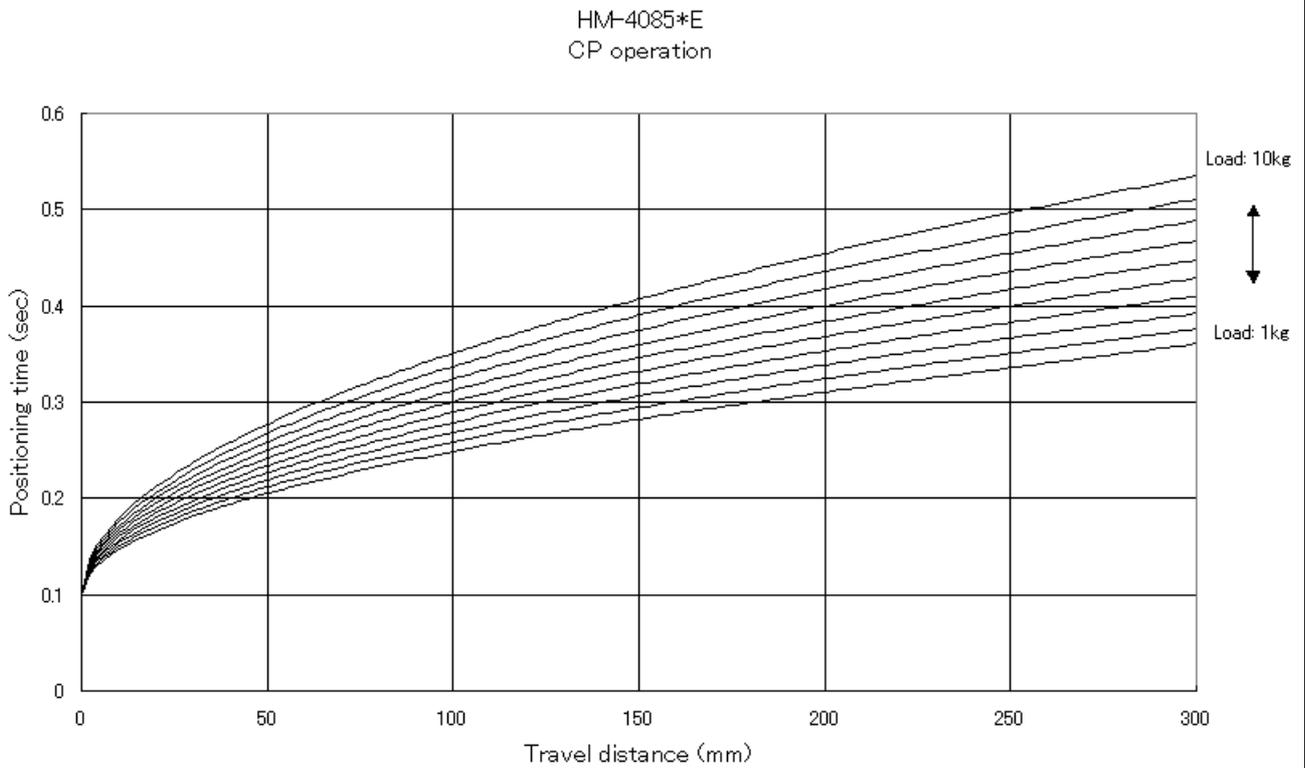


(9) HM/HMS-40854E


J1 axis (PTP motion)

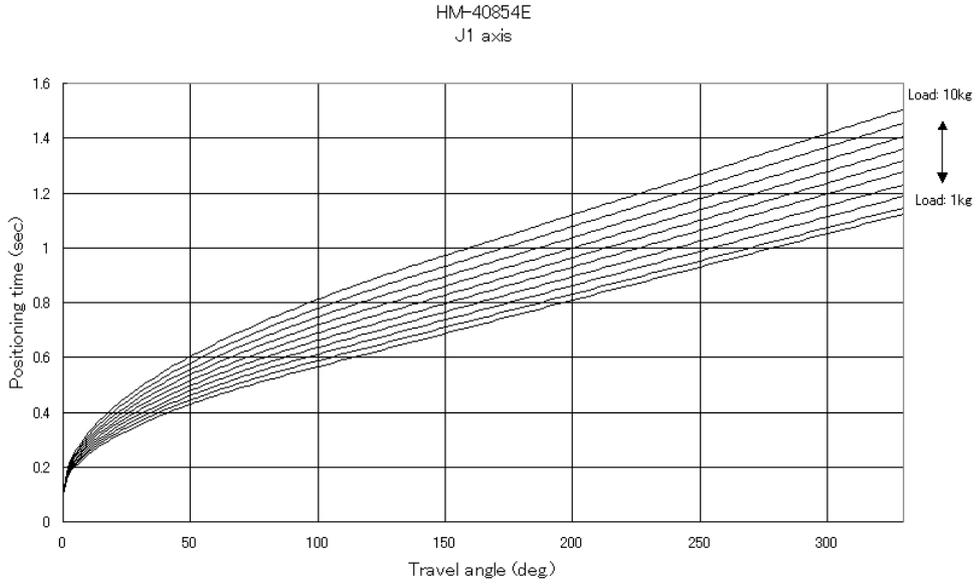


J2 axis (PTP motion)

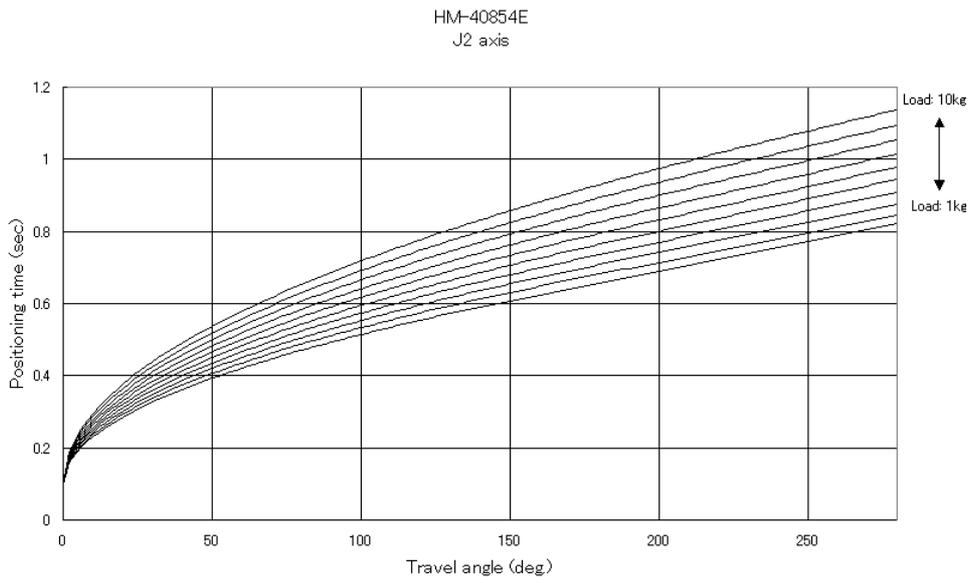


Z axis (PTP motion)

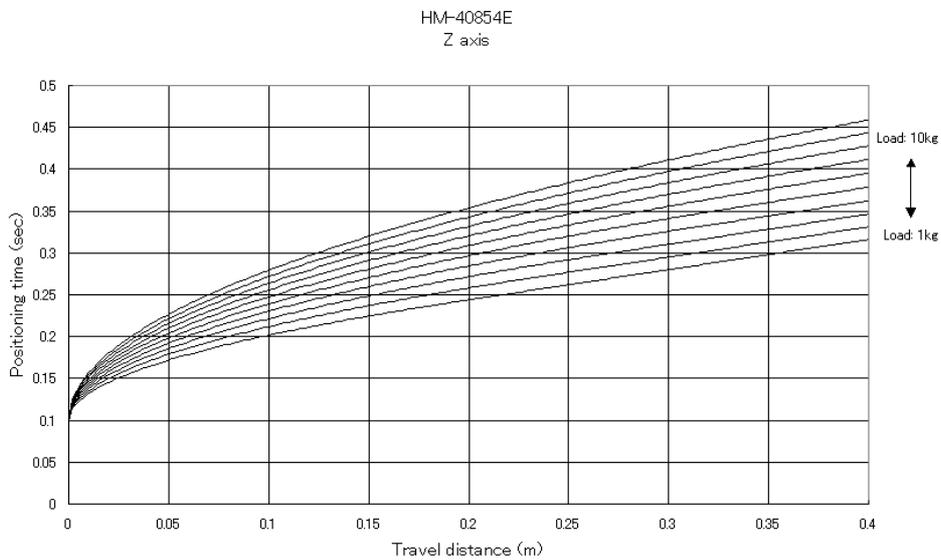

T axis (PTP motion)

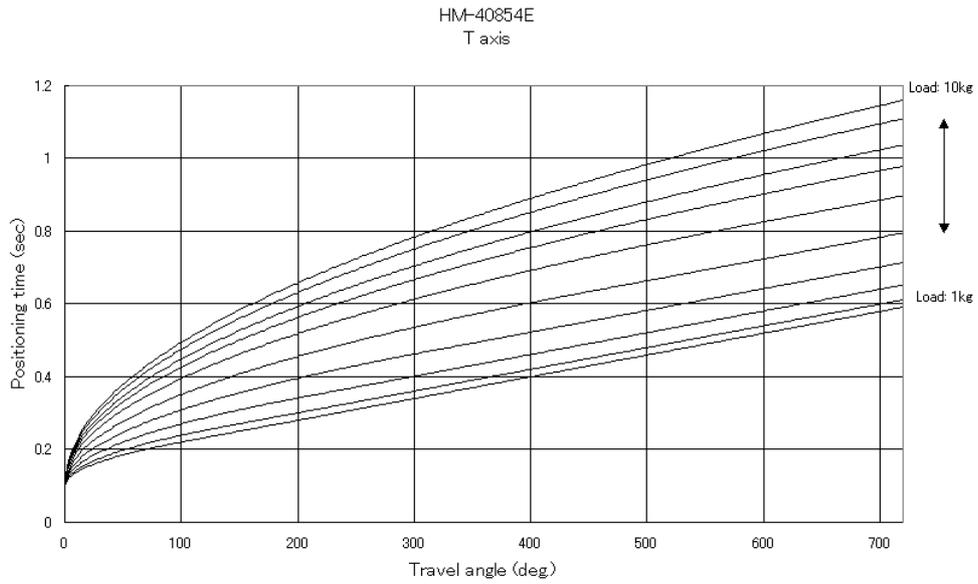


All axes (CP operation)

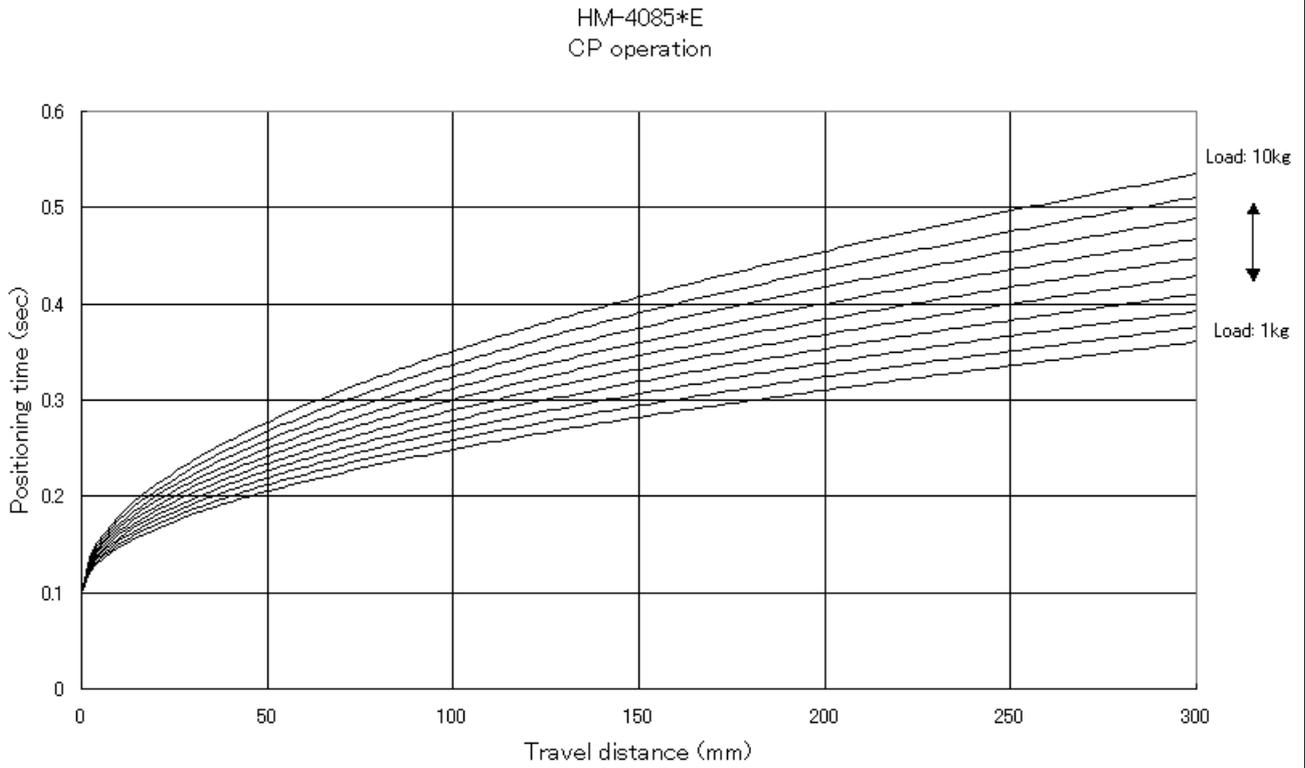


(10) HM-40A02E


J1 axis (PTP motion)

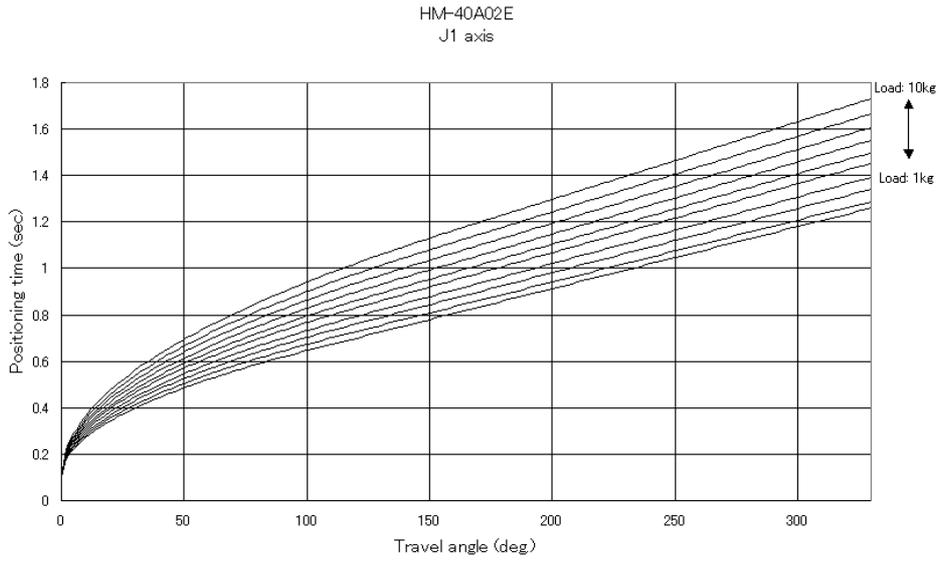


J2 axis (PTP motion)

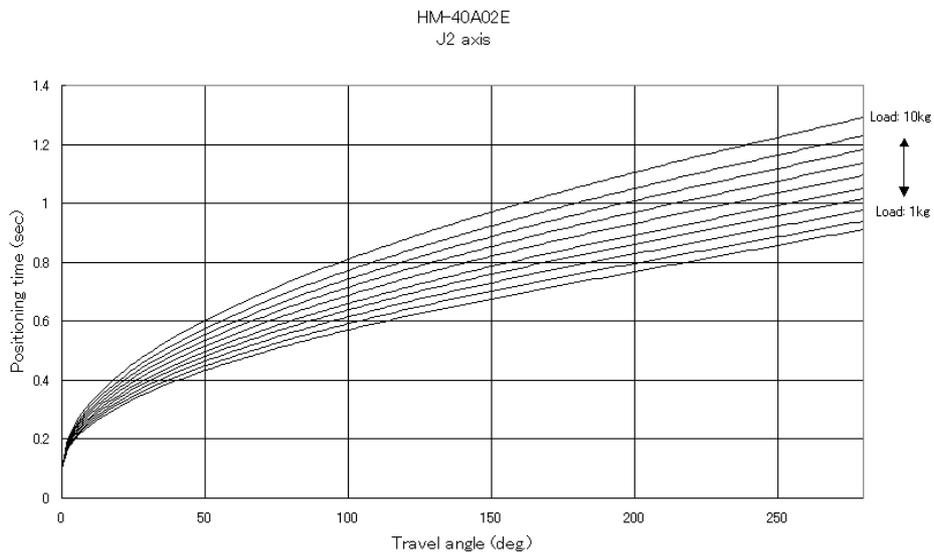


Z axis (PTP motion)

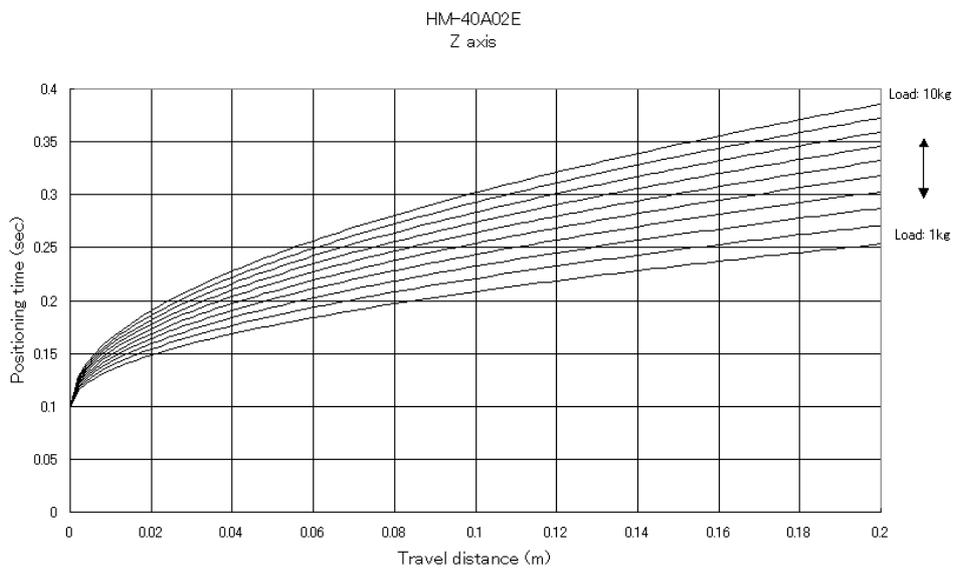

T axis (PTP motion)

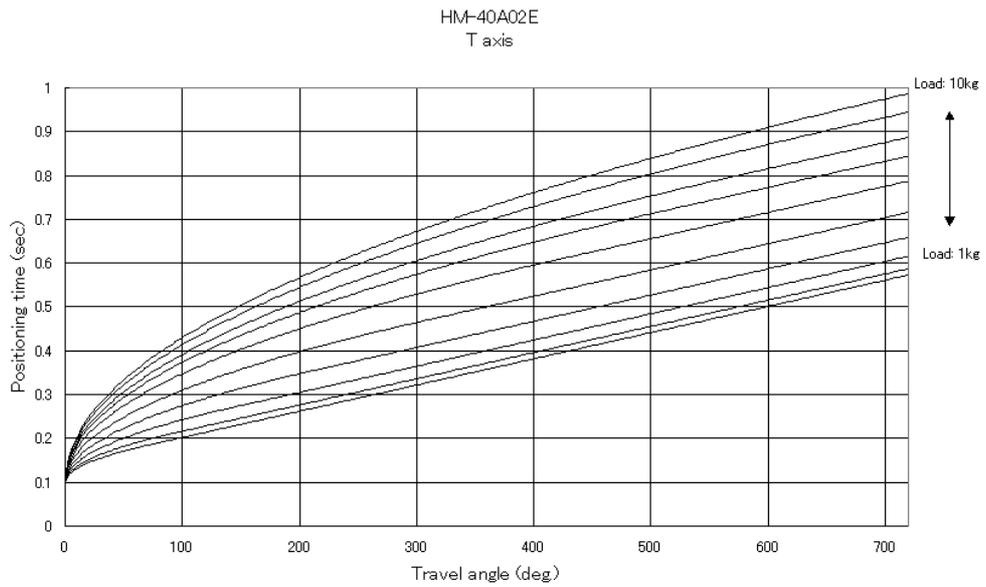


All axes (CP operation)

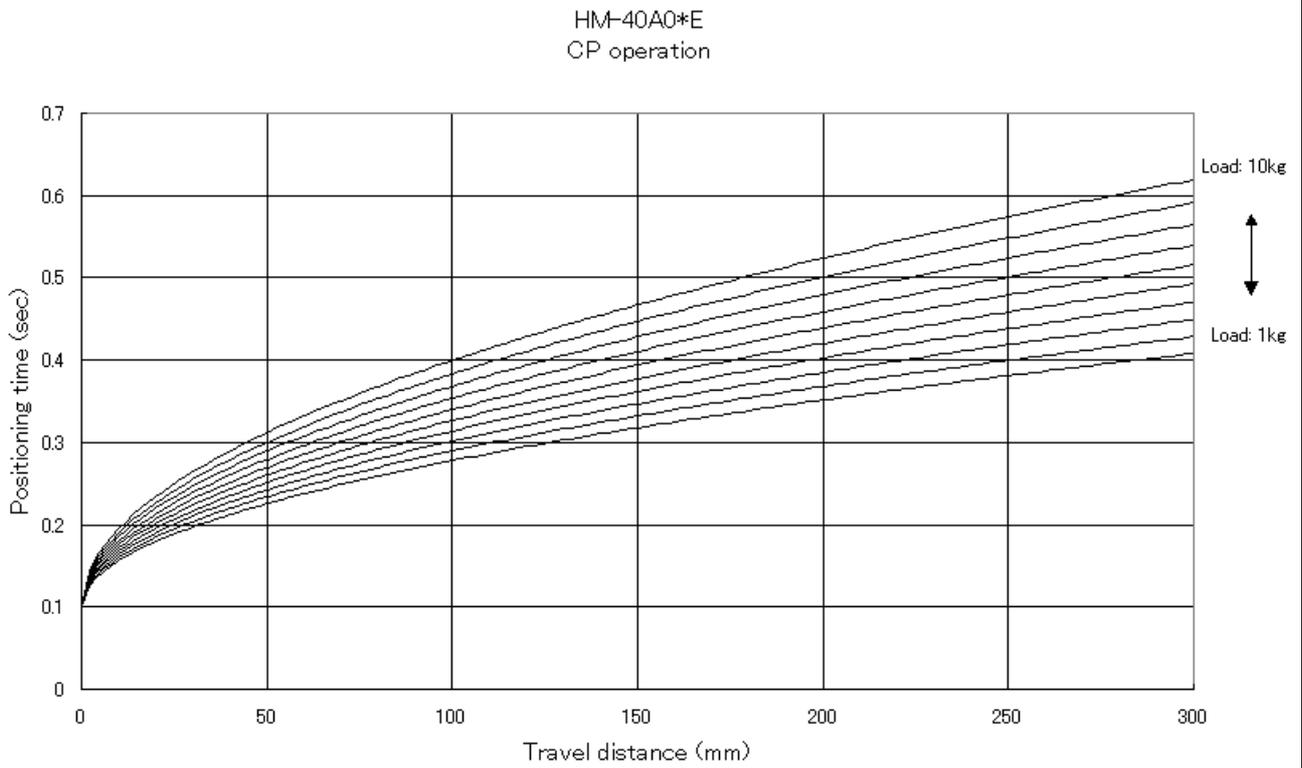


(11) HM-40A03E


J1 axis (PTP motion)

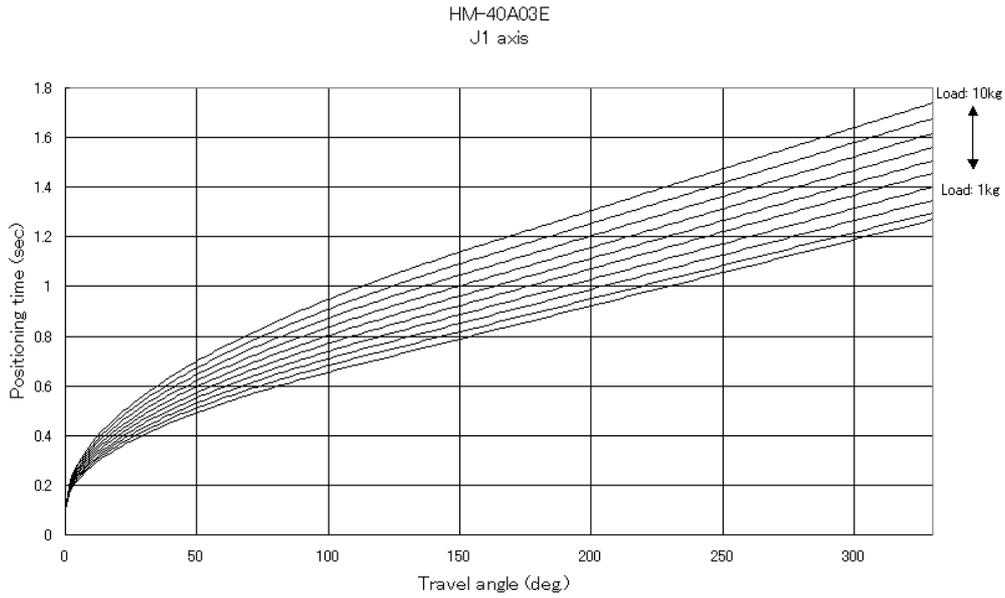


J2 axis (PTP motion)

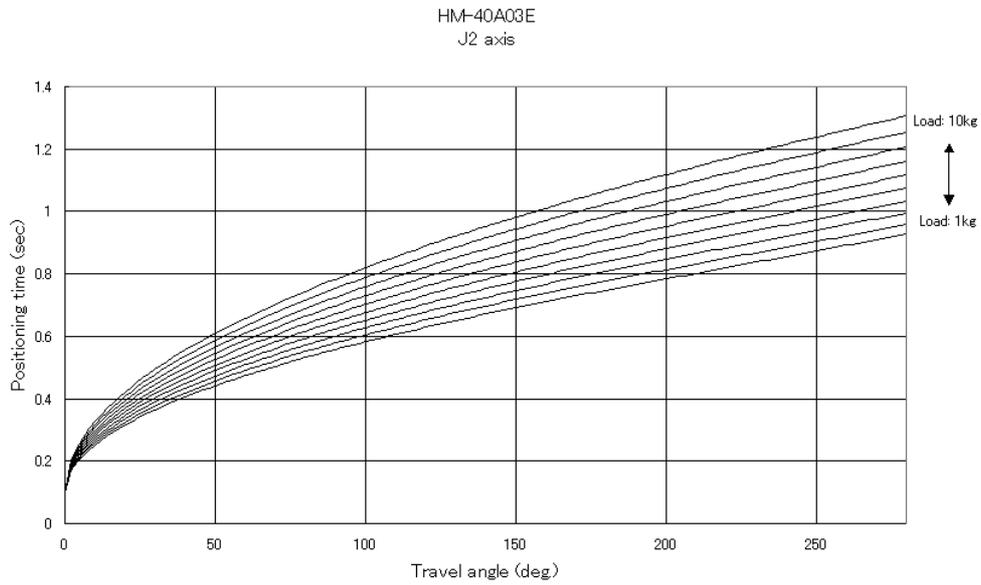


Z axis (PTP motion)

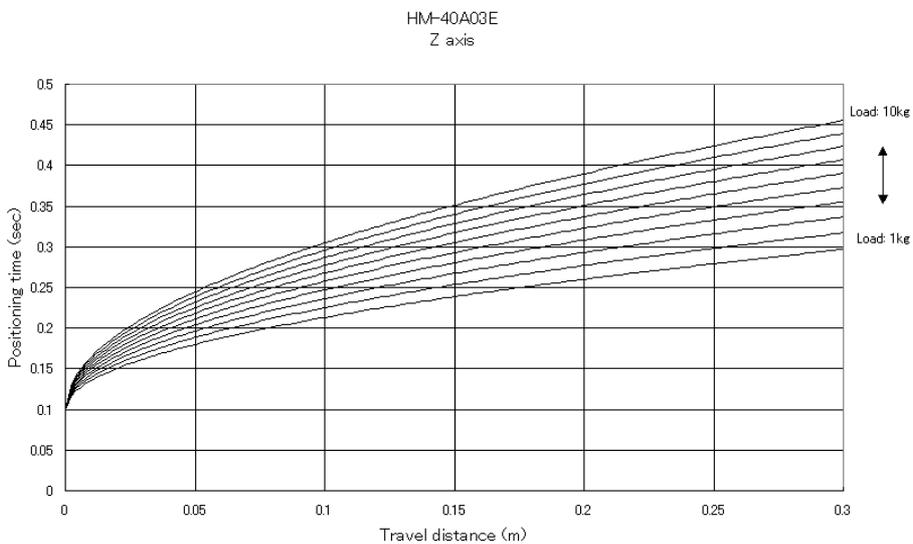

T axis (PTP motion)

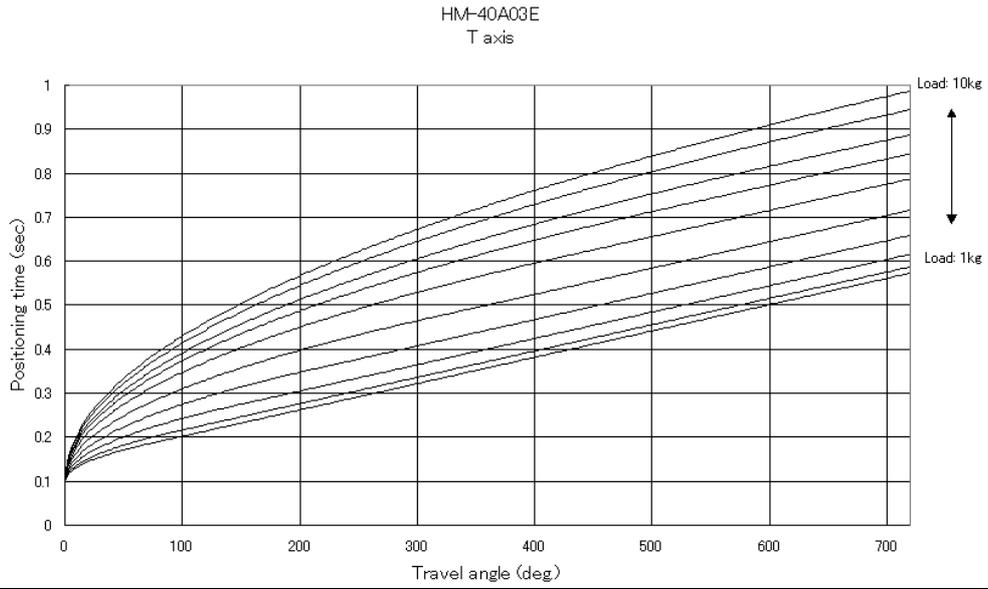


All axes (CP operation)

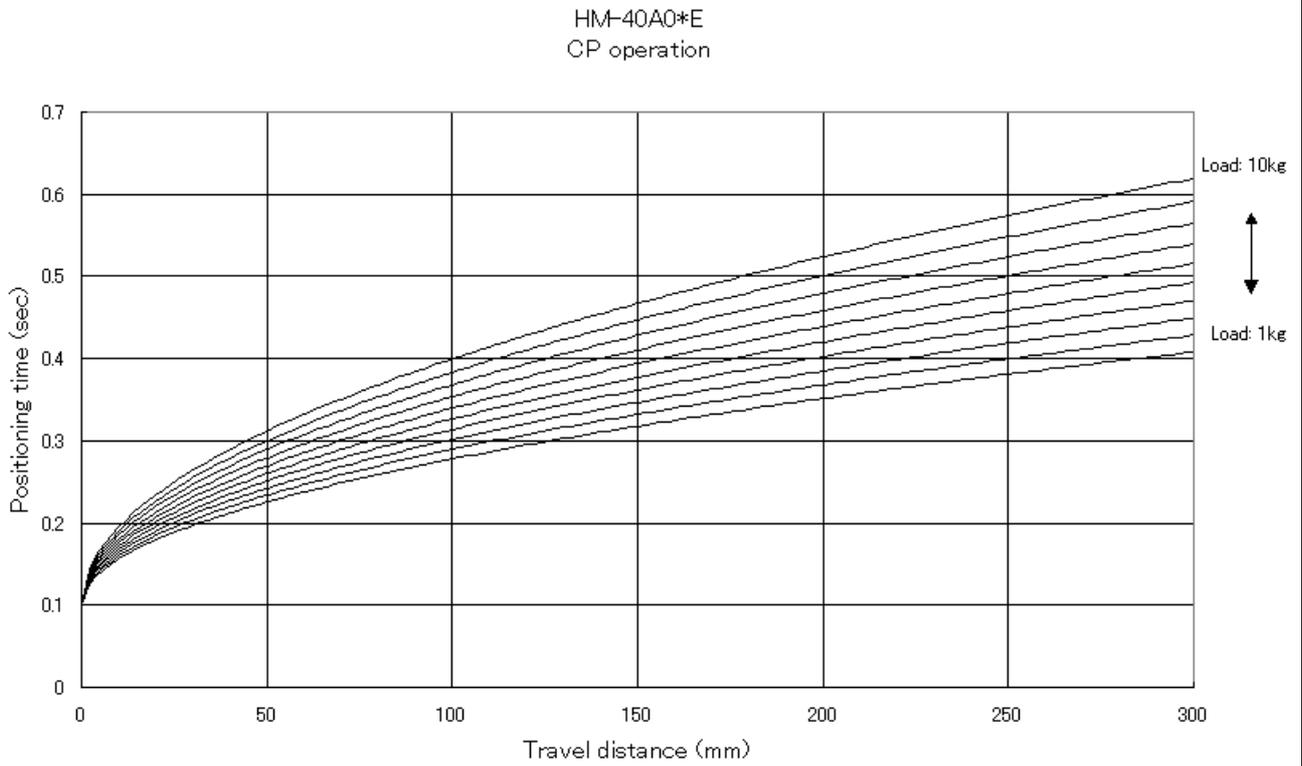


(12) HM-40A04E


J1 axis (PTP motion)

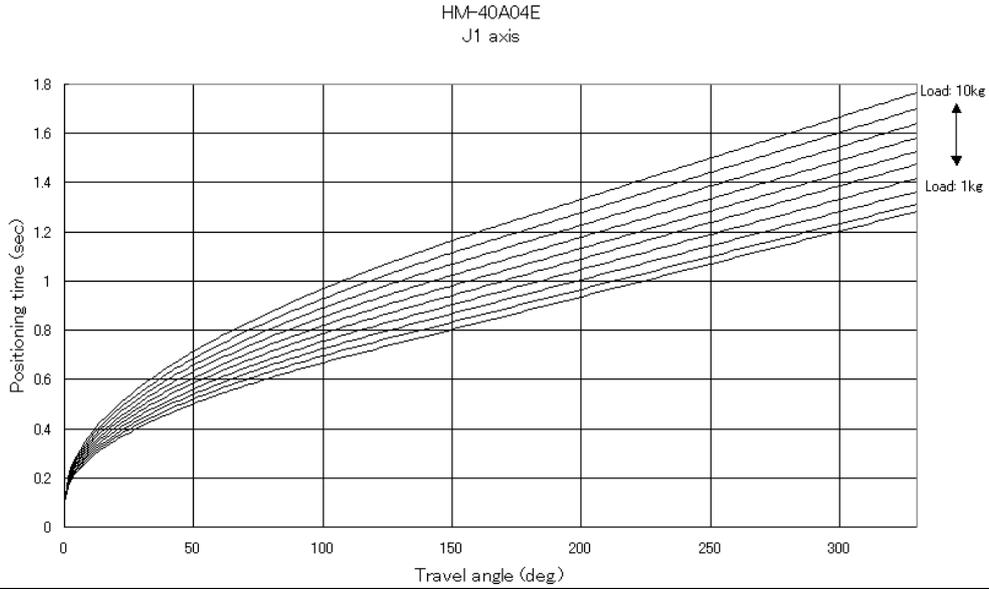


J2 axis (PTP motion)

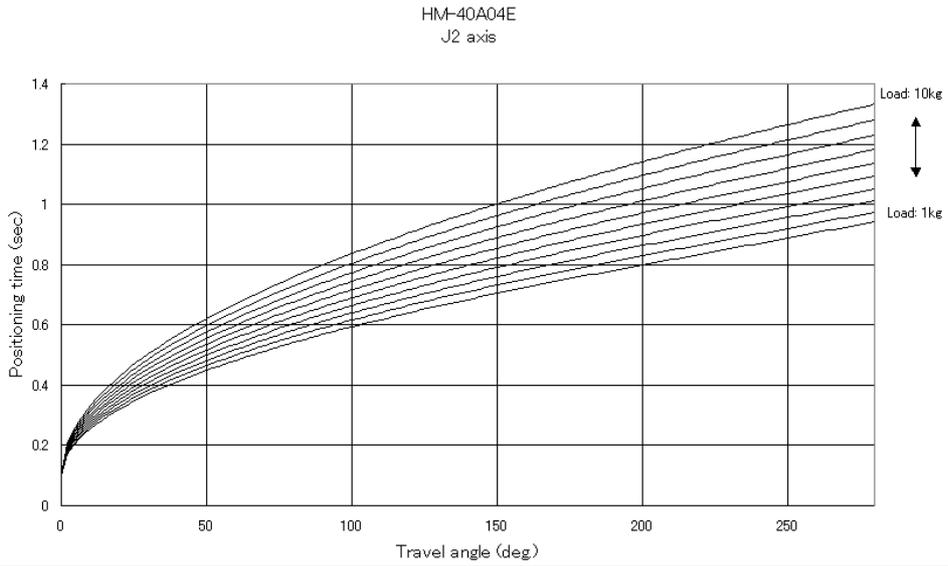


Z axis (PTP motion)

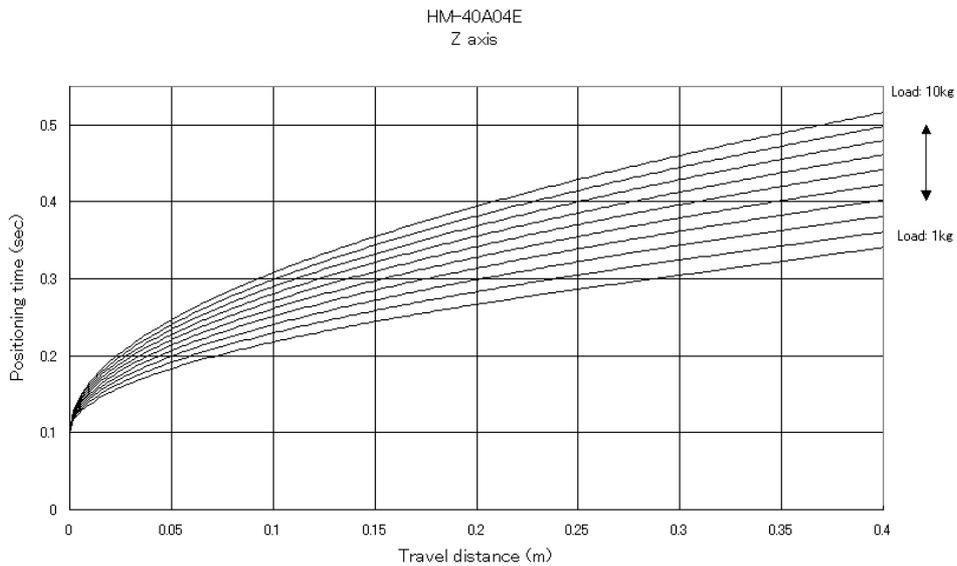

T axis (PTP motion)

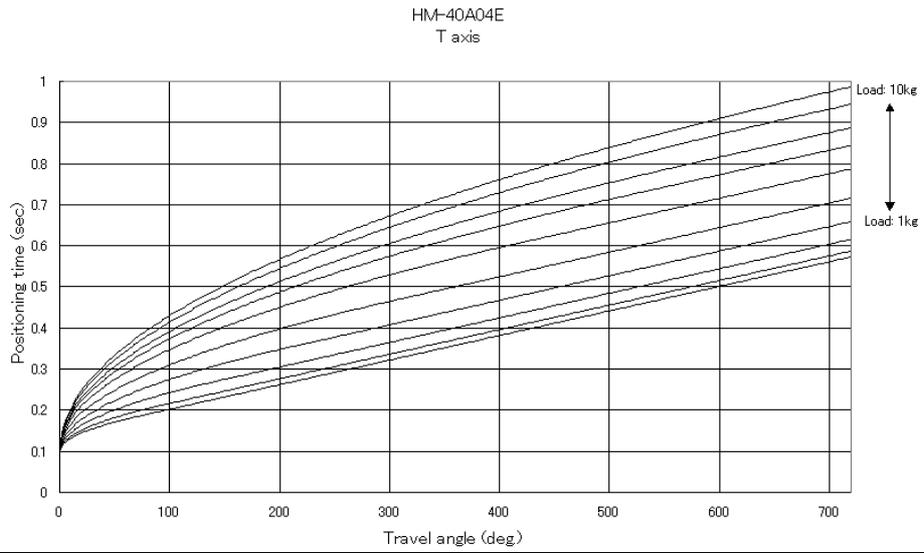


All axes (CP operation)

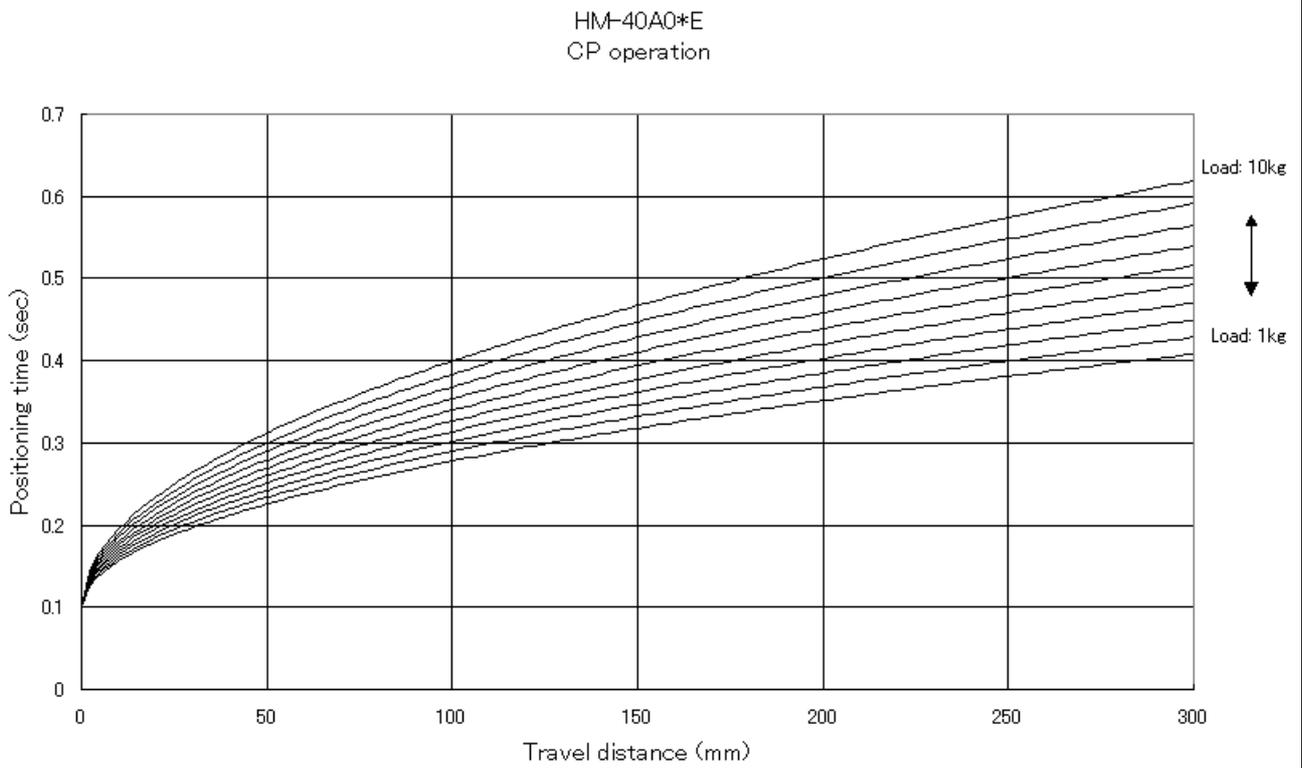


(13) HM-4A602E


J1 axis (PTP motion)

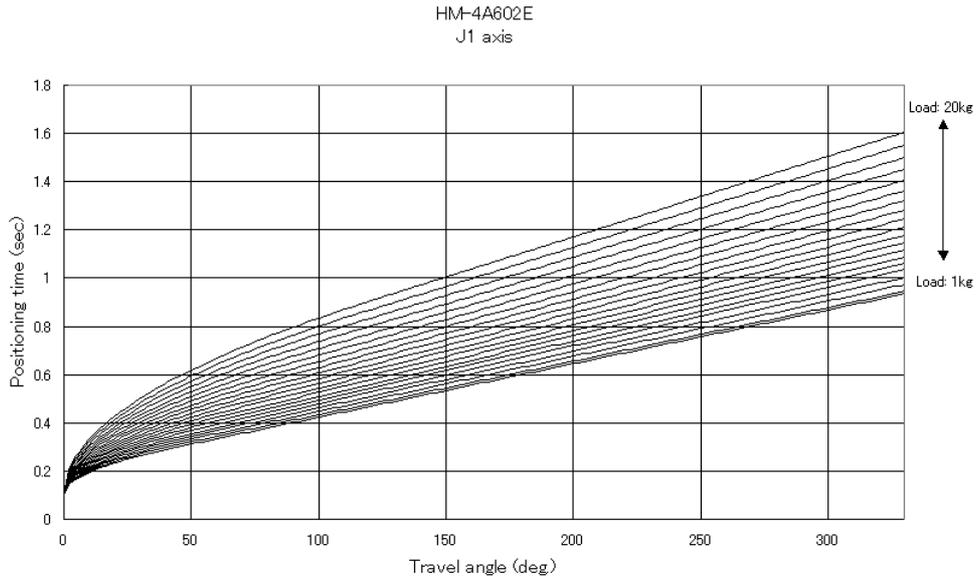


J2 axis (PTP motion)

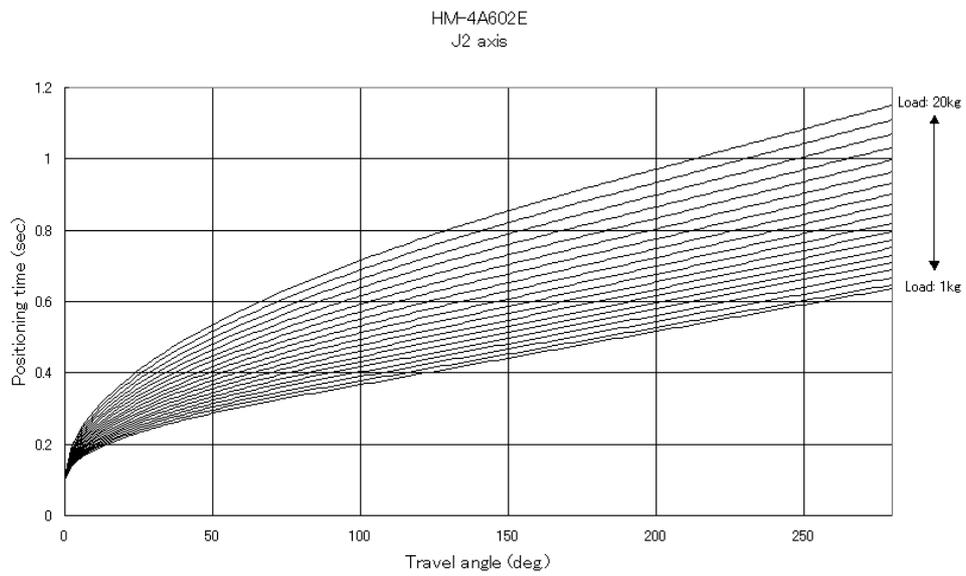


Z axis (PTP motion)

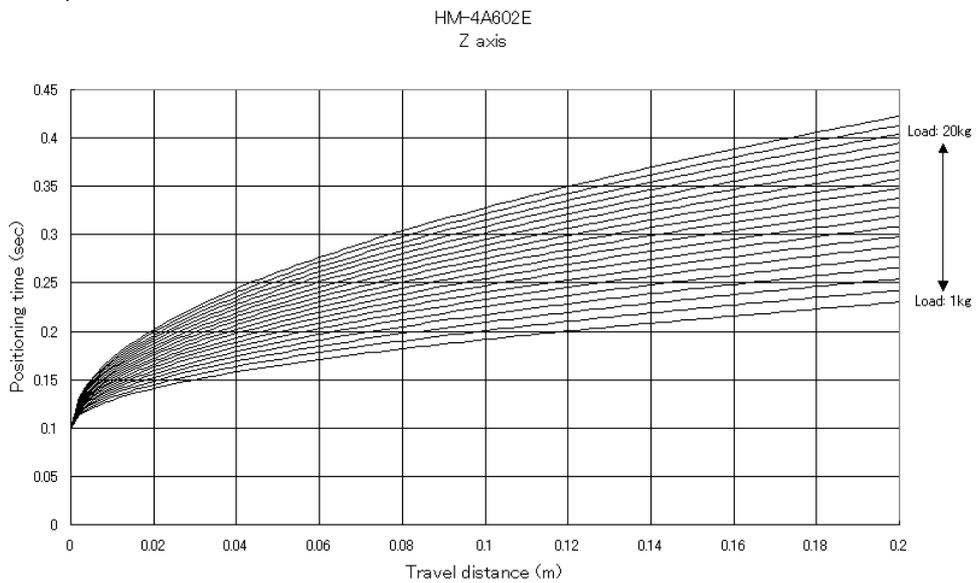

T axis (PTP motion)

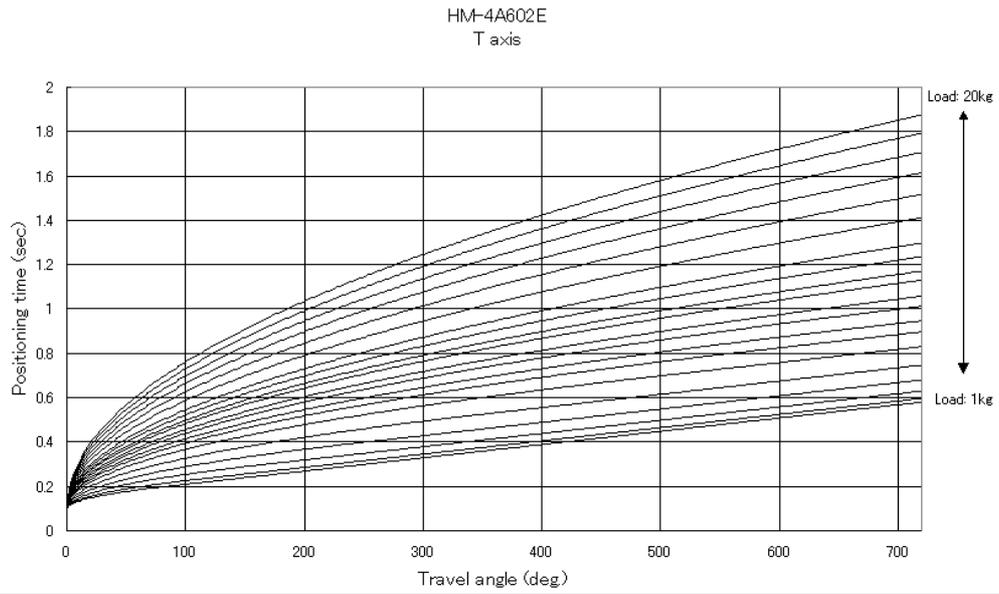


All axes (CP operation)

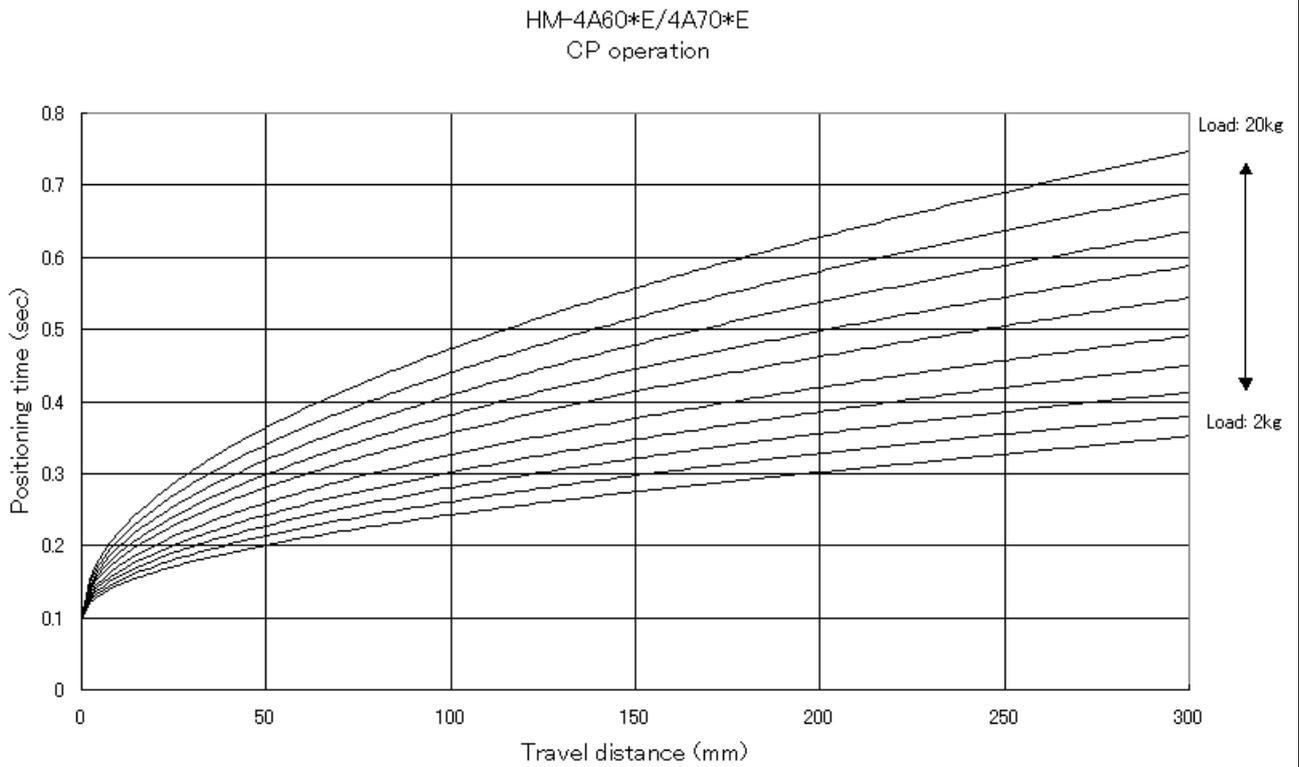


(14) HM-4A603E


J1 axis (PTP motion)

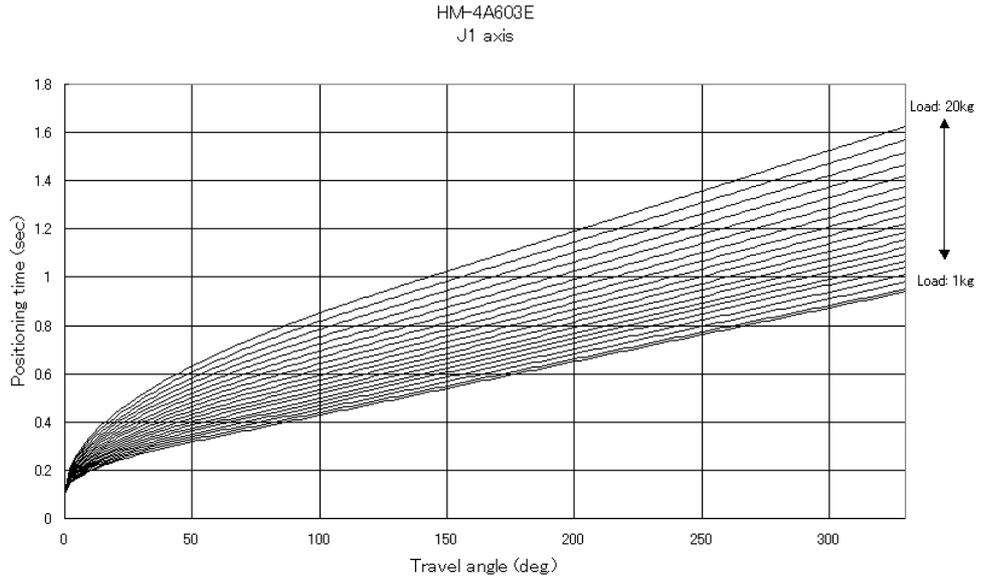


J2 axis (PTP motion)

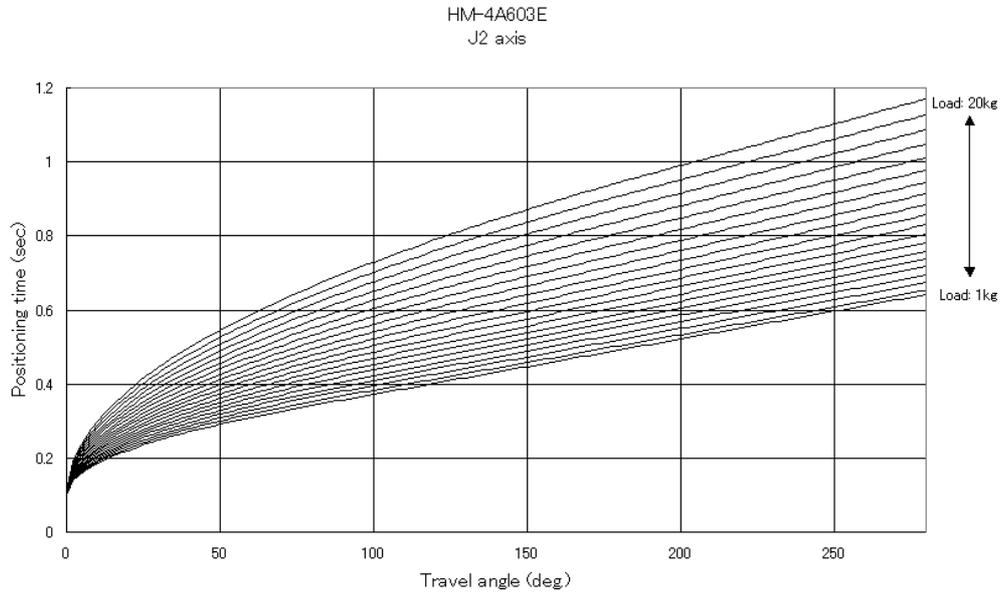


Z axis (PTP motion)

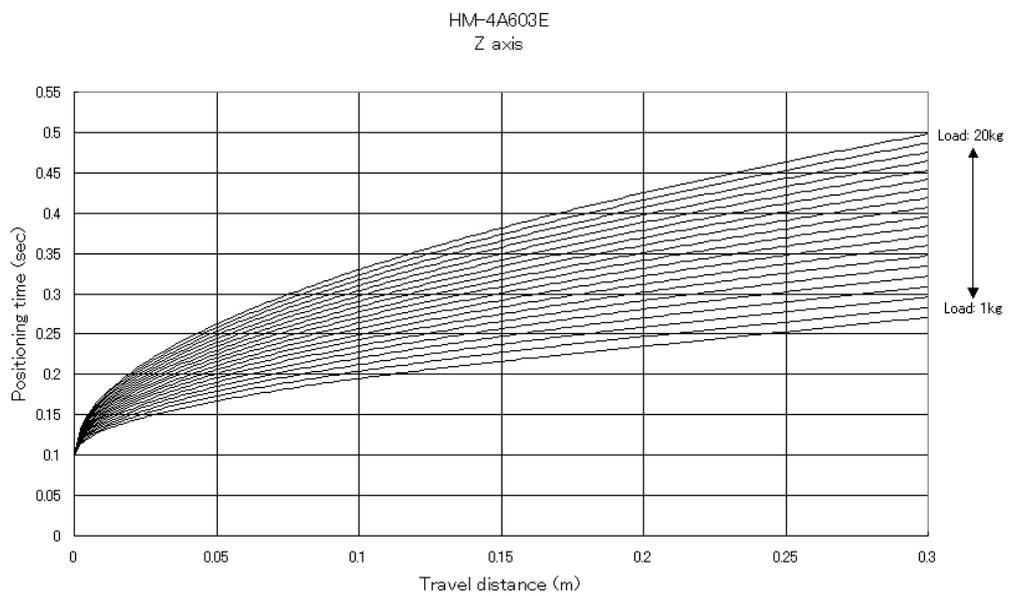

T axis (PTP motion)

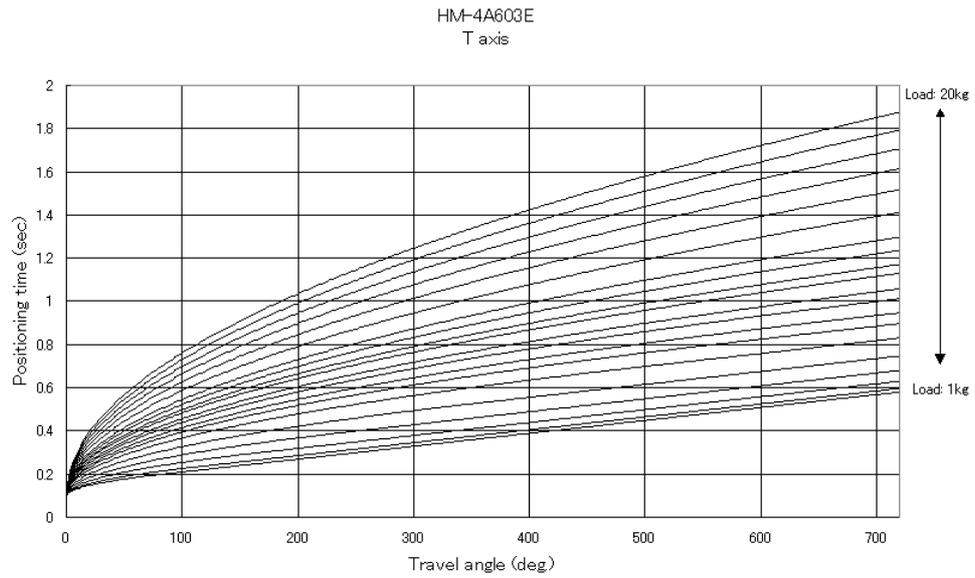


All axes (CP operation)

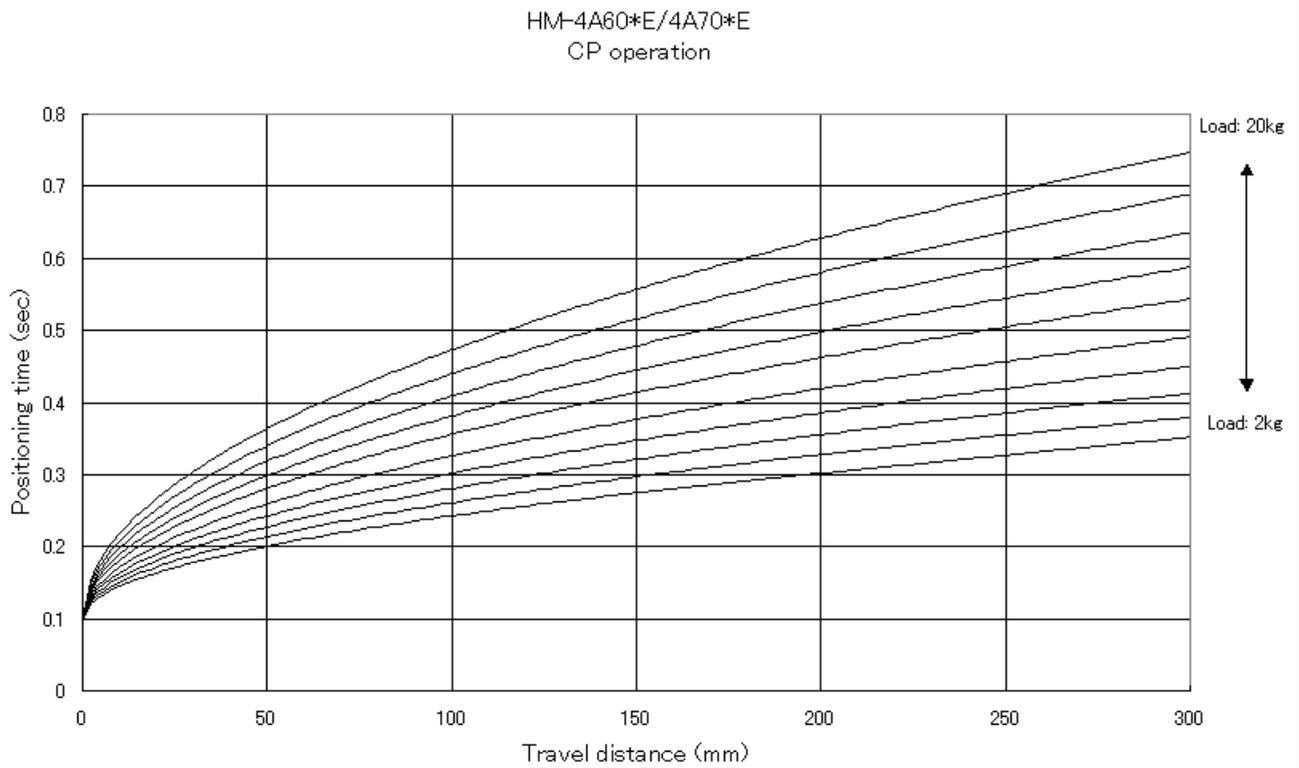


(15) HM-4A604E


J1 axis (PTP motion)

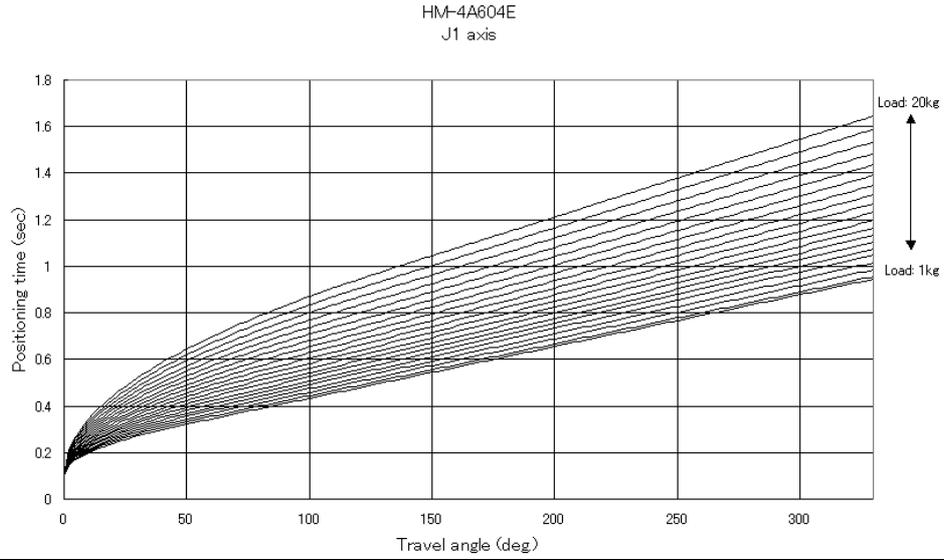


J2 axis (PTP motion)

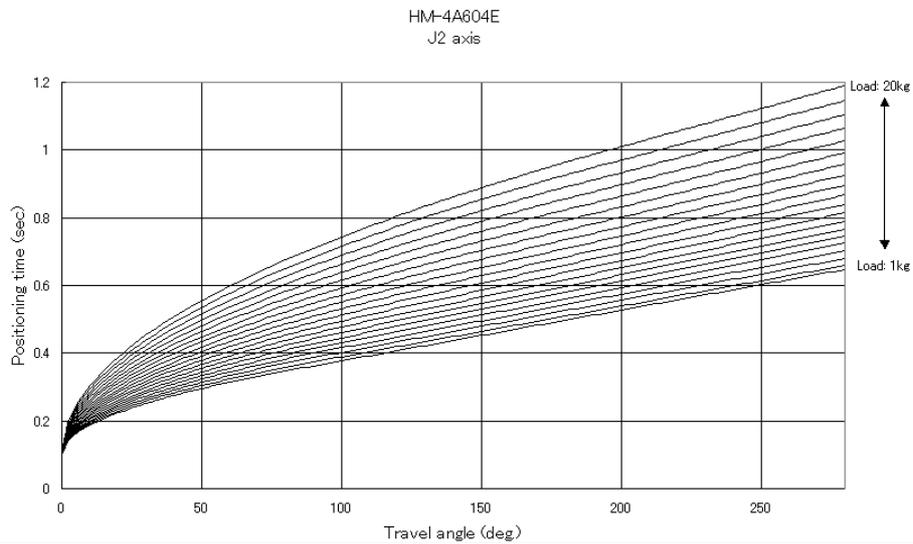


Z axis (PTP motion)

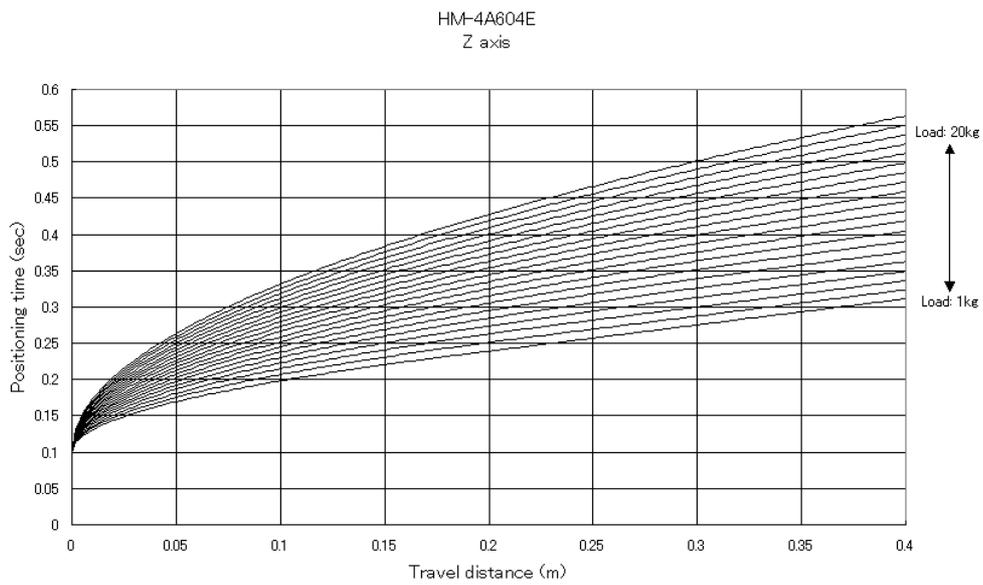

T axis (PTP motion)

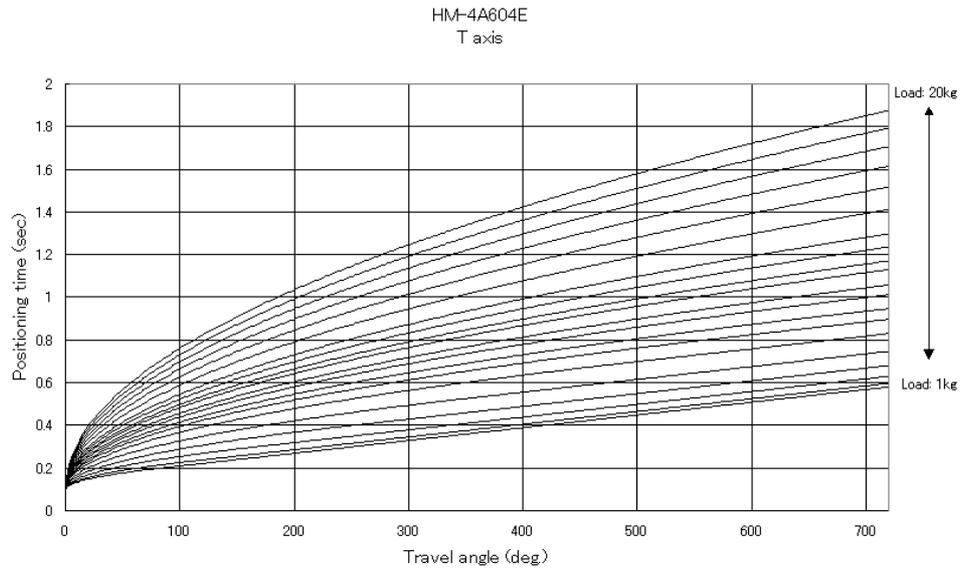


All axes (CP operation)

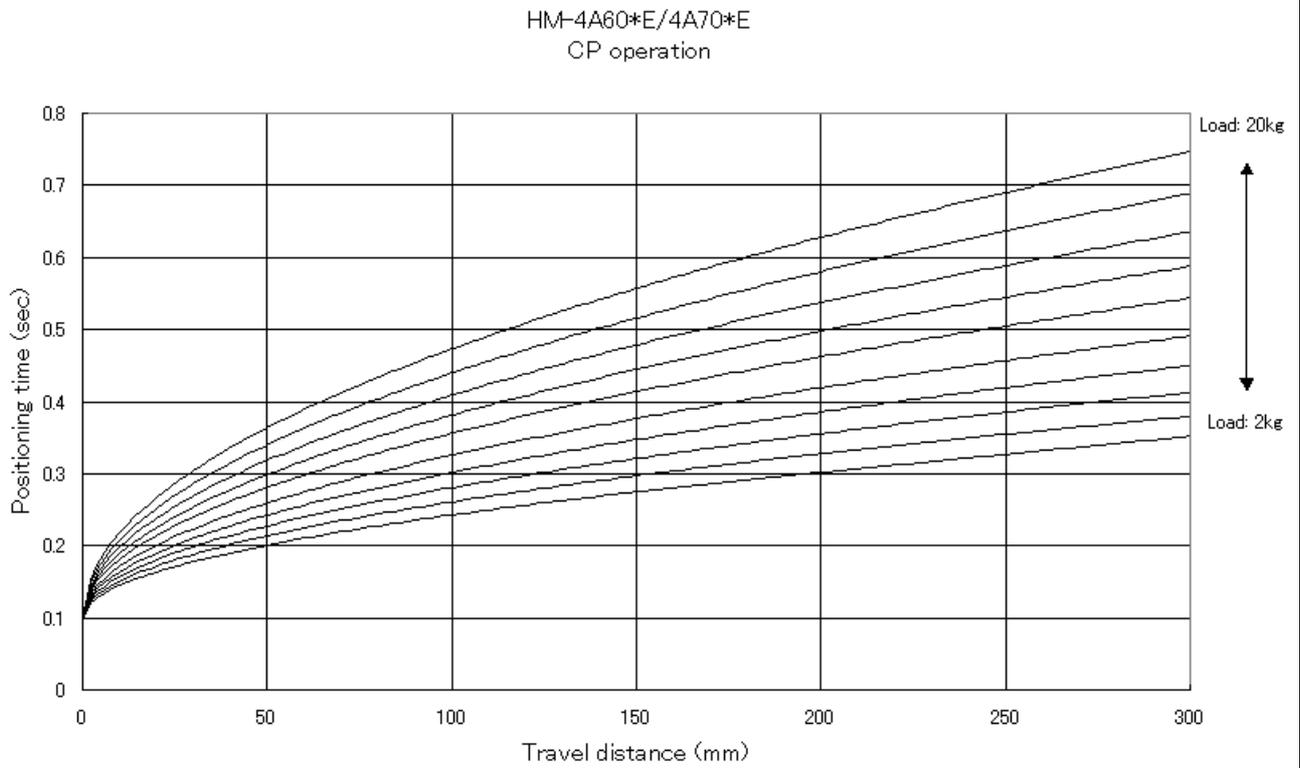


(16) HM/HMS-4A702E


J1 axis (PTP motion)

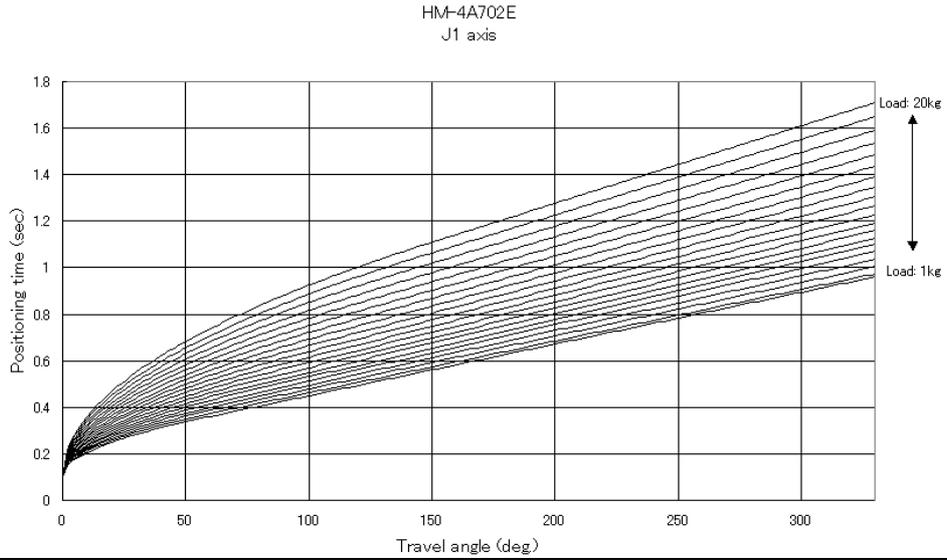


J2 axis (PTP motion)

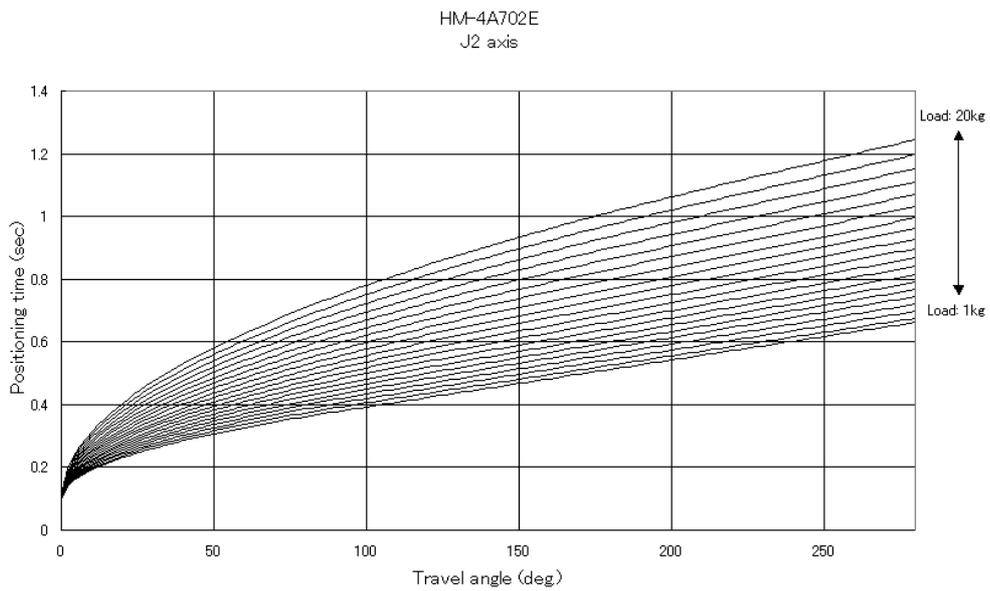


Z axis (PTP motion)

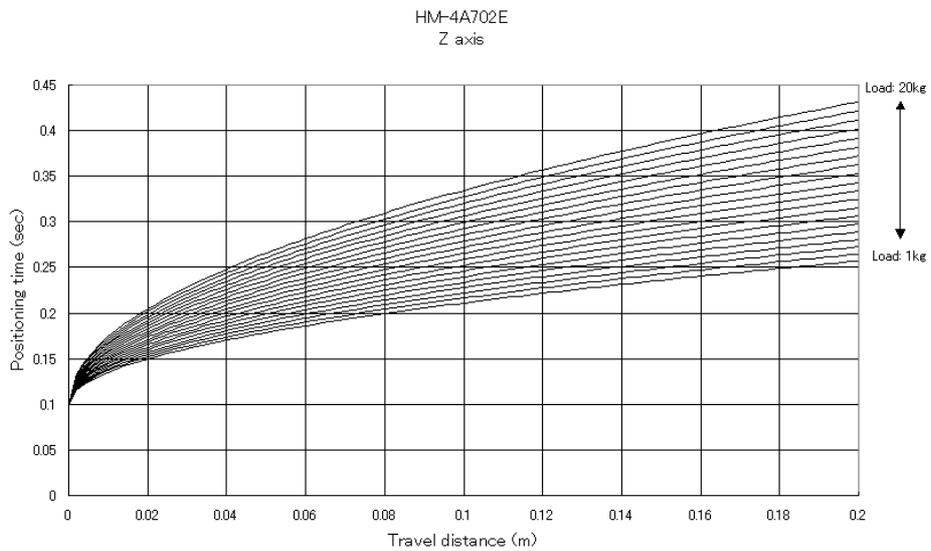

T axis (PTP motion)

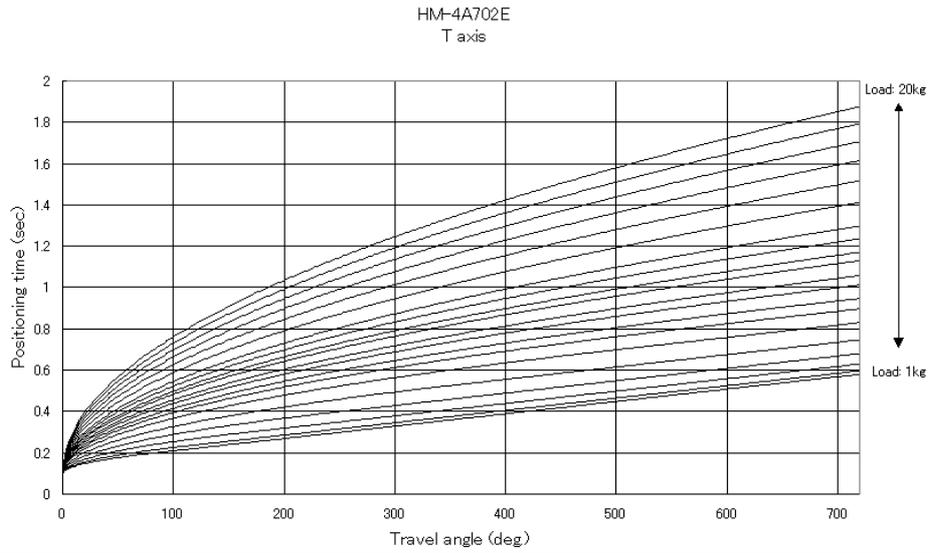


All axes (CP operation)

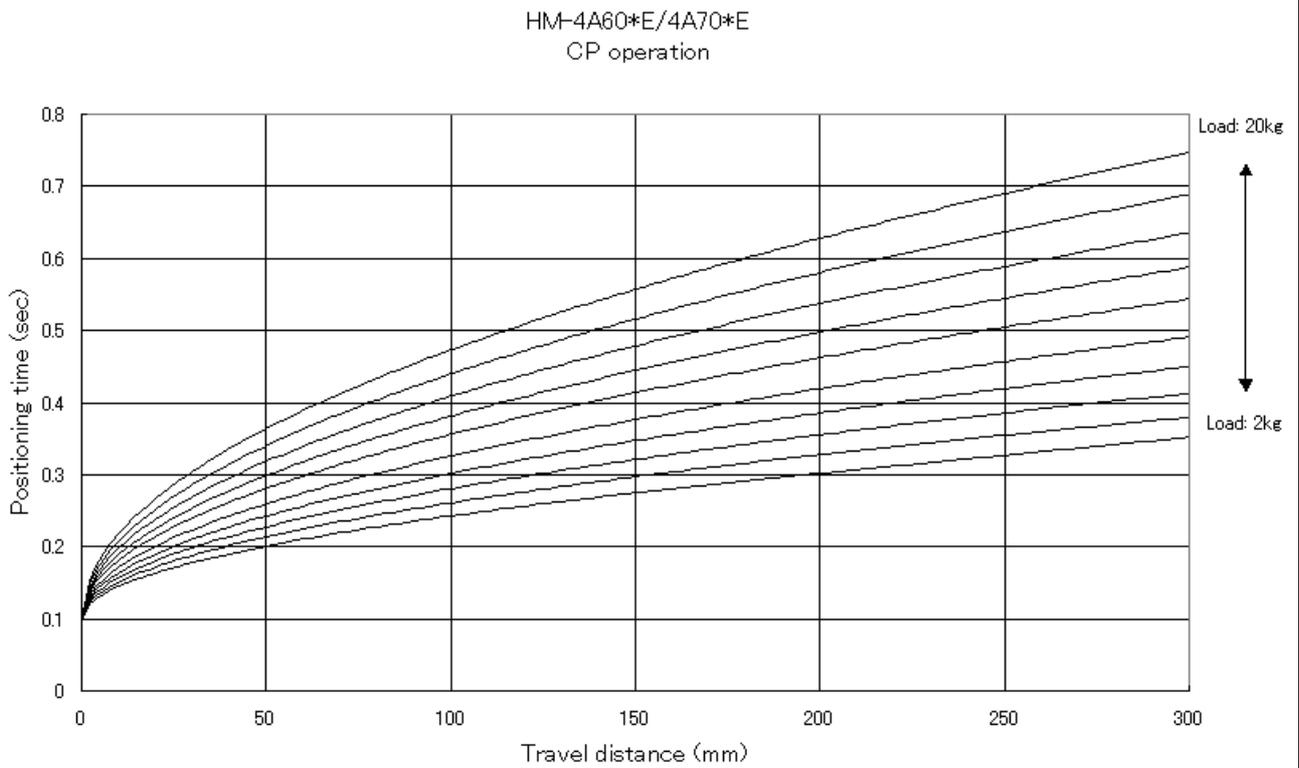


(17) HM/HMS-4A703E


J1 axis (PTP motion)

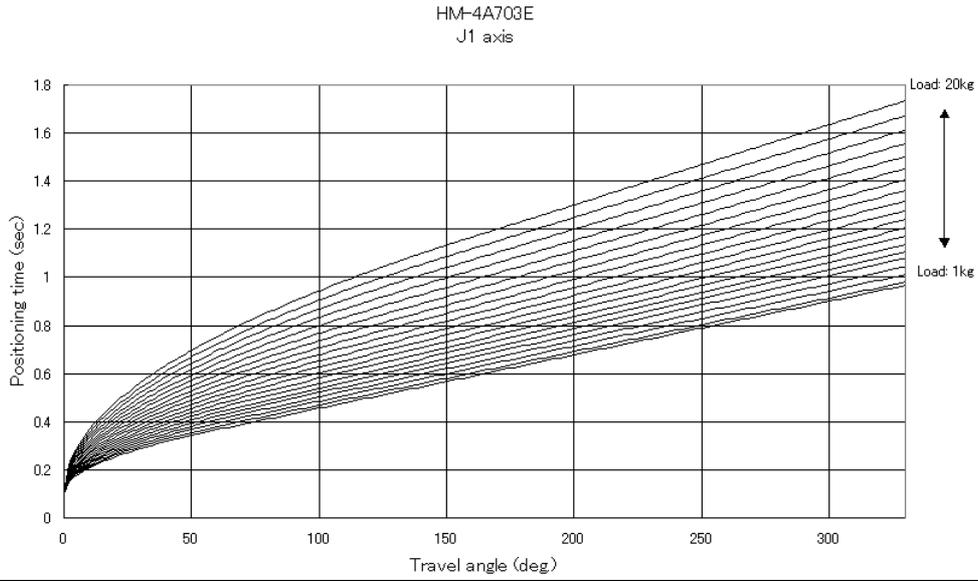


J2 axis (PTP motion)

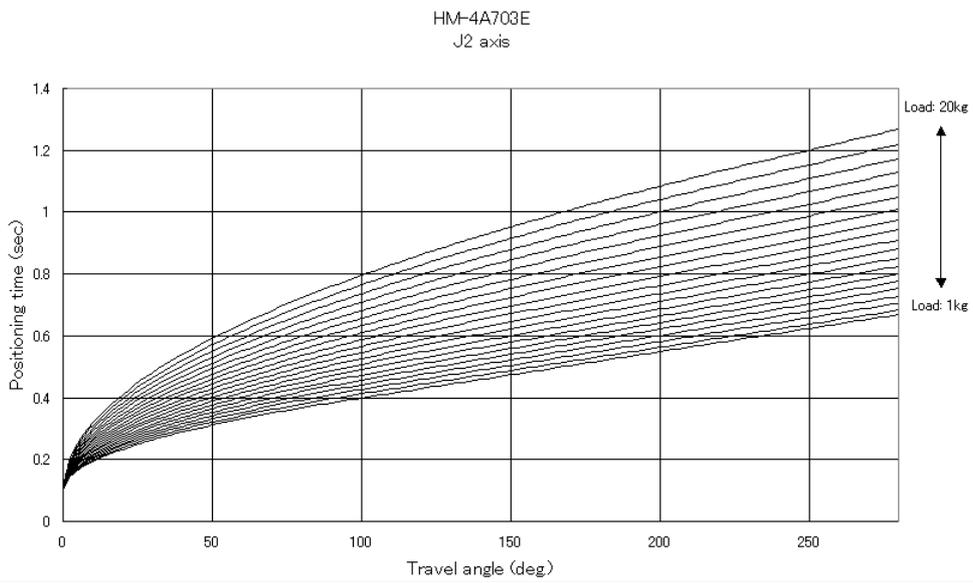


Z axis (PTP motion)

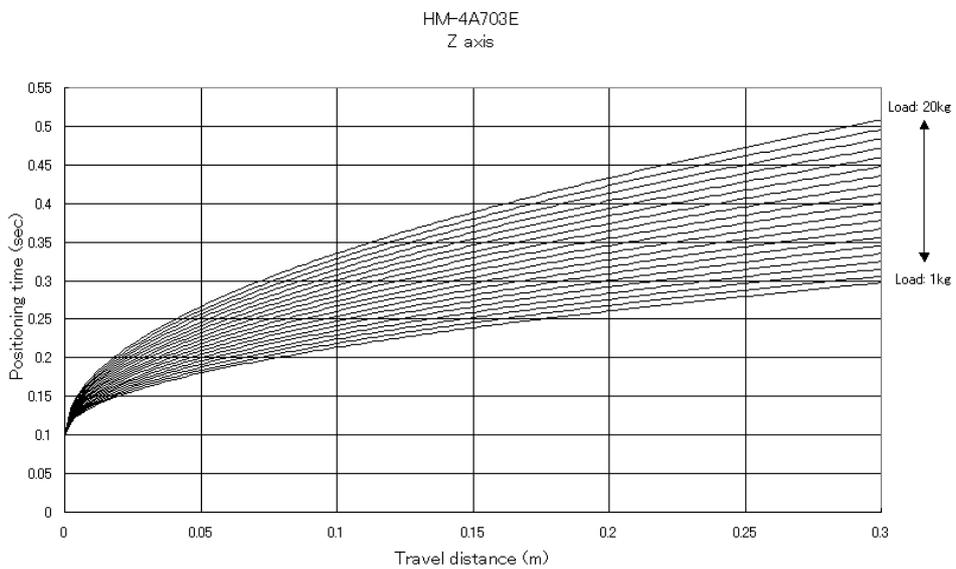

T axis (PTP motion)

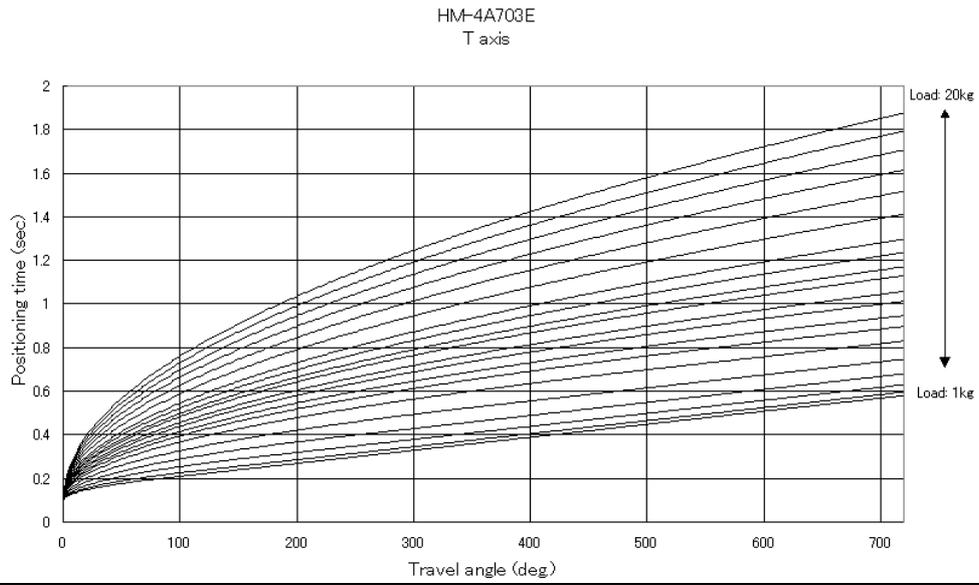


All axes (CP operation)

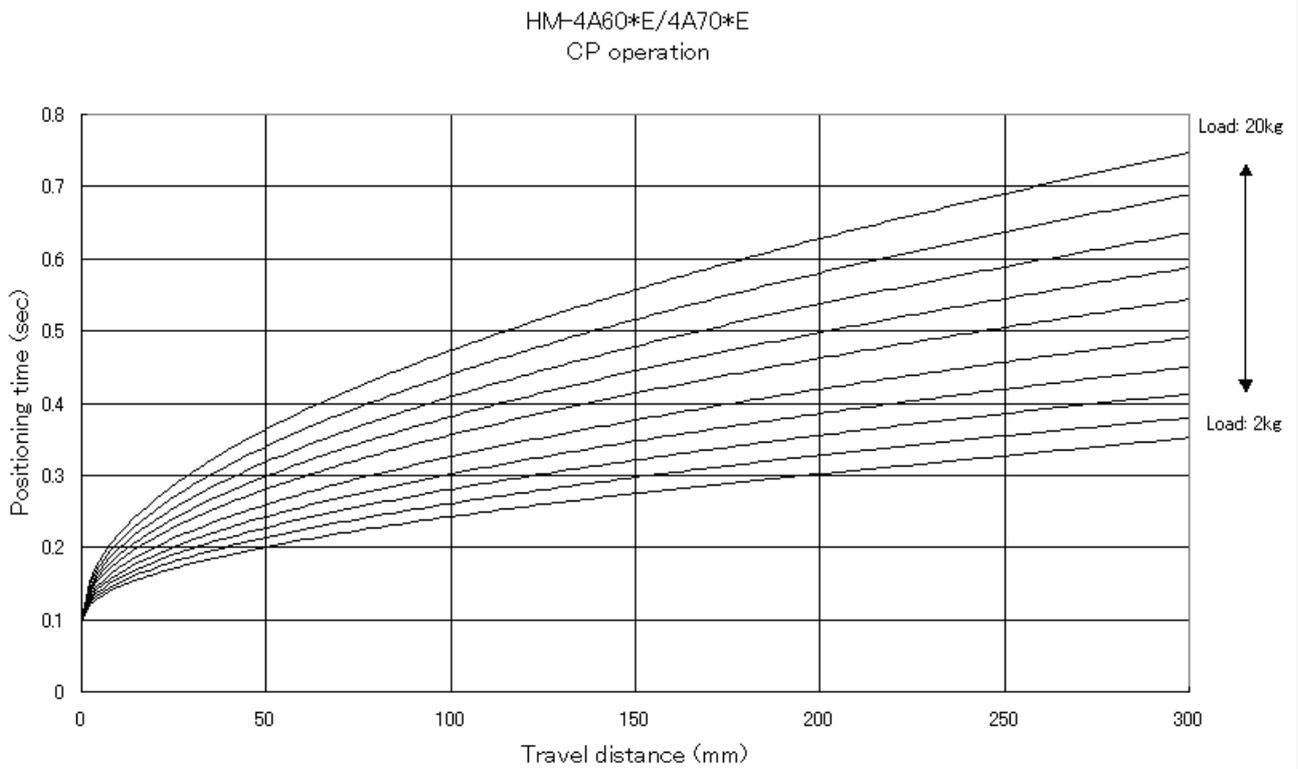


(18) HM/HMS-4A704E


J1 axis (PTP motion)

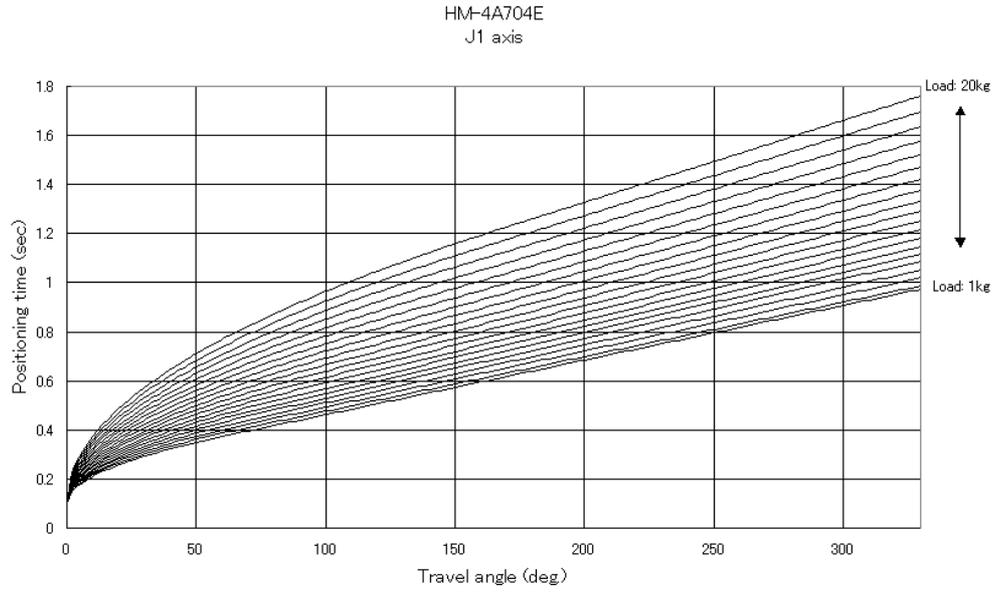


J2 axis (PTP motion)

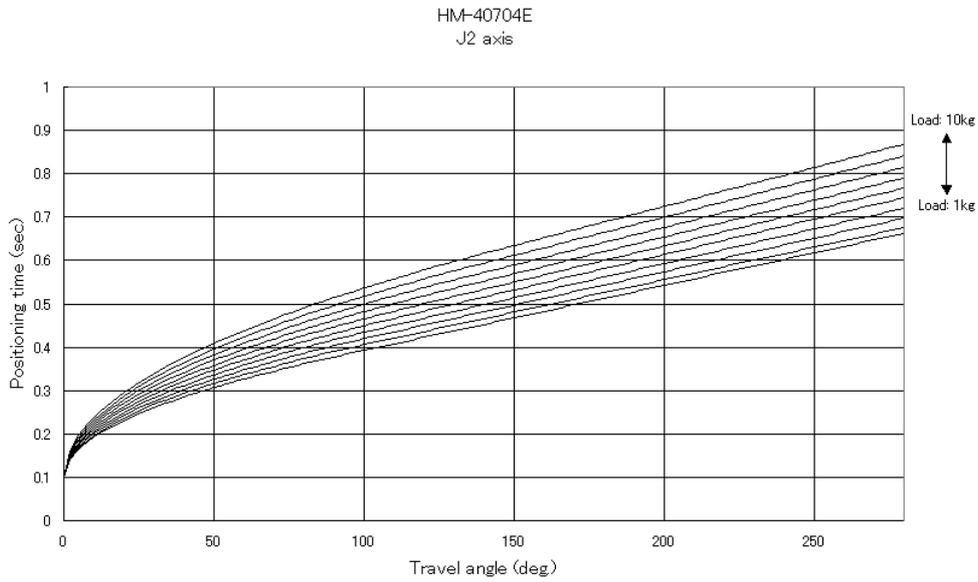


Z axis (PTP motion)

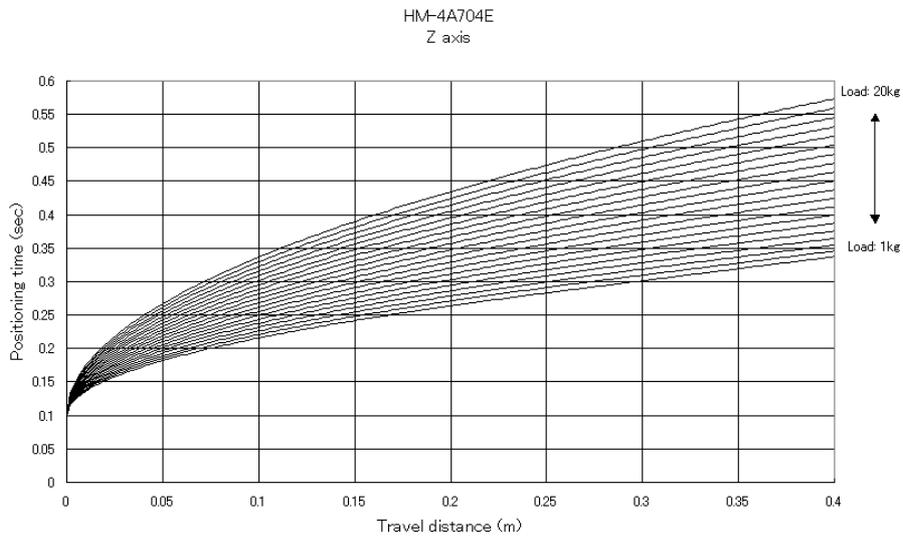

T axis (PTP motion)

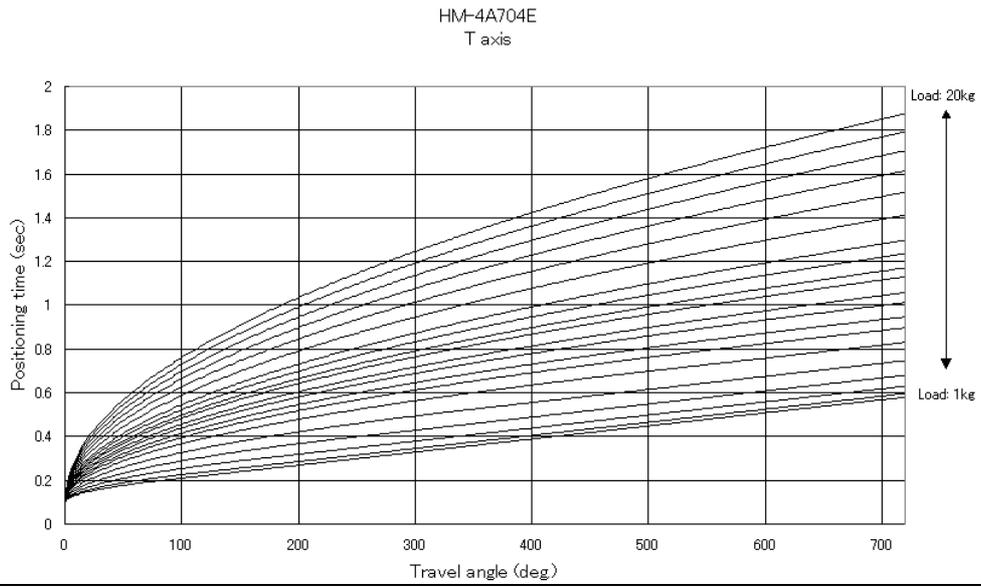


All axes (CP operation)

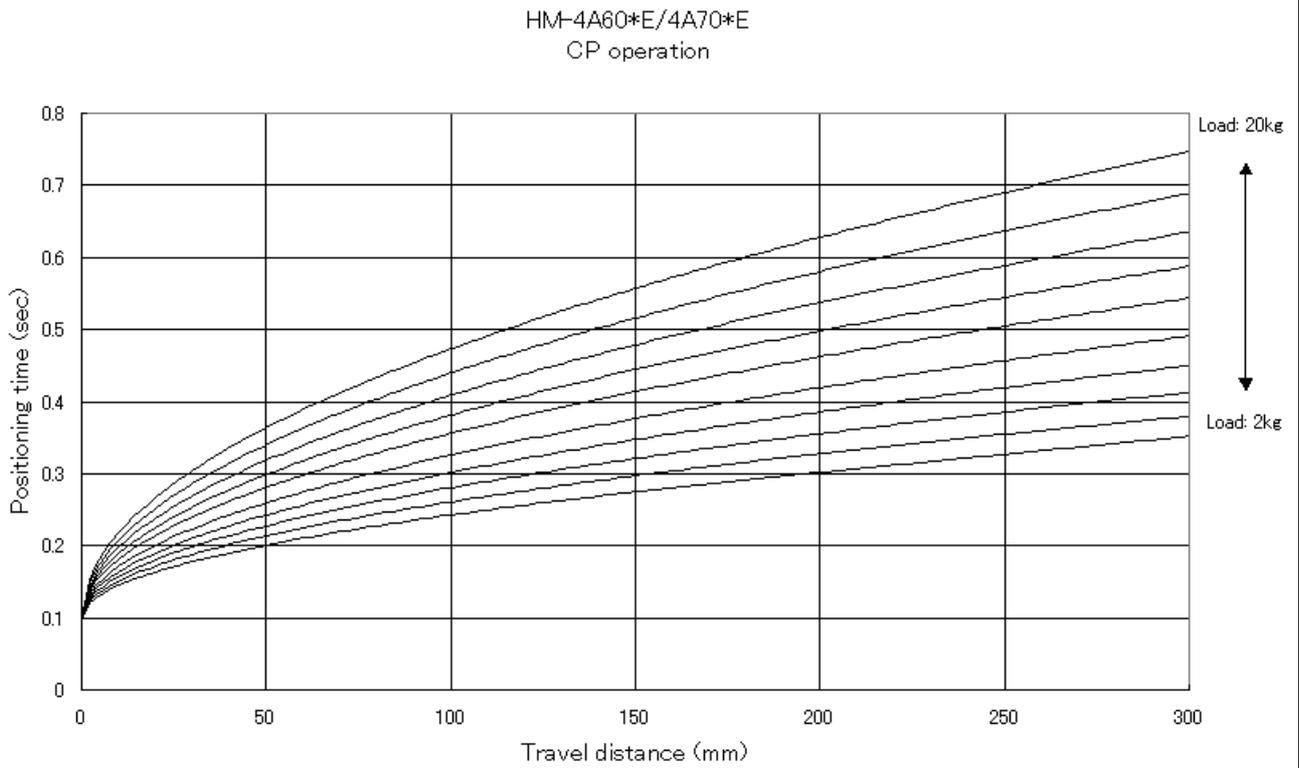


(19) HM/HMS-4A852E


J1 axis (PTP motion)

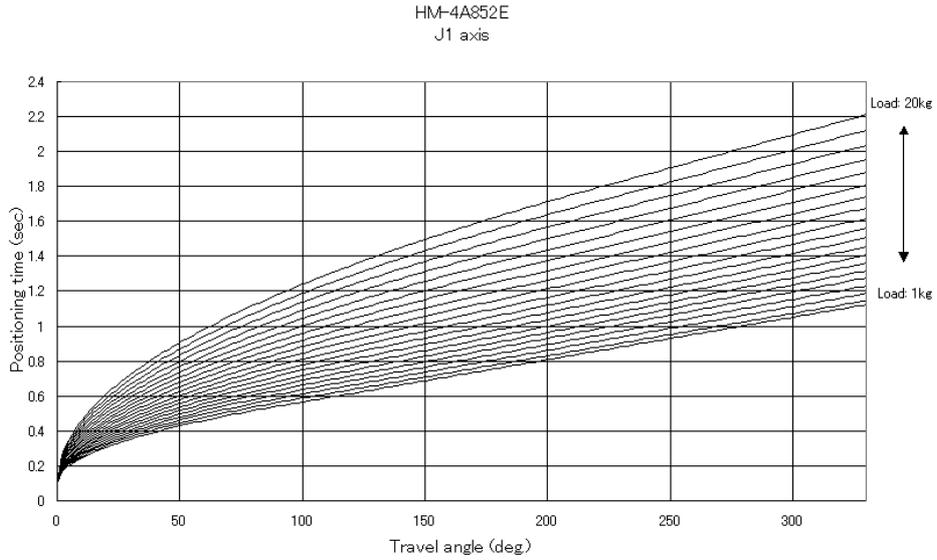


J2 axis (PTP motion)

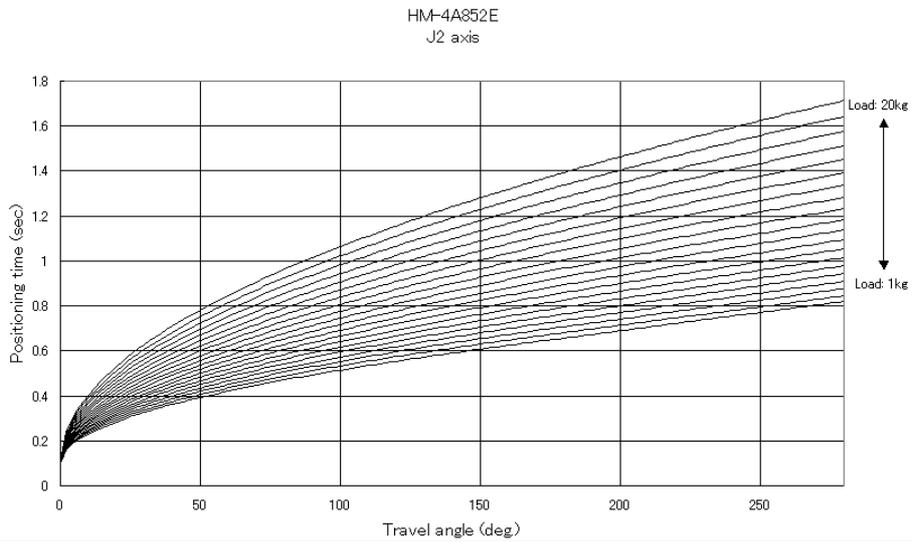


Z axis (PTP motion)

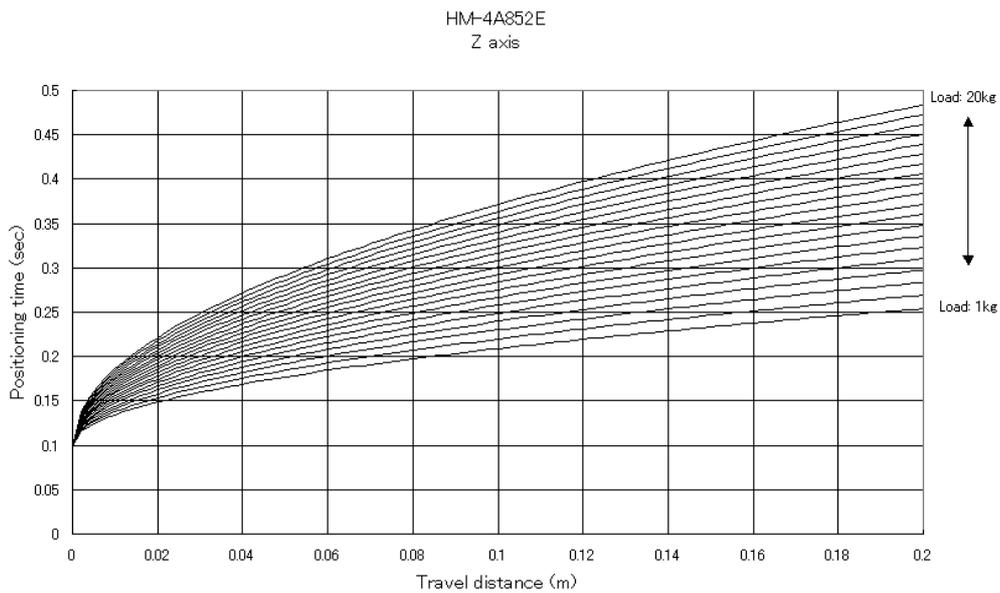

T axis (PTP motion)

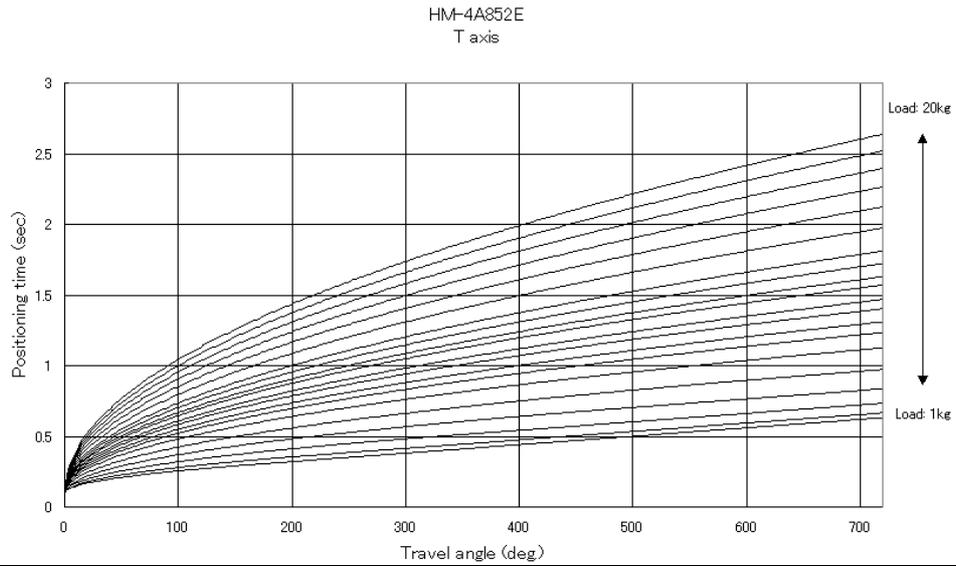


All axes (CP operation)

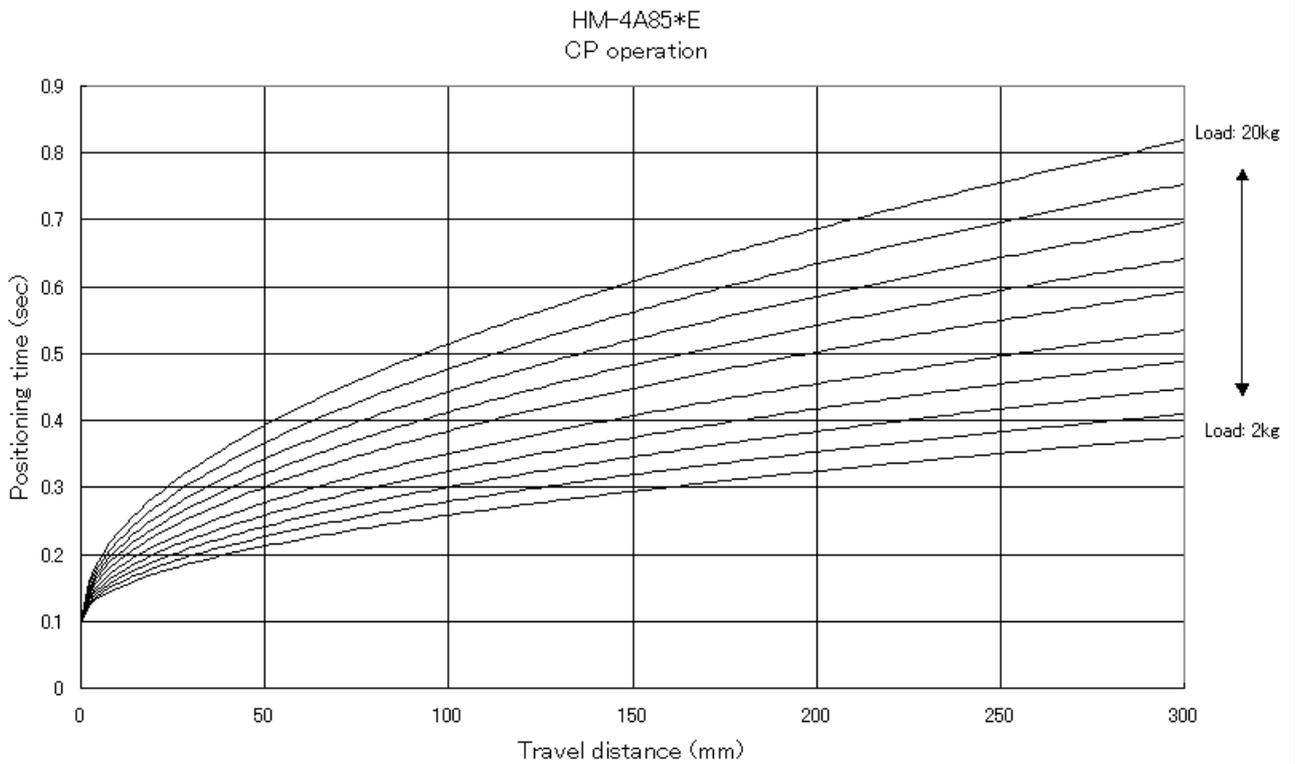


(20) HM/HMS-4A853E


J1 axis (PTP motion)

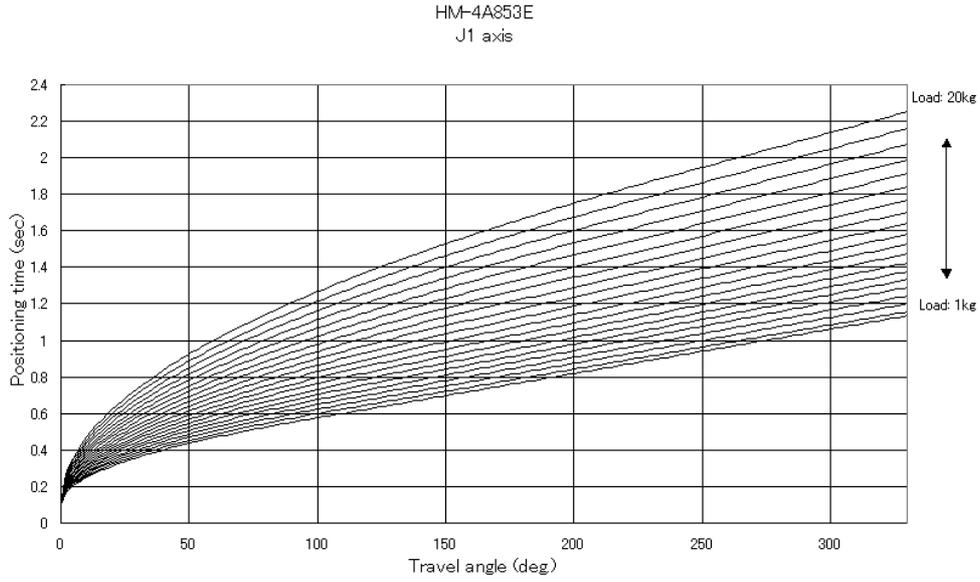


J2 axis (PTP motion)

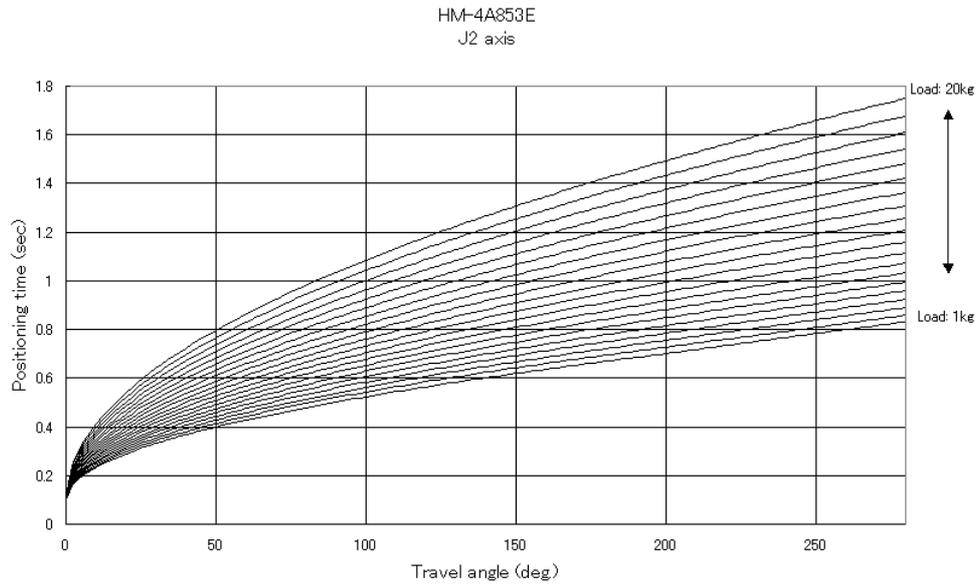


Z axis (PTP motion)

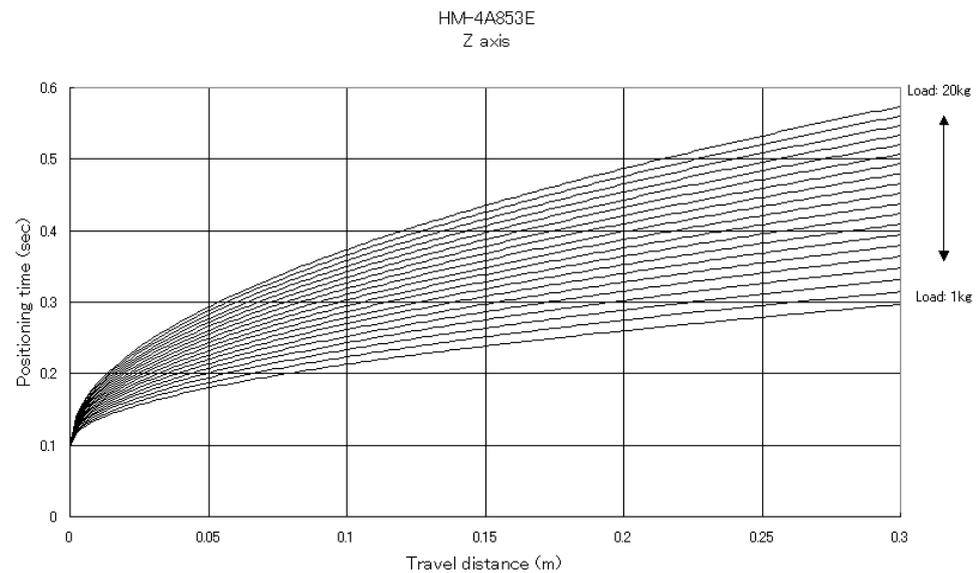

T axis (PTP motion)

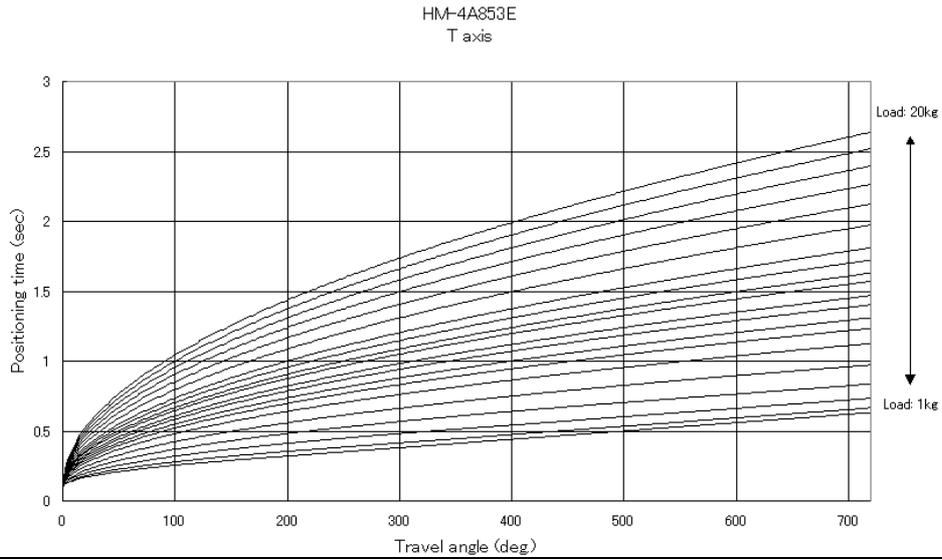


All axes (CP operation)

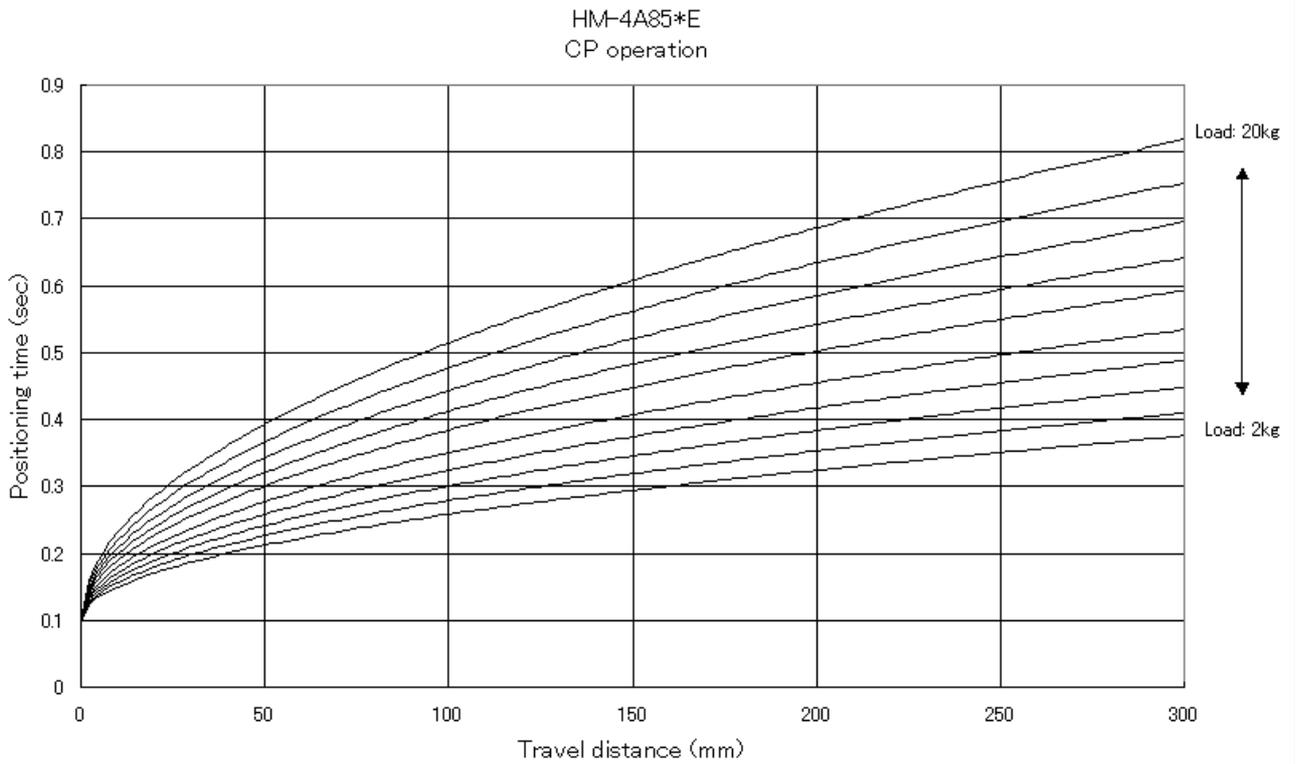


(21) HM/HMS-4A854E


J1 axis (PTP motion)

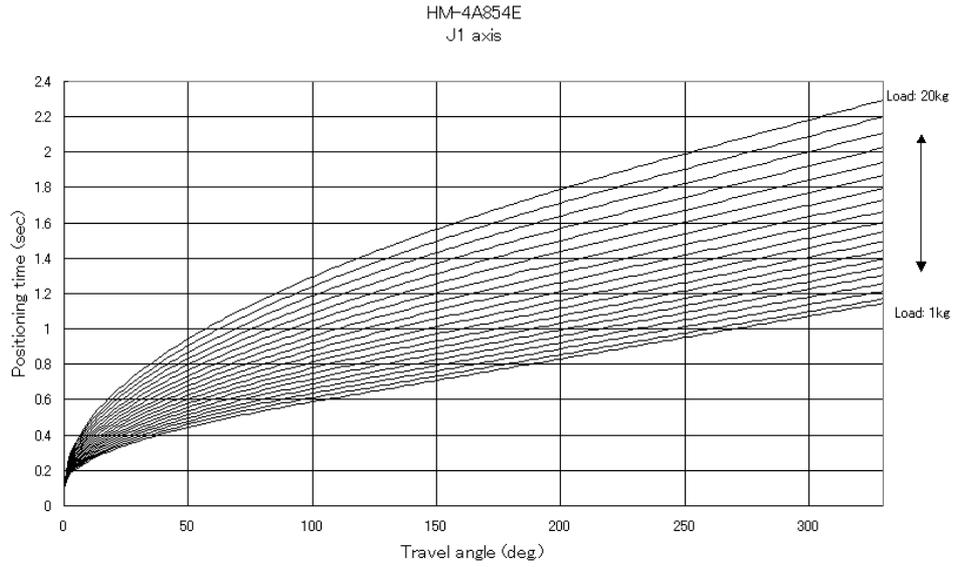


J2 axis (PTP motion)

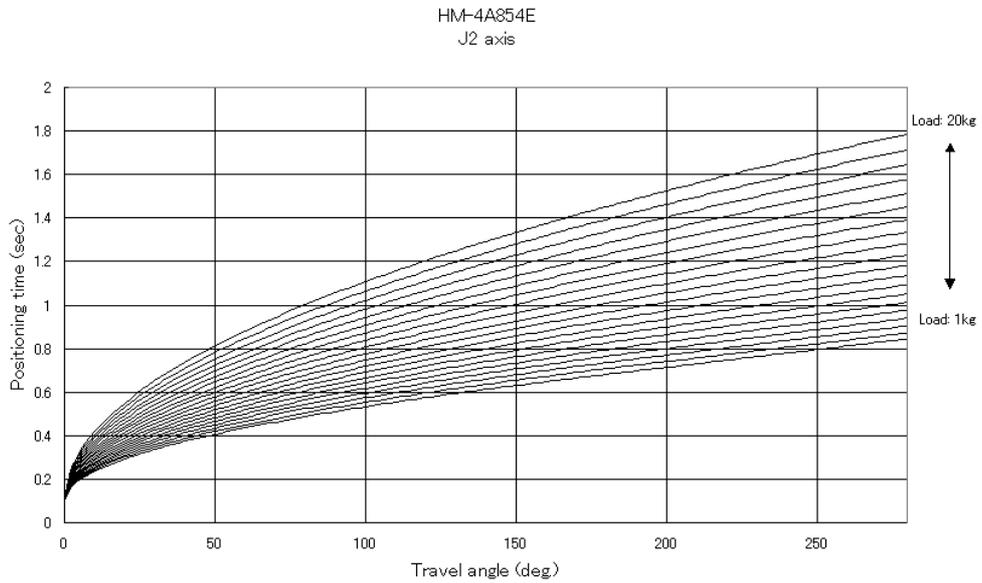


Z axis (PTP motion)

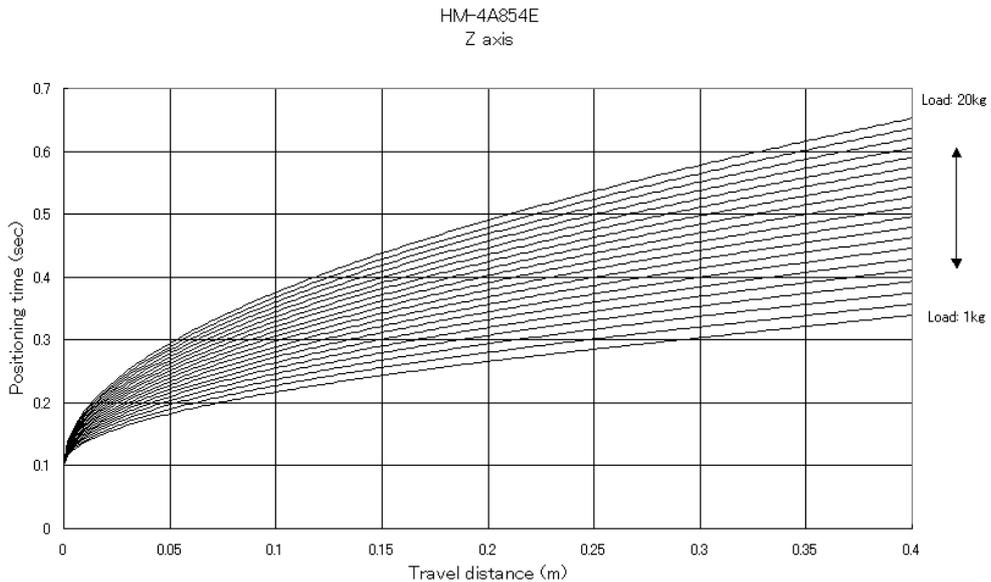

T axis (PTP motion)

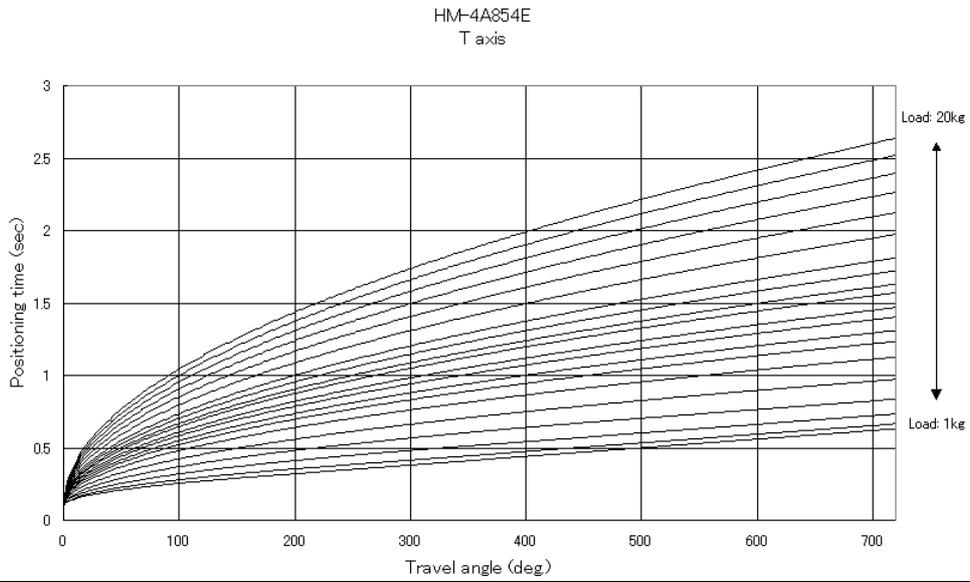


All axes (CP operation)

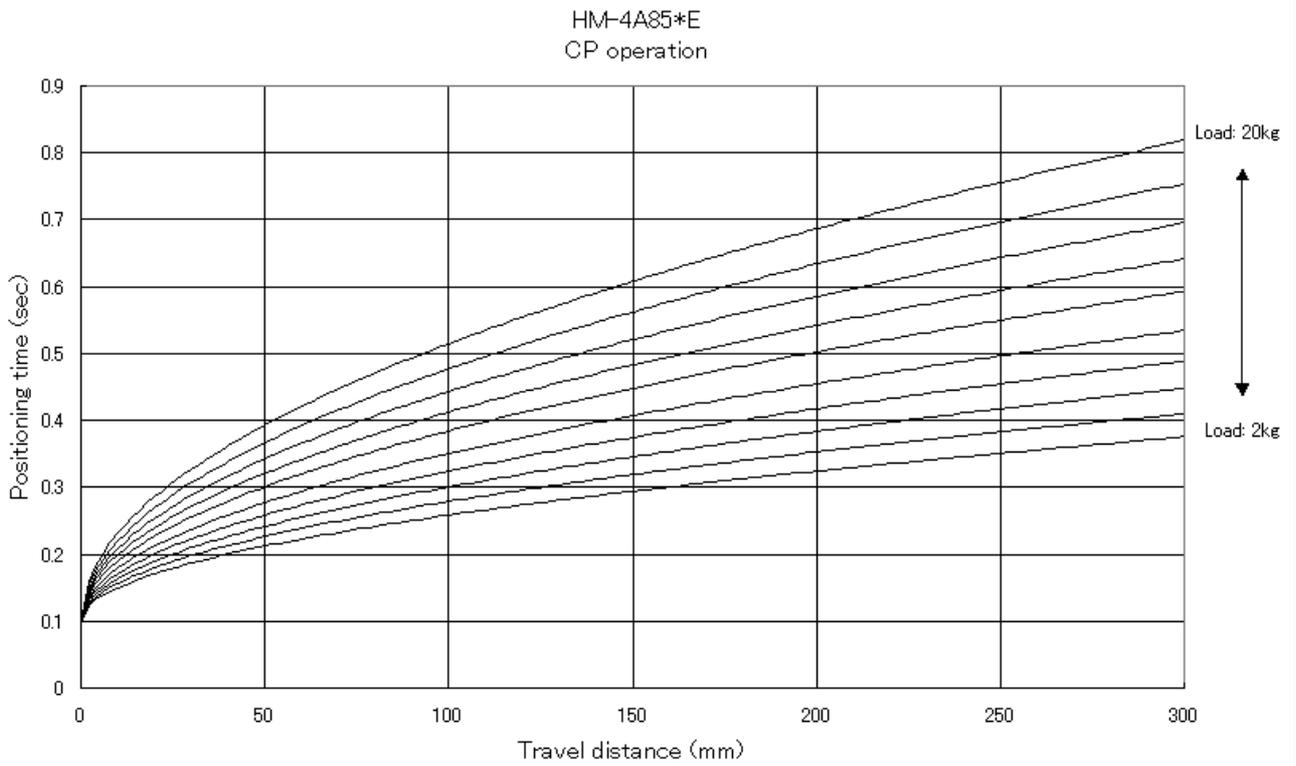


(22) HM-4AA02E


J1 axis (PTP motion)

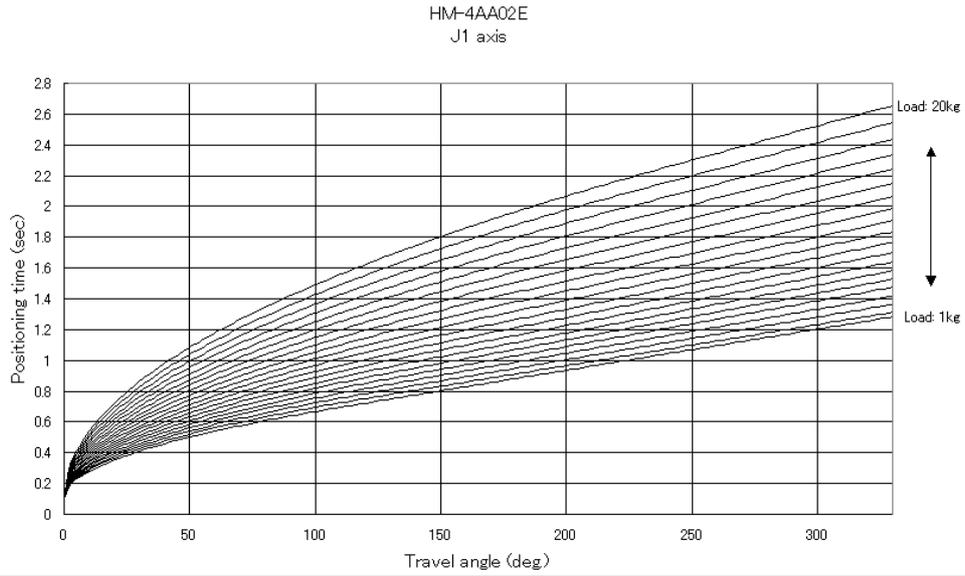


J2 axis (PTP motion)

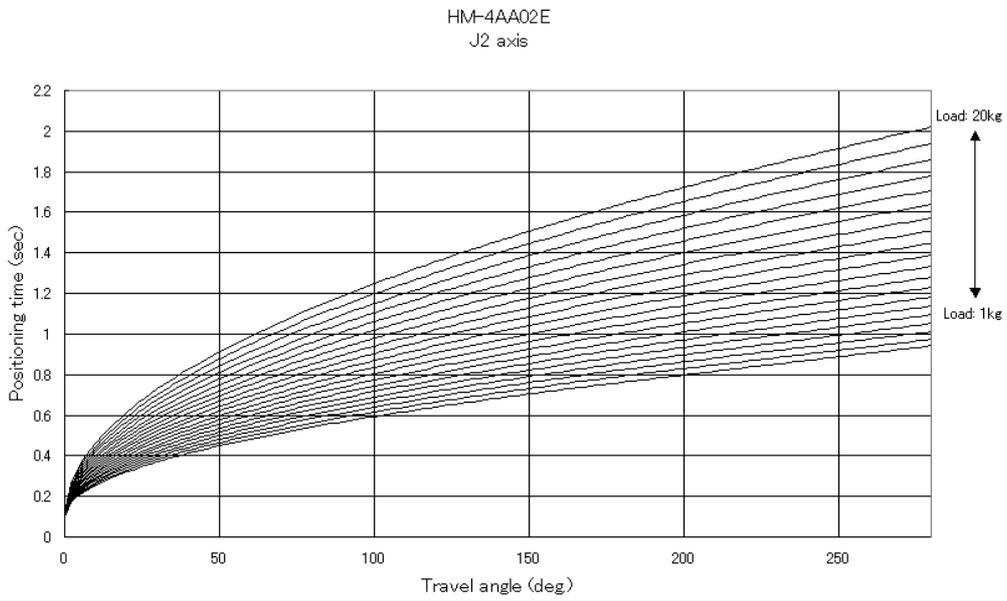


Z axis (PTP motion)

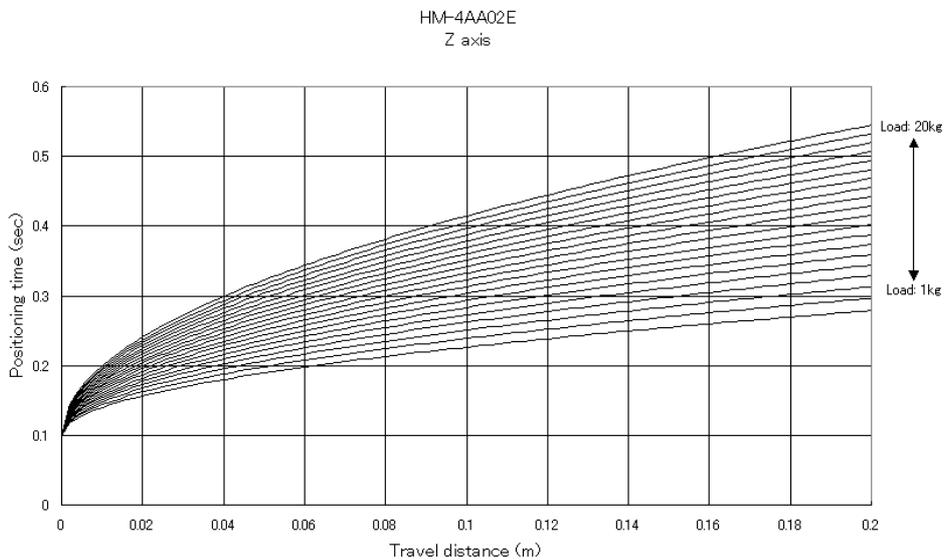

T axis (PTP motion)

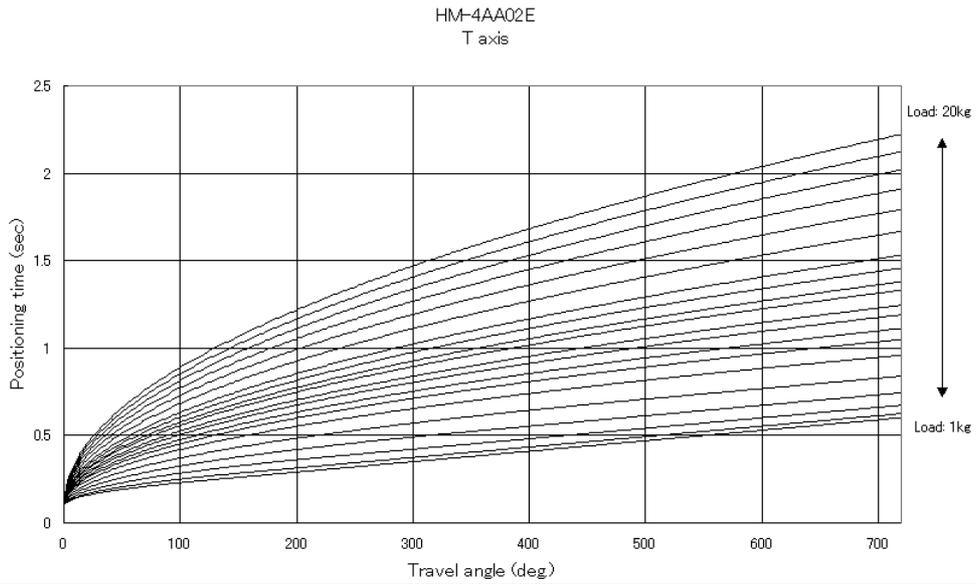


All axes (CP operation)

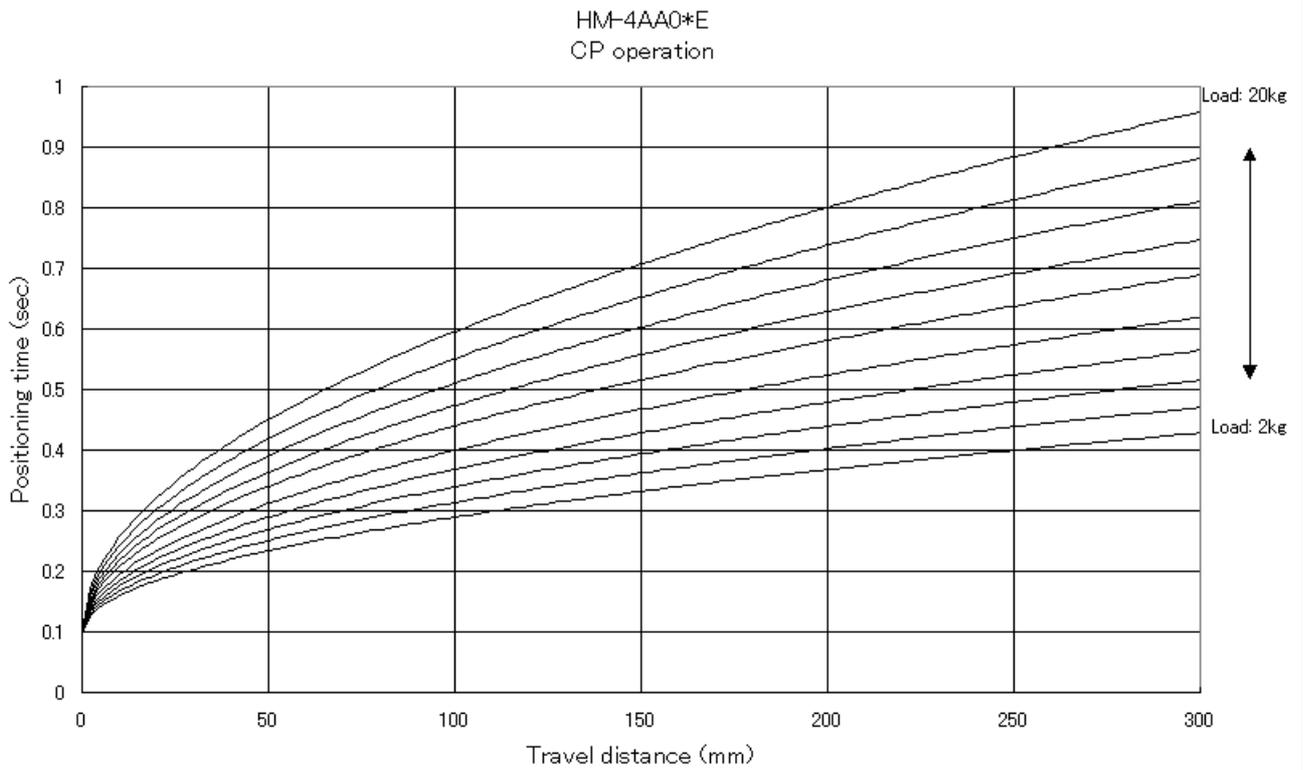


(23) HM-4AA03E


J1 axis (PTP motion)

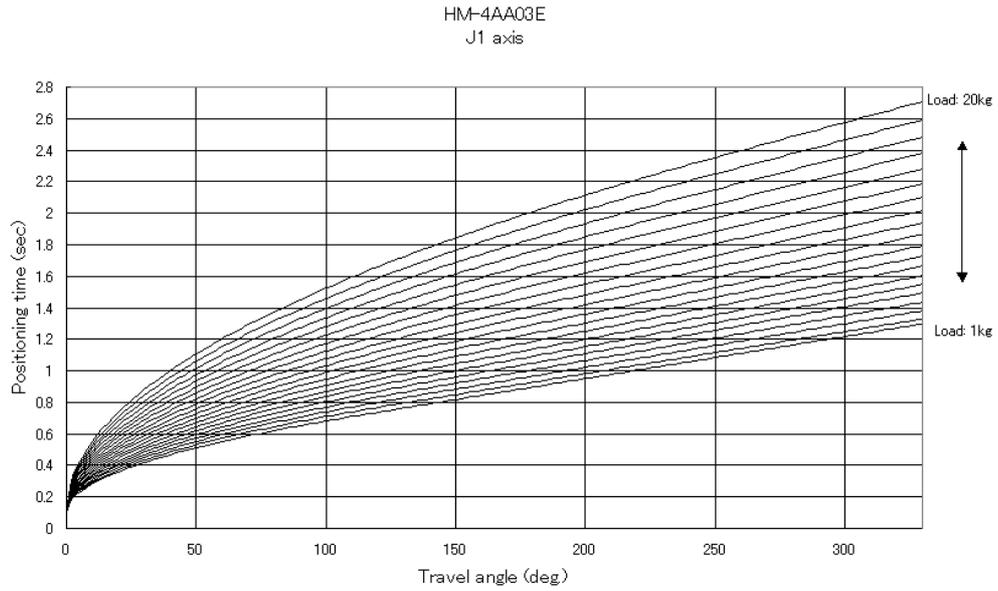


J2 axis (PTP motion)

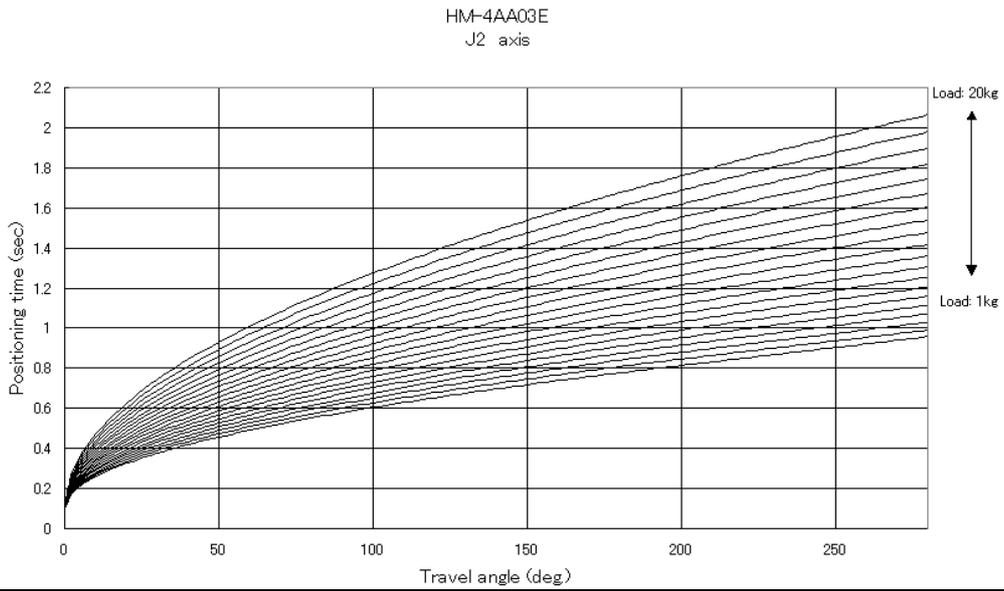


Z axis (PTP motion)

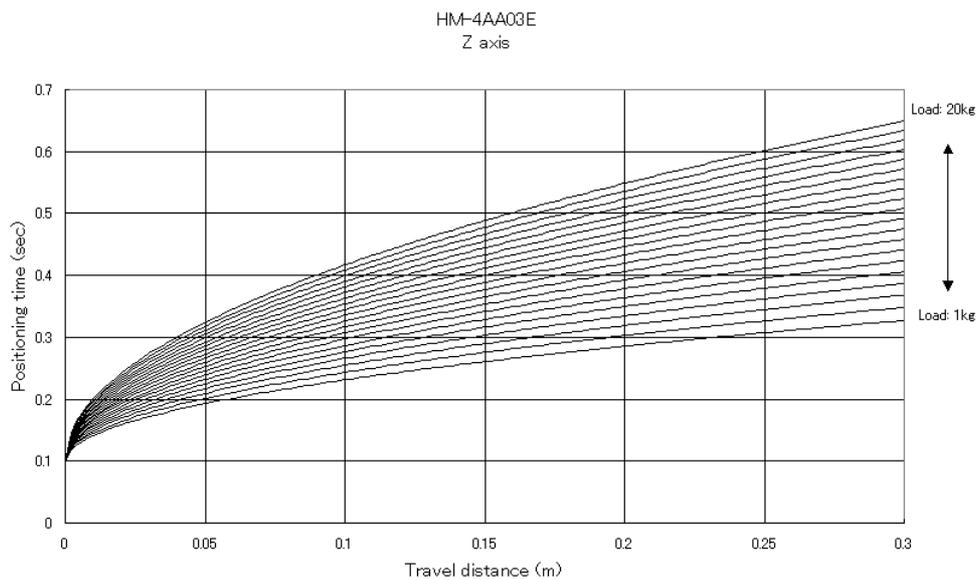

T axis (PTP motion)

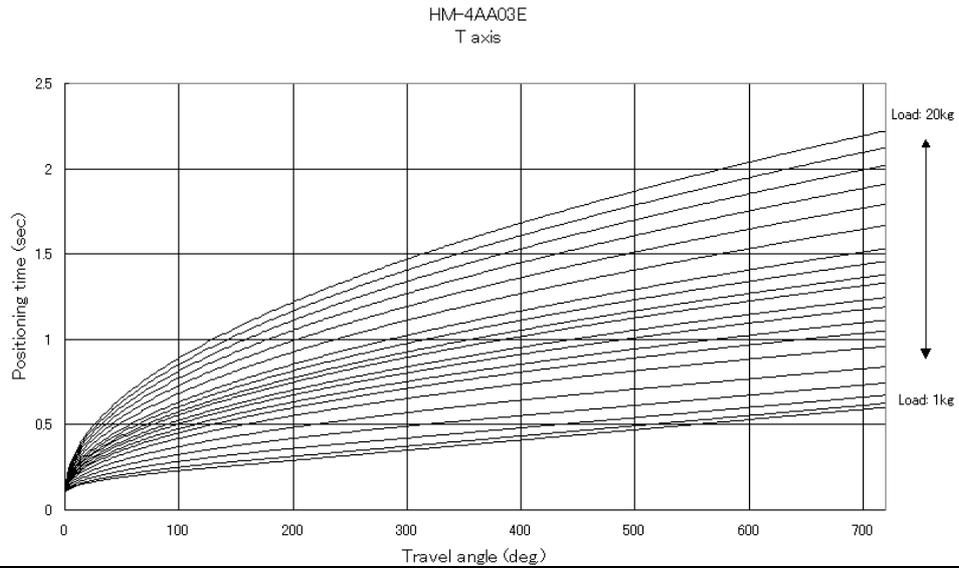


All axes (CP operation)

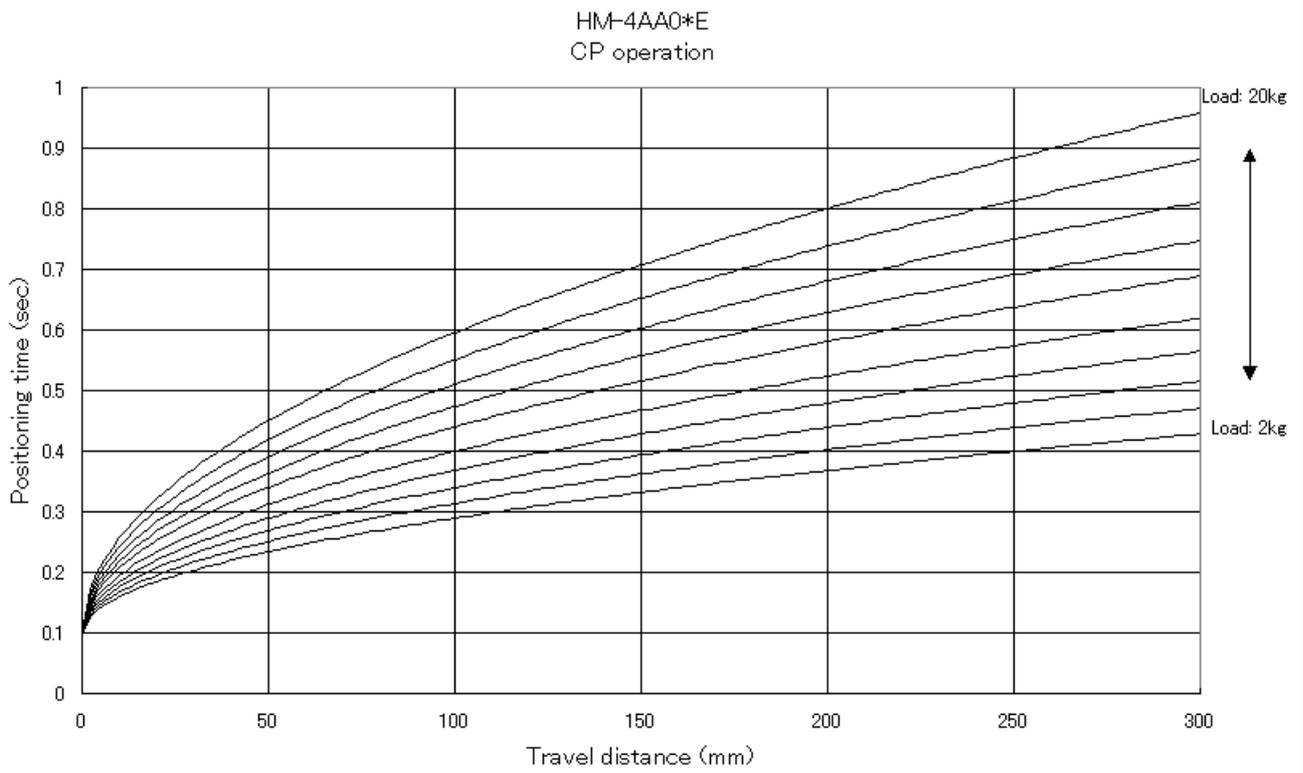


(24) HM-4AA04E


J1 axis (PTP motion)

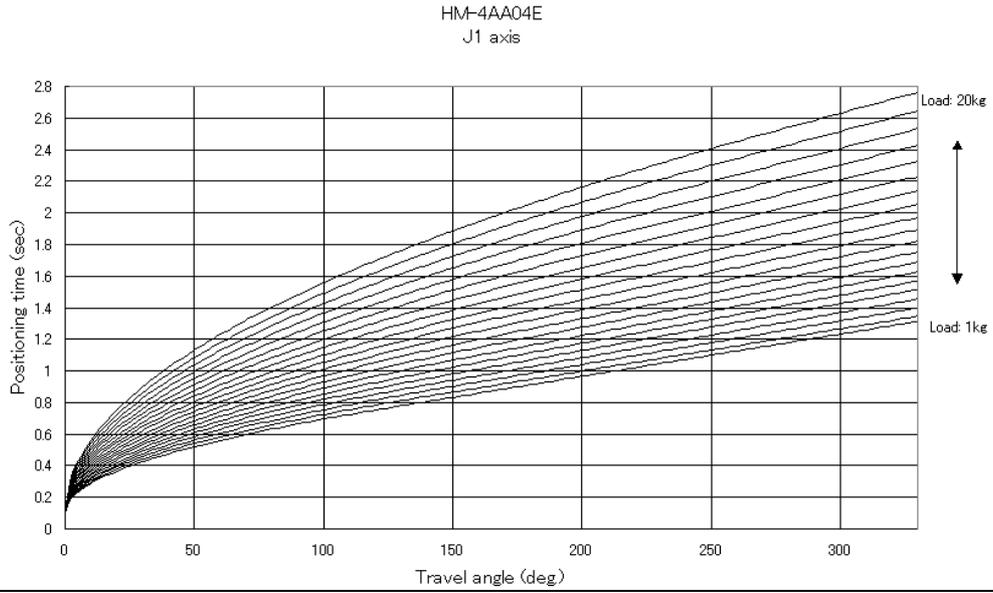


J2 axis (PTP motion)

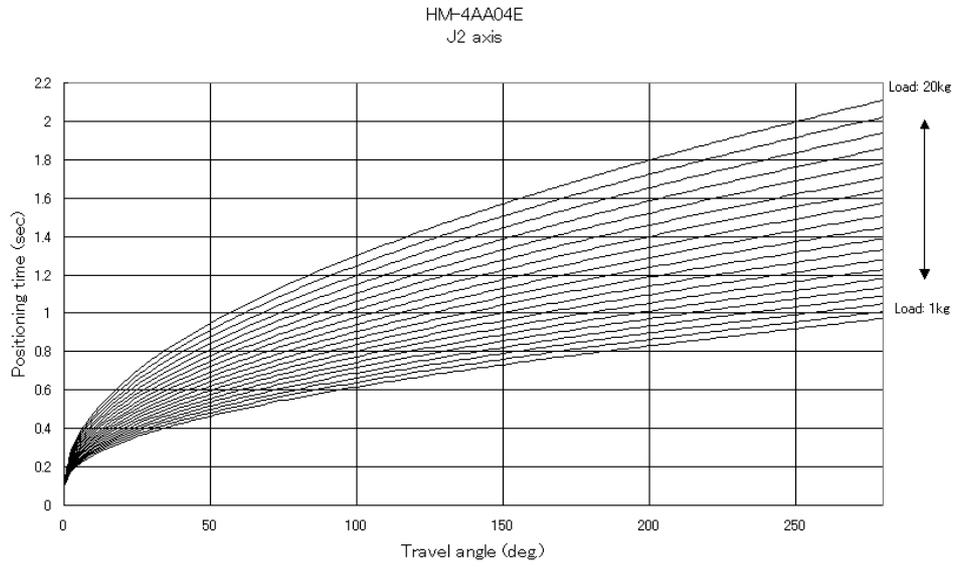


Z axis (PTP motion)

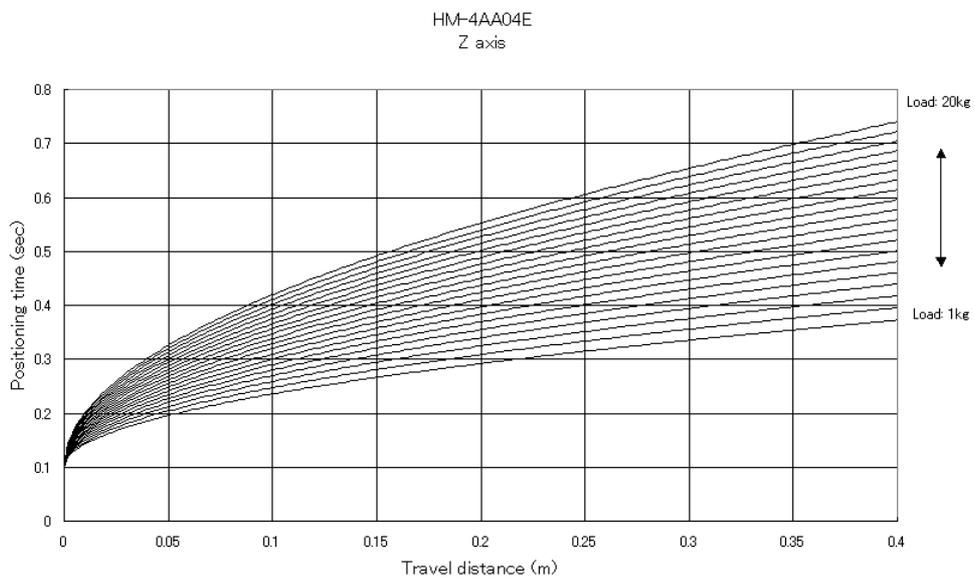

T axis (PTP motion)

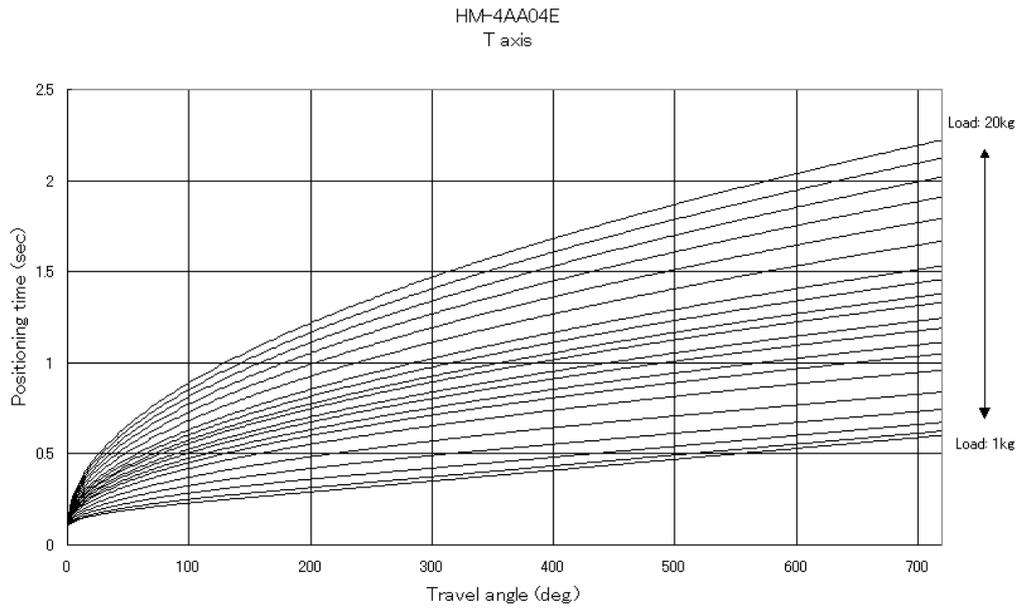

All axes (CP operation)

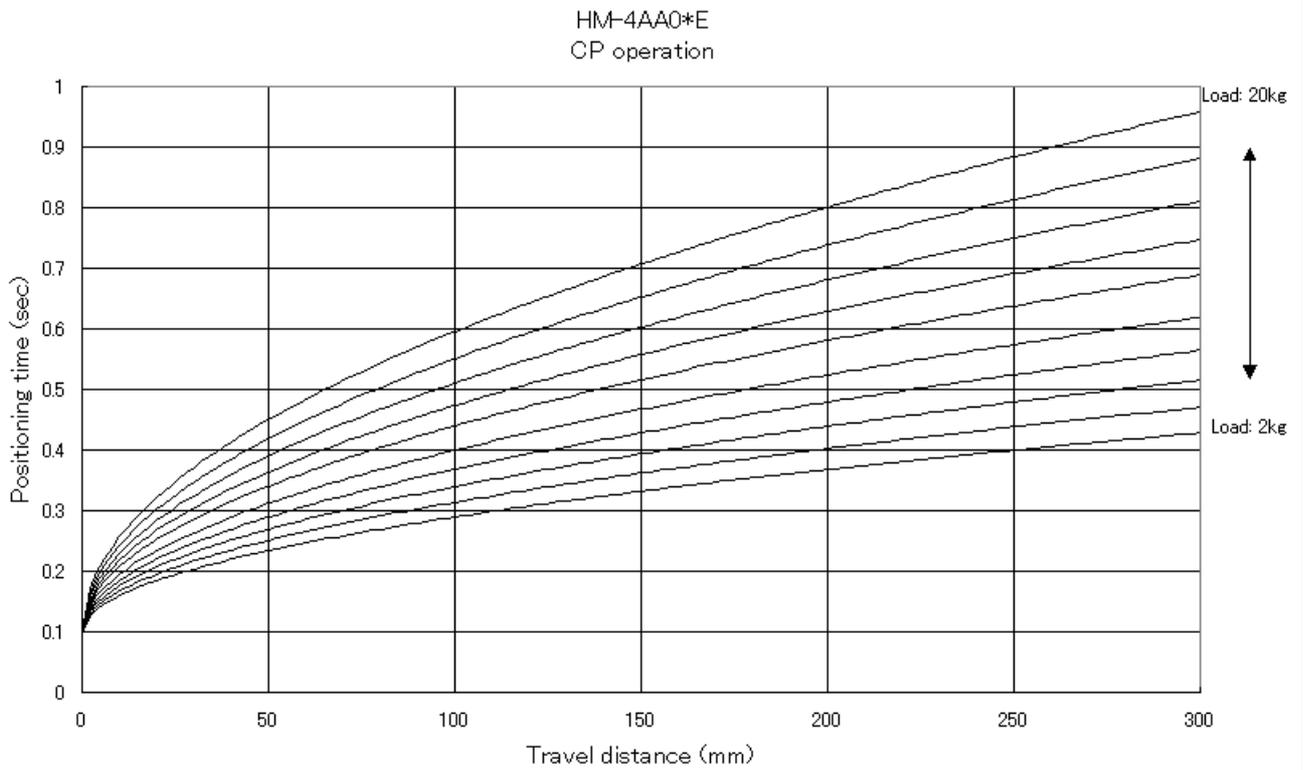

### 3.2.4 Notes for setting the positioning speed (HM/HMS-E series)

■ To be applied to all models of the HM-E series (Floor-mount type)

- (1) To horizontally traverse the robot arm at high speeds, teach the robot so that Z axis comes to be as close as possible to its upper end.
- (2) To stabilize positioning of Z axis near its lower end, the following maximum speed limiting control is automatically provided for J1 and J2 axes depending on the Z-axis coordinate value, only when the robot is moved under PTP control (MV, MVP, DRV, APR).


The positioning time of J1 and J2 axes becomes longer according to the maximum speed limit shown below.

$$\frac{\text{[Movement time in J1/J2 positioning time graphs (sec.)]}}{\text{Max. speed limit}} \times 100 \text{ (sec.)}$$

For example, when the robot arm moves by SP100 from the start point (Z-axis coordinate 100 mm) to the target point (Z-axis coordinated 0 mm), the maximum speed limits are as follows:

- 75 when Z-axis coordinate is 100 mm
- 35 when Z-axis coordinate is 0 mm

At this time, the maximum speed is the smaller value (at the lowest end) of 35.

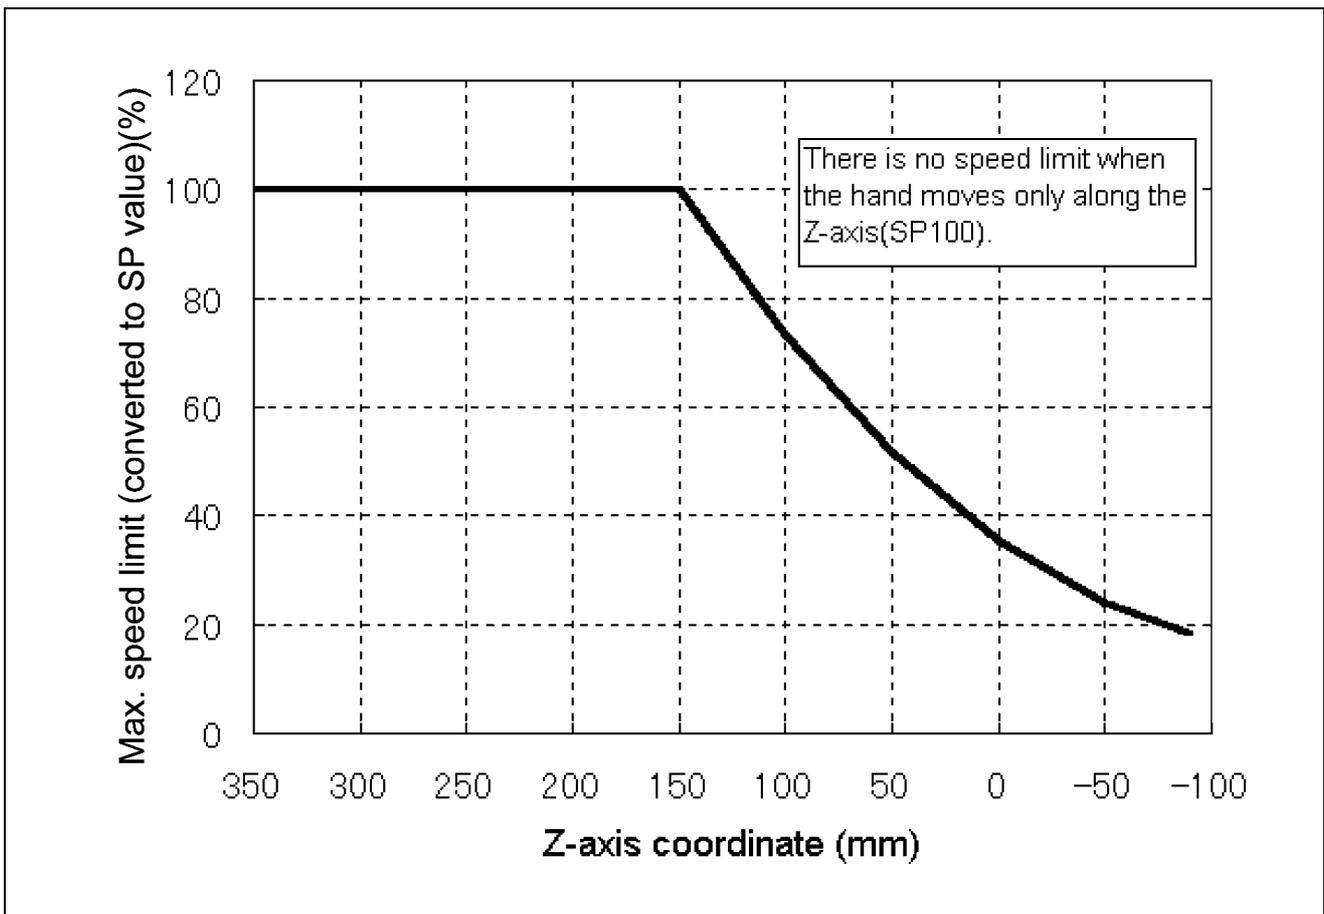

HM-E Series: Maximum Speed Limit on the J1 and J2 (PTP control)

■ To be applied to all models of the HMS-E series (Overhead-mount type)

- (1) To horizontally traverse the robot arm at high speeds, teach the robot so that Z axis comes to be as close as possible to its upper end.
- (2) To stabilize positioning of Z axis near its lower end, the following maximum speed limiting control is automatically provided for J1 and J2 axes depending on the Z-axis coordinate value, only when the robot is moved under PTP control (MV, MVP, DRV, APR).


The positioning time of J1 and J2 axes becomes longer according to the maximum speed limit shown below.

$$\frac{\text{[Movement time in J1/J2 positioning time graphs (sec.)]}}{\text{Max. speed limit}} \times 100 \text{ (sec.)}$$

For example, when the robot arm moves by SP100 from the start point (Z-axis coordinate -706 mm) to the target point (Z-axis coordinated -806 mm), the maximum speed limits are as follows:

- 706 when Z-axis coordinate is 57 mm
- 806 when Z-axis coordinate is 33 mm

At this time, the maximum speed is the smaller value (at the lowest end) of 33.

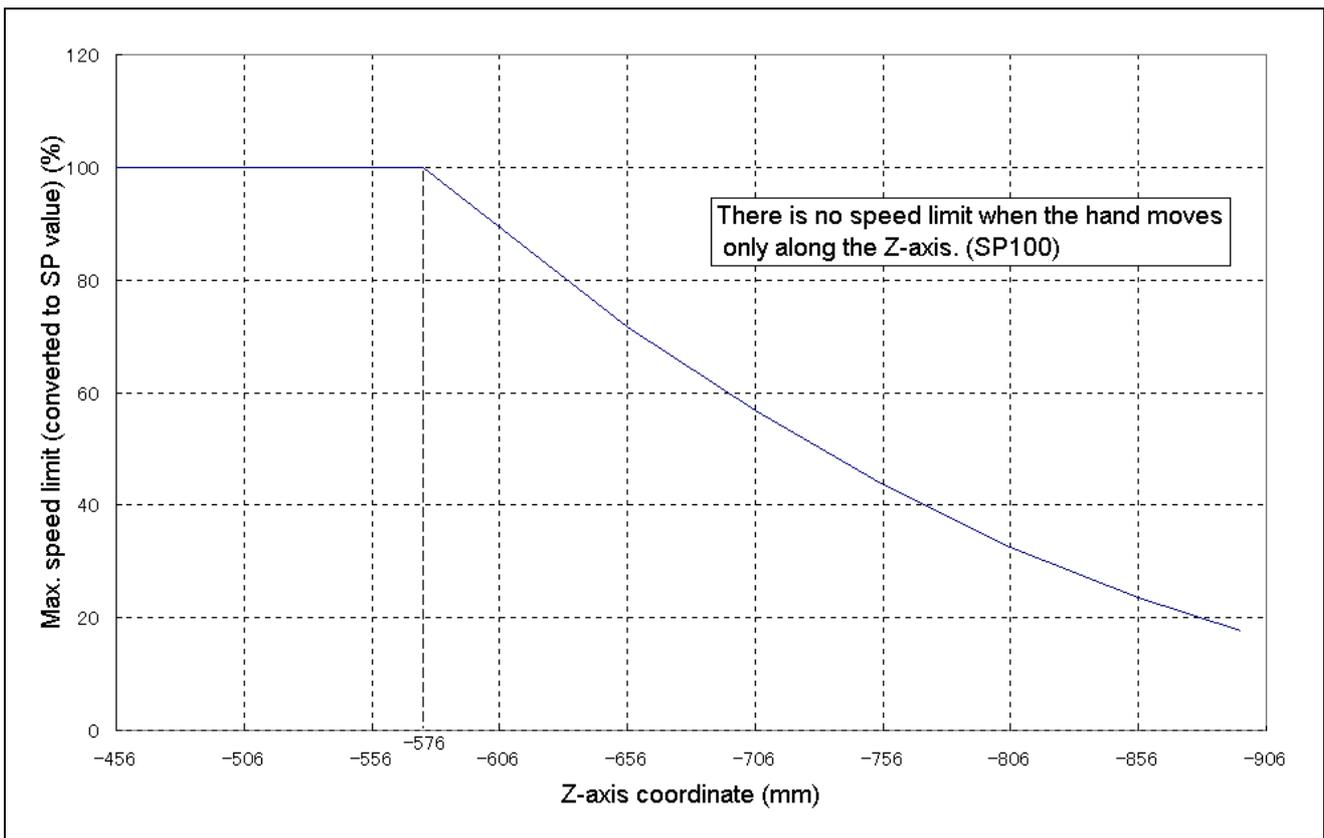


HMS-E Series: Maximum Speed Limit on the J1 and J2 (PTP control)

### 3.2.5 Air piping and signal wiring (HM/HMS-E series)


The HM/HMS-E series is equipped with 4 air pipes ( $\phi 6$ ) for air chuck and 24 signal lines in the robot unit.

#### (1) HM/HMS-E (standard type)

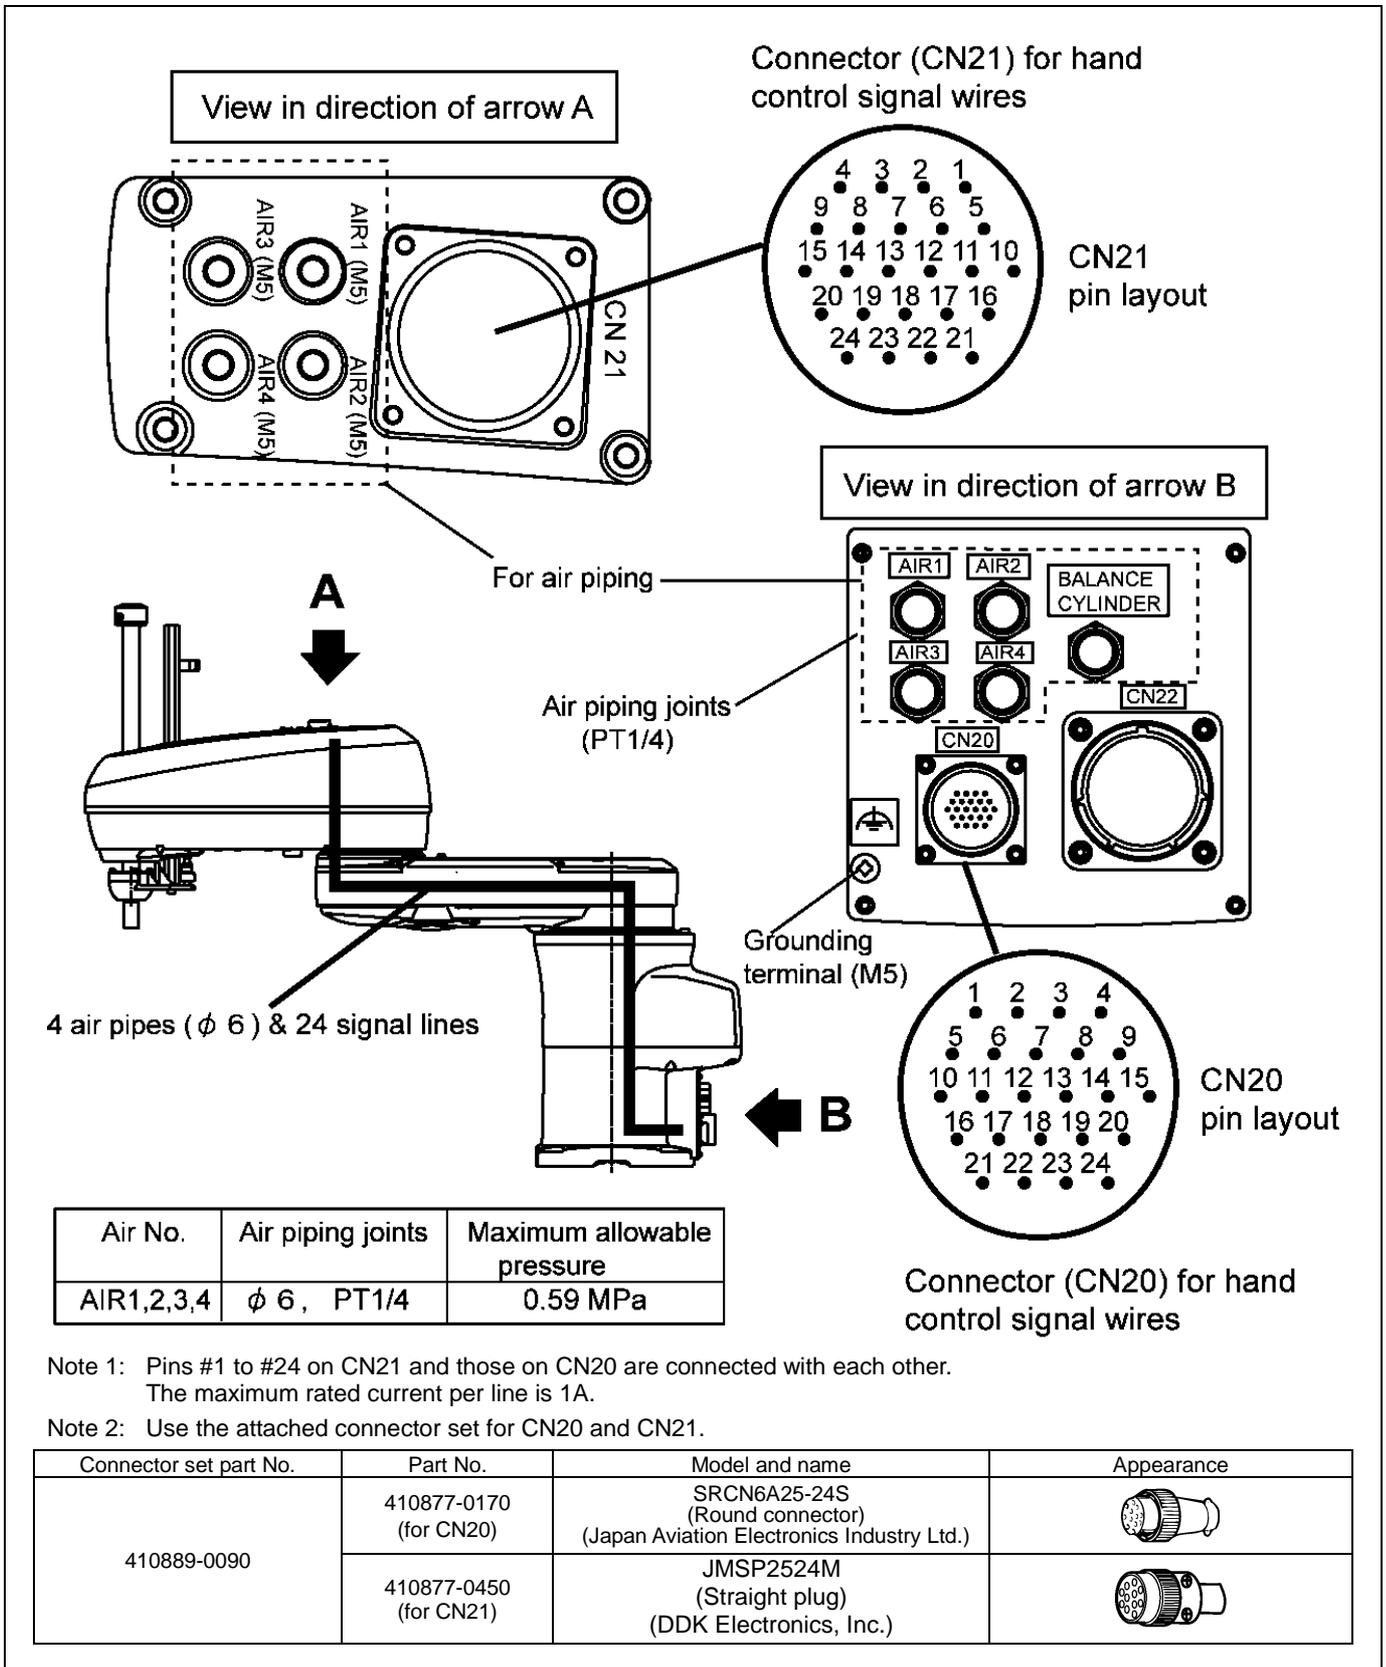

Air piping and Signal Wiring (HM/HMS-E standard type)

**(2) HM/HMS-E-W (dust-proof & splash-proof type)**

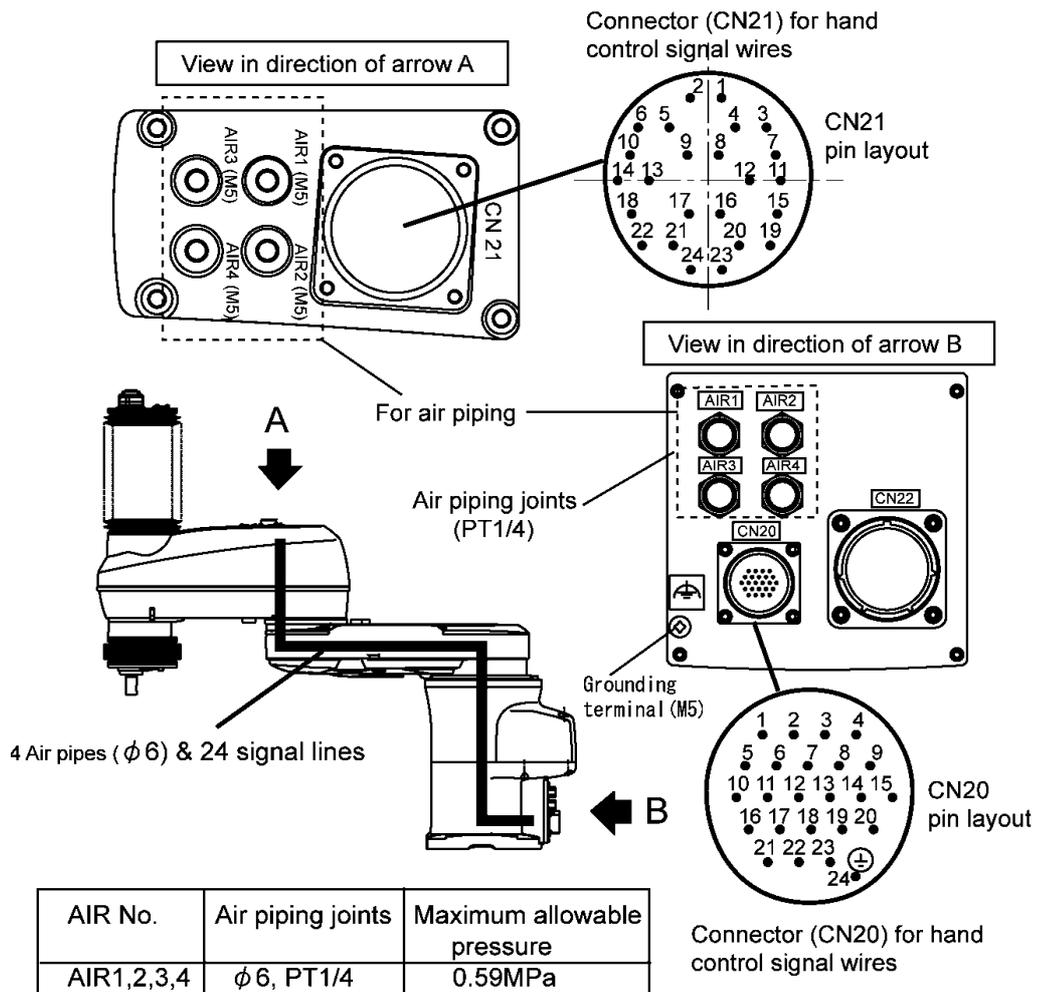

Note 1: Pins #1 to #24 on CN21 and those on CN20 are connected with each other.  
The maximum rated current per line is 1A.

Note 2: Use the attached connector set for CN20 and CN21.

Connector set part No.	Part No.	Model and name	Appearance
410889-0100	410877-0480 (for CN20)	JL05-6A24-28S-(A72)-F0 (Straight plug) (Japan Aviation Electronics Industry Ltd.)	
	410877-0490 (for CN20)	JL05-24EB9B-(17)-(A72) (Cord clamp) (Japan Aviation Electronics Industry Ltd.)	Applicable wire diameter φ15 to 17 
	410877-0500 (for CN20)	JL05-24EB9B-(21)-(A72) (Cord clamp) (Japan Aviation Electronics Industry Ltd.)	
	410877-0470 (for CN21)	EBS2524M (Straight plug) (DDK Electronics, Inc.)	

**Air piping and Signal Wiring (HM/HMS-E-W dust-proof & splash-proof type)**

### 3.2.6 Engineering-design Notes for Robot Hands (HM/HMS-E series)

Design a hand (end-effector) so that it will satisfy conditions (1) and (3) described below.

**⚠ Caution:** Strictly observe these engineering-design notes. Otherwise, the clamped sections of the robot unit will become loose, rattle or be out of position. In the worst case, the mechanical parts of the robot unit and the robot controller may be damaged.

#### (1) Mass of hand


The total mass of a hand or tool (including workpiece) should be less than the maximum allowable payload of the robot. Be sure to include the mass of wirings and piping used for a hand or tool.

**Total mass of hand or tool (incl. workpiece)  $\leq$  Max. allowable payload**

**NOTE:** The maximum allowable payload refers to a mass of payload that you have preset.

#### (2) Hand center of gravity

The center of gravity of a hand or tool (including workpiece) should be located within the range specified in Figure below.

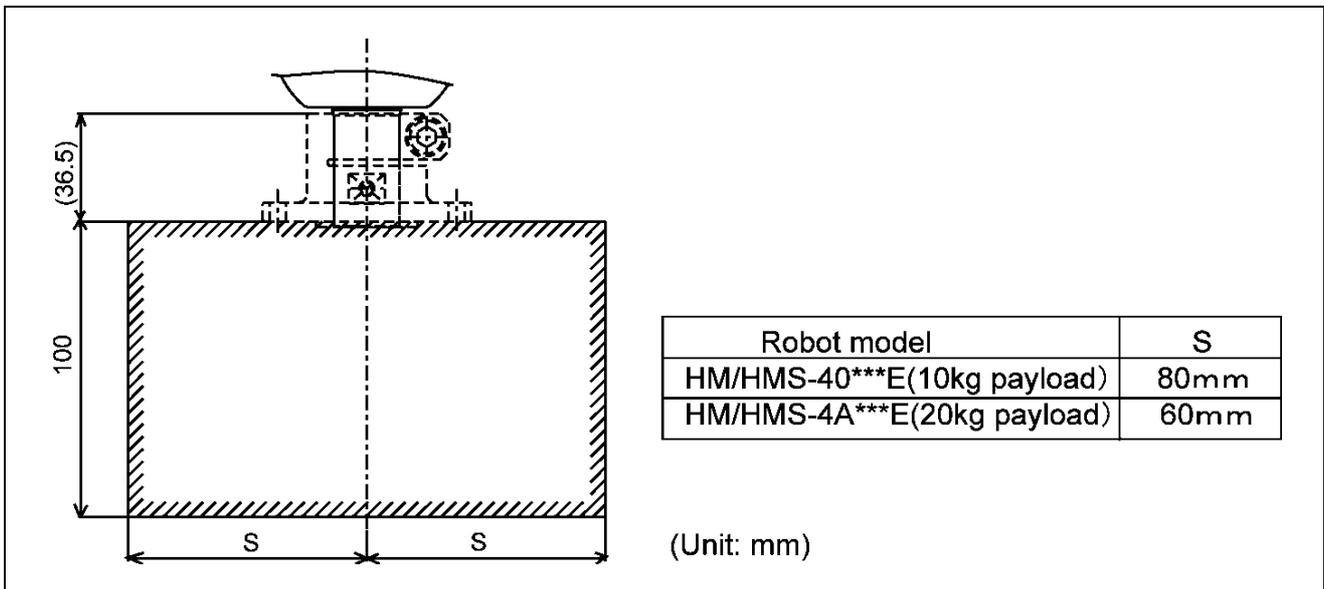

Hand center of gravity (HM/HMS-E)

### (3) Moment of inertia around the T axis

The moment of inertia of a hand or tool (including work-piece) around the T axis should be less than the maximum allowable moment of inertia around the T axis of the robot.

**Hand's moment of inertia (incl. Work-piece) around the T axis  $\leq$  Max. allowable moment of inertia**


Calculate the moment of inertia around the T axis according to the graph given below.

**NOTE:** You may program the reduced ratio of the speed and acceleration individually within the range specified below. If you set the reduced ratio of the programmed speed only, the controller automatically calculates that of the acceleration according to the formula below.

$$\text{Acceleration (\%)} = (\text{Speed}/100)^2 \times 100$$


#### Application sample of hand's moment of inertia: HM/HMS-E series, 10 kg payload type

- To run the robot at 100% of the programmed speed and acceleration: The moment of inertia around the T axis should be 0.15 kgm<sup>2</sup> or less.
- If the moment of inertia around the T axis is 0.17 kgm<sup>2</sup>: Run the robot at 90% or less of the programmed speed and at 81% or less of the programmed acceleration.

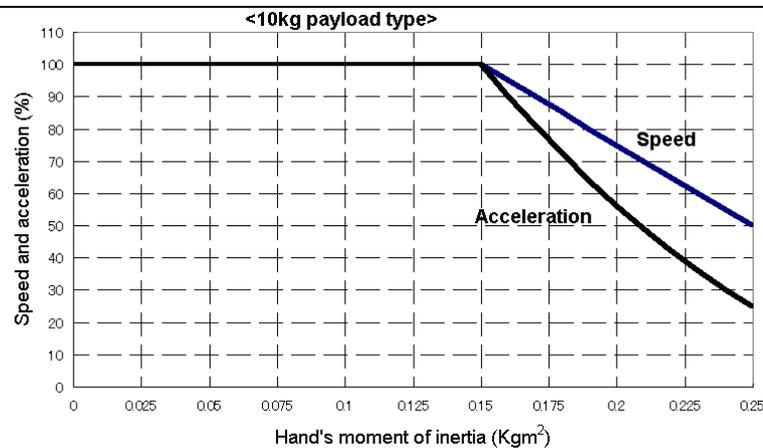






#### Application sample of hand's moment of inertia: HM/HMS-E series, 20 kg payload type

- To run the robot at 100% of the programmed speed and acceleration: The moment of inertia around the T axis should be 0.3 kgm<sup>2</sup> or less.
- If the moment of inertia around the T axis is 0.33 kgm<sup>2</sup>: Run the robot at 90% or less of the programmed speed and at 81% or less of the programmed acceleration.

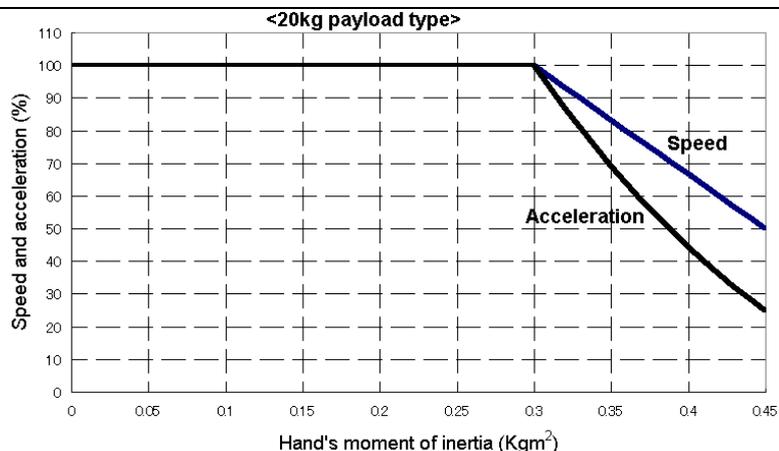


When calculating the hand's or tool's moment of inertia around the T axis, refer to the moment-of-inertia formulas on the next page.

**Moment-of-inertia Formulas**
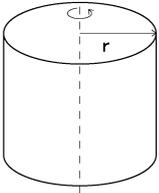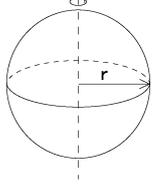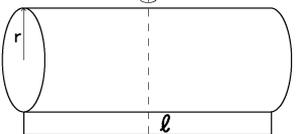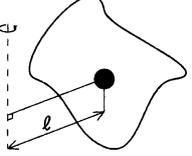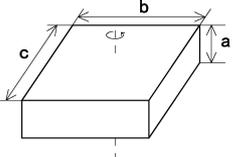
<p>1. Cylinder (1) (Axis of rotation = Center axis)</p>  $I = \frac{mr^2}{2}$	<p>4. Sphere (Axis of rotation = Center axis)</p>  $I = \frac{2mr^2}{5}$
<p>2. Cylinder (2) (The axis of rotation passes through the center of gravity.)</p>  $I = \frac{m}{4} \left( r^2 + \frac{l^2}{3} \right)$	<p>5. Center of gravity not on the axis of rotation. I<sub>g</sub>: Moment of inertia around center of gravity [kgm<sup>2</sup>]</p>  $I = I_g + m l^2$
<p>3. Rectangular parallelepiped (The axis of rotation passes through the center of gravity.)</p>  $I = \frac{m}{12} (b^2 + c^2)$	<p>I: Moment of inertia [kgm<sup>2</sup>] m: Mass [kg] r: Radius [m] a, b, c, l: Length [m]</p>

Calculation example : When calculating the moment of inertia of a complicated shape, divide it into simple parts as much as possible for easier calculations.  
As shown in the figure below, divide the hand into three parts ( (1), (2), (3) ).

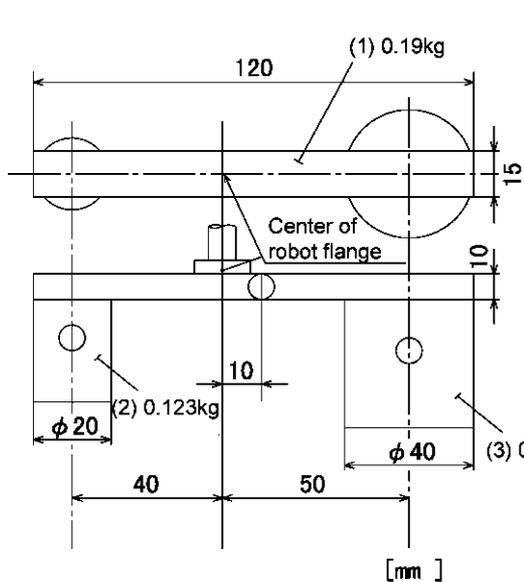

Moment of inertia around T-axis of (1): I<sub>1</sub> (from 3 and 5 in the above table)

$$I_1 = \frac{0.19}{12} (0.12^2 + 0.015^2) + 0.19 \times 0.01^2 = 2.51 \times 10^{-4} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of (2): I<sub>2</sub> (from 1 and 5 in the above table)

$$I_2 = \frac{0.123 \times 0.01^2}{2} + 0.123 \times 0.04^2 = 2.03 \times 10^{-4} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of (3): I<sub>3</sub> (from 1 and 5 in the above table)

$$I_3 = \frac{0.98 \times 0.02^2}{2} + 0.98 \times 0.05^2 = 2.65 \times 10^{-3} \text{ [kgm}^2 \text{]}$$

Moment of inertia around T-axis of entire hand: I

$$I = I_1 + I_2 + I_3 = 0.003 \text{ [kgm}^2 \text{]}$$

**Calculation Example of Hand's Moment of Inertia Around the T Axis**

# Chapter 4

## Specifications of the Robot Controller

### 4.1 Specifications

The table below lists the specifications of the robot controller.

**Specifications of Robot Controller**

Item		Specifications	
Applicable robot		Small-sized, horizontal articulated type (HS-E)	Medium-sized, horizontal articulated type (HM-E)
Model		RC5-HSE4BA	RC5-HME4BA
Control system		PTP, CP 3-dimensional linear, 3-dimensional circular	
No. of controllable axes		Up to four axes simultaneously	
Drive system		All axes: all digital AC servo	
Memory capacity		1.25 MB (equivalent to 5000 steps, 13,000 points)	
Language used		DENSO robot language (conforming to SLIM)	
No. of teach programs loadable to the memory		255	
Teaching system		1) Remote teaching 2) Numerical input (MDI) 3) Direct teaching	
External signals (I/O)	Input signal	20 user open points (PLC 12, hand input 8) + 36 fixed system points	
	Output signal	32 user open points (PLC 24, hand output 8) + 33 fixed system points	
External communication		RS-232C:1 line Ethernet:1 line (option)	
Timer function		0.02 to 10 sec. (in increment of 1/60 sec.)	
Self-diagnosis function		Overrun, servo error, memory error, input error, etc.	
Error display		Error codes will be displayed on the external I/O, the operating panel (option) or mini-pendant (option). Error messages will be displayed in English on the teach pendant (option).	
Power source		3-phase: 200 VAC-15% to 230VAC+10%, 50/60 Hz, 1.8 kVA  Single-phase, 230 VAC-10% to 230 VAC+10%, 50/60 Hz, 1.8 kVA	3-phase: 200 VAC-15% to 230VAC+10%, 50/60 Hz, 2.5 kVA  Single-phase, 230 VAC-10% to 230 VAC+10%, 50/60 Hz, 2.5 kVA
Environmental conditions (in operation)		Temperature: 0 to 40°C Humidity: 90% RH or less (no condensation allowed)	
Degree of protection		IP20	
Cables	Robot control cable	Standard: 4 m or 6 m (selectable) High strength: 6 m or 12 m (selectable)	
	I/O cable	8 m, 15 m (option)	
	Power cable	5 m	
Weight		Approx. 17 kg (excluding attached cables)	

 **CAUTION**


- **DO NOT touch fins. Their hot surfaces may cause severe burns.**
- **DO NOT insert fingers or foreign objects into openings. Doing so may cause bodily injury.**
- **Before opening the controller cover and accessing the inside of the controller for maintenance, be sure to turn off the power switch, disconnect the power cable, and wait 3 minutes or more. This is for protecting you from electric shock.**
- **DO NOT connect or disconnect connectors to/from the controller while the power switch is ON. Doing so may cause electric shock or controller failure.**

 **CAUTION IN INSTALLATION**


- **This controller is not designed to be dust-proof, splash-proof, or explosion-proof.**
- **Read user's manuals before installation.**
- **Do not place anything on the top of the controller.**

## 4.2 Outer Dimensions of the Robot Controller

The figure below shows the outer dimensions of the robot controller.

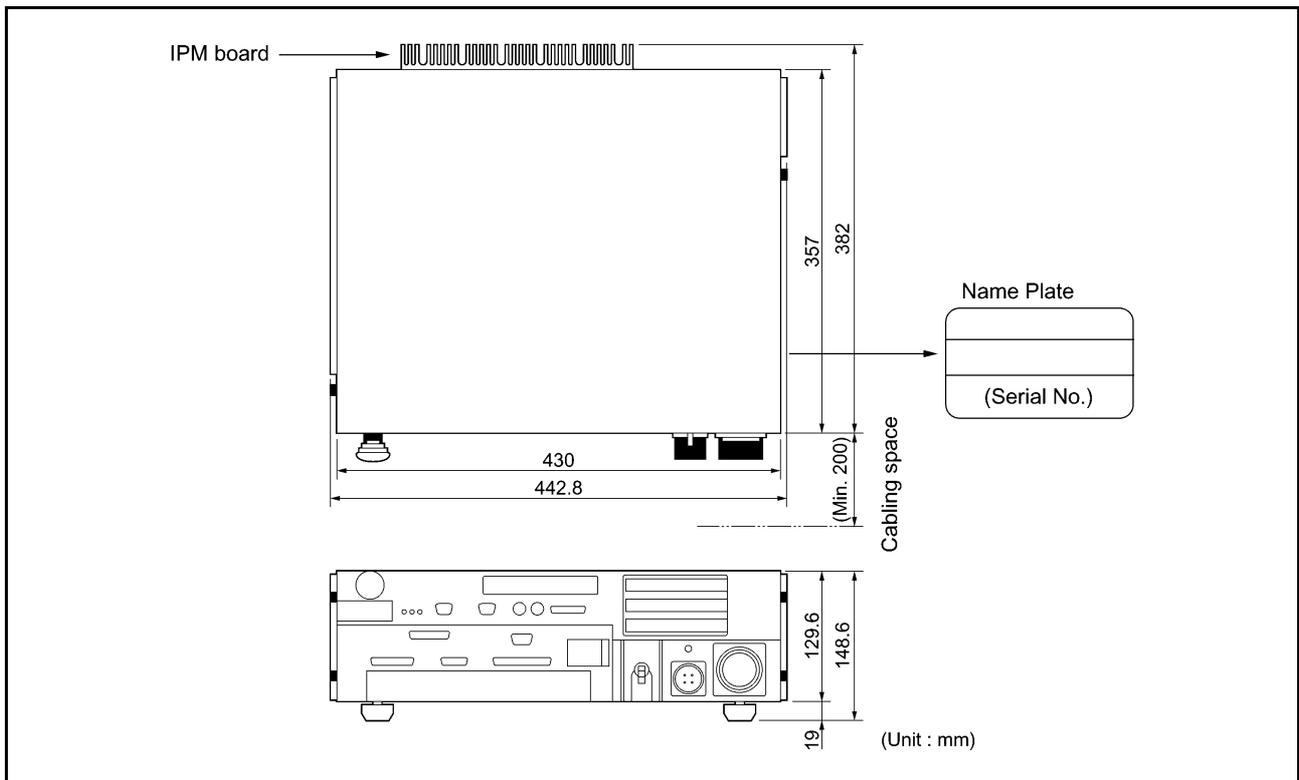

**Outer Dimensions of HS-E Series Robot Controller**

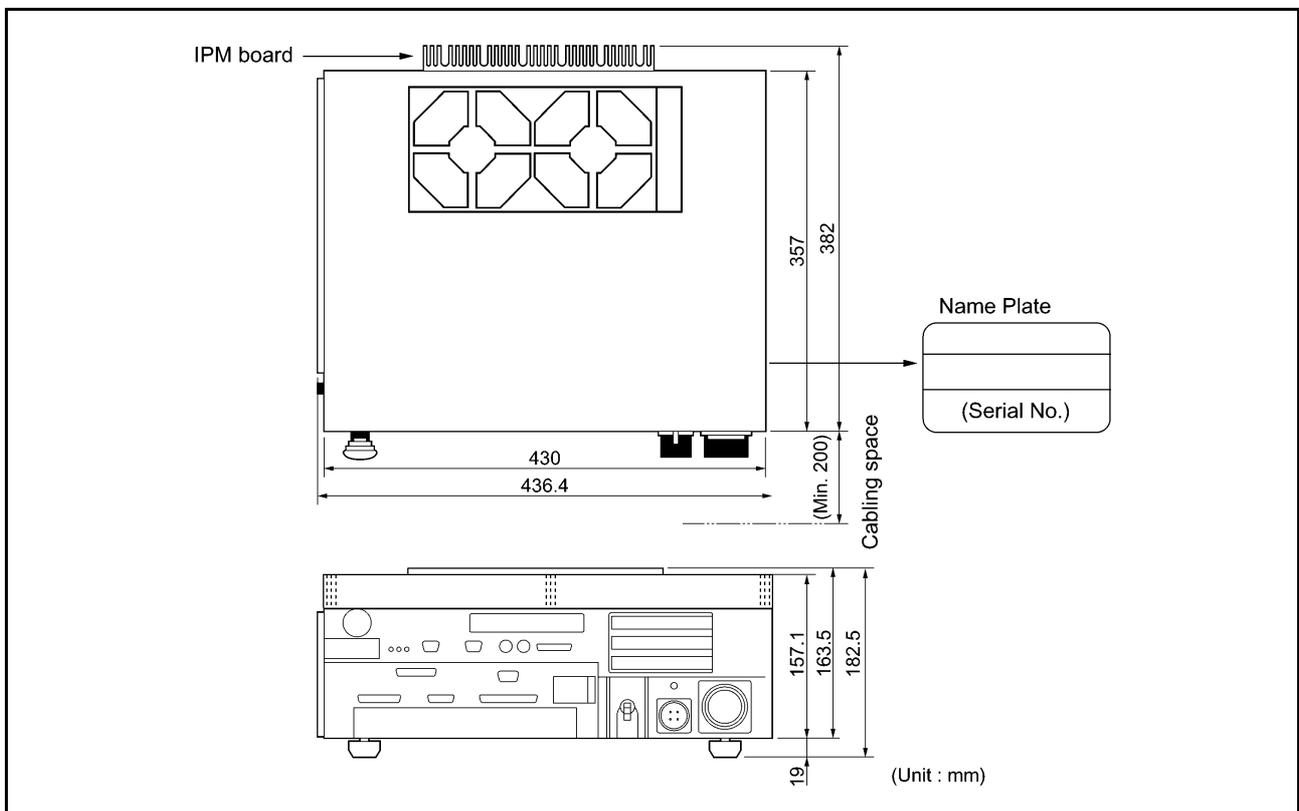

**Outer Dimensions of HM-E Series Robot Controller**

## 4.3 Controller Setting Table

The controller setting table given on the next page is attached to the controller. It shows the parameters that are set before delivery of the robot, as well as the next replacement dates of the memory backup battery and encoder backup battery.

- Parameters (① in the controller setting table)

Only parameters changed from the standard values are entered. Blanks indicate that the standard value is set.

For further information about parameters, see INSTALLATION & MAINTENANCE GUIDE, Chapter 2 "Customizing Your Robot."

- Main software Ver. (② in the table)

The version of the main software for the controller is entered.

- Sub software Ver. (③ in the table)

The version of the control software is entered.

- Battery replacement date (④ in the table)

In this battery replacement date box the next battery replacement date is entered.

- SER No. (⑤ in the table)

The serial number of the robot is entered.


- TYPE (⑥ in the table)

The model of the robot system is entered.


The coding of the set model is described below:

### Small-sized, horizontal articulated robot (HS/HSS-E series)

HS - 4 5 35 2 E - W / E

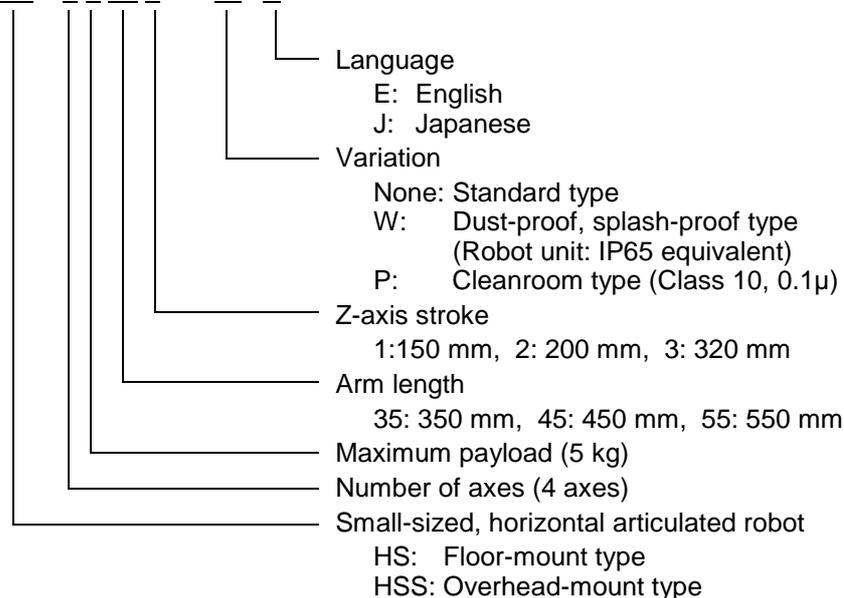

### Medium-sized, horizontal articulated robot (HM-E series)

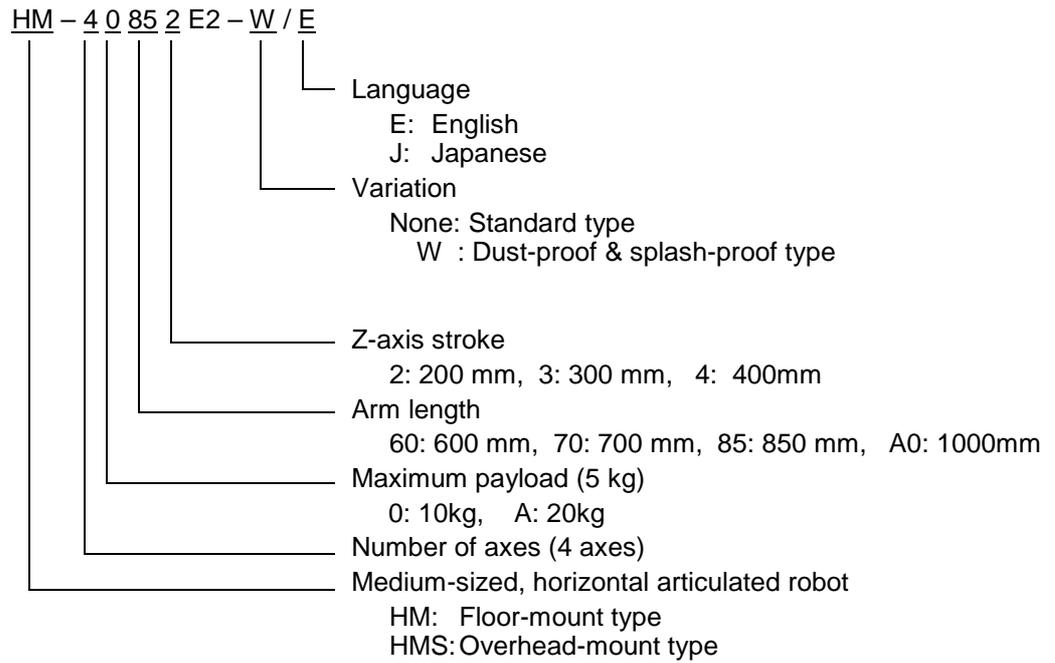

## コントローラ設定表/THE SETPRM LIST

注記1. 標準値から変更された個所のみ値を示します。空欄のものは標準値が設定されています。

2. パラメータ値を変更した場合は、必ず下表の値の書き直し、または記入をしてください。

Note1. Only the different value from the defaults of the SETPRM are written. The blank means default.

2. Write the new values on this list when you modify the SETPRM values.

① 1 パラメータ/PARAMETER		② サブアッセンブリ/SUBASSEMBLY		
パラメータ PARAMETER	値 VALUE	名称 BOARD	型式 BOARD TYPE	備考 REMARK
正方向 ソフト リミット PLIM	1	メインボード MAIN BOARD	RP227	
	2	I/Oボード I/O BOARD	RP228, 229	
	3	電源ボード POWER SUPPLY BOARD	RP214A, B	
	4	ハーネスボード HARNESS BOARD	RP231	
	5	NFボード NF BOARD	RP235A	
	6	コンパクトABSボード C-ABS BOARD	RP240A	
	7	ブレーキリレーボード BRAKE RELAY BOARD	RP242	
	8	回生抵抗ボード RESISTER BOARD	RP243	
負方向 ソフト リミット NLIM	1	IPMボード (L) IPM BOARD (L)	RP232	
	2	IPMボード (M) IPM BOARD (M)	RP232	
	3	IPMボード (S) IPM BOARD (S)	RP232	
	4	IPMボード (SS) IPM BOARD (SS)	RP232	
	5	拡張ボード1 EXTENSION BOARD 1		
	6	拡張ボード2 EXTENSION BOARD 2		
	7	拡張ボード3 EXTENSION BOARD 3		
	8	メモリボード MEMORY BOARD	RP234	
RANG	1	FD		
I/Oモード I/O MODE				
② メインソフト Ver. MAIN SOFTWARE Ver.				
③ サブソフト Ver. SUB SOFTWARE Ver.				
④ 電池交換日 DATE OF RENEWING BAT.				
⑤ SERIAL No.				
⑥ TYPE				
		③ その他の変更点/OTHER MODIFICATIONS		

# Chapter 5 Warranty

DENSO robots are manufactured under strict quality control. In case of failure, we warranty the robot under the following conditions:

## **Warranty Period**

The warranty shall be effective for one year from the date of purchase.

## **Warranty Coverage**

DENSO WAVE shall repair the robot free of charge when a failure occurs and is attributable to the design, manufacture or material of the robot within the warranty period in spite of proper use.

## **Items Not Covered**

Failures, which arise from one of the following, shall not be covered by the warranty even if the robot is under warranty:

- (1) Failures caused by improper repair, modification, transfer or handling by you or a third party;
- (2) Failures caused by the use of a part or oil/fat other than those specified in the related manuals;
- (3) Failures caused by a fire, salt damage, earthquake, storm/flood or other acts of God;
- (4) Failures caused by the use of the robot in an environment other than the environment specified in the related manuals, such as dust and water ingress;
- (5) Failures caused by a worn-out consumable, such as a fan filter;
- (6) Failures caused by improper performance or non-performance of lubrication, maintenance or inspections stated in this owner's manual; and
- (7) Damages other than the robot repair costs.

# Appendix How to Use the Manual Pack CD

— A convenient and easy-to-use electronic manual! —

There are a number of electronic manuals for Denso robots included in this manual pack CD. Using the top screen shown below, it is possible to view a list of all the manuals for a robot series and then select and open the manual you want to view.


In this new manual pack, the search function, which is the key component of electronic manuals, has been further improved. The scope of the search function has been enhanced so that by using a keyword and index, it is possible to perform searches of individual manuals, all manuals related to a particular robot series or of all the manuals included in the manual pack CD. With the keyword search, it is also possible to perform a search using two or more words (AND search).

How to call up the top screen is described in "1. Using this electronic manual," and how to perform searches in "2. Performing a keyword search" and "3. Using the index."

(The screens shown in the descriptions that follow may differ slightly to those actually displayed.)

The screenshot shows the DENSO ROBOT Manual Pack interface. At the top, it says "DENSO ROBOT" and "DENSO WAVE INCORPORATED". There are two main panels: "Owner's Manuals" on the left and a list of manual titles on the right. Below these is a search bar with "teaching" entered and a "Go" button. At the bottom, there is a table of search results.

Hit Words	Title	Page	Files
PC Teaching System Software	3.4 PC Teaching System Software, "WINCAPSII"	3-18	XYC_inst.pdf
PC Teaching System Software	3.4 PC Teaching System Software, "WINCAPSII"	3-18	V_inst.pdf
PC Teaching System Software	3.4 PC Teaching System Software, "WINCAPSII"	3-18	H_inst.pdf
Starting Personal Computer Teaching System	3.1 Starting Personal Computer Teaching System	3-1	wincaps.pdf
TEACHING	Appendix Glossary	140	V_bee.pdf
TEACHING	Appendix Glossary	146	H_bee.pdf
Teaching	2.2 Teaching	24	V_bee.pdf
Teaching	2.2 Teaching	24	H_bee.pdf
Teaching	15.4 Teaching	93	H_bee.pdf
Teaching	15.4 Teaching	93	V_bee.pdf
Teaching (Output)	5.5 System I/O Signals Compatible Mode	5-63	XYC_inst.pdf
Teaching (Output)	5.5 System I/O Signals Compatible Mode	5-72	H_inst.pdf

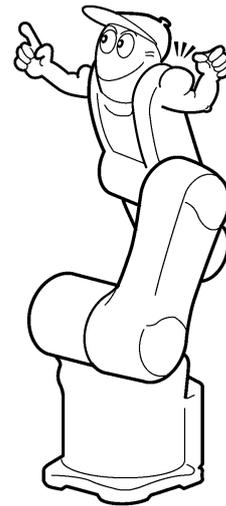

— Electronic manuals are much easier to use than printed ones! —

Printed Manuals

Any number of manuals

Search for the desired term in the index and search the corresponding page(s) after the term has been located.


Search is confined to one manual at a time.

Electronic Manuals

A single CD

Simply type the desired term on the top screen, and a list of pages where the term can be found will be displayed. Double-click on any item in the list to display the corresponding page.

- Search all manuals at once
- Search all manuals within a specific robot series
- Search each manual individually

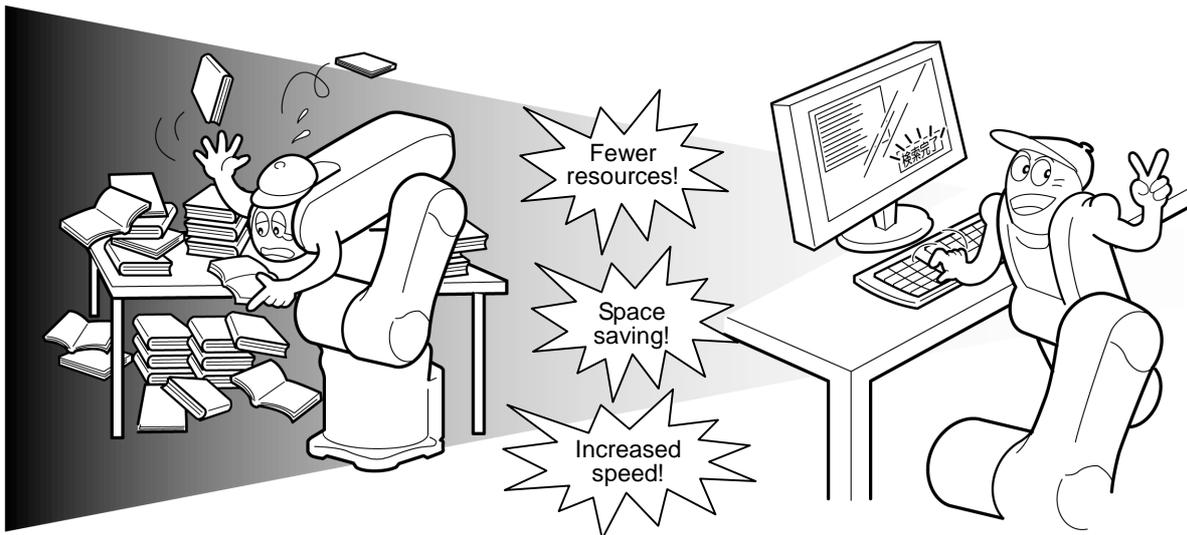

# 1. Using this electronic manual



- (1) Insert the manual pack CD into your computer.

The top screen shown at left appears.

- (2) Choose either of the English or Japanese version of the manuals. (In this example, select **ENGLISH**.)



The electronic manuals included in the manual pack CD are PDF files, just as with the previous NetwoRC CD version and require Acrobat Reader 4.0 or higher to be installed. If Acrobat Reader 4.0 or higher has not been installed on your computer, install it according to the following steps:




- 1) Double-click **My Computer** in Windows to open it.
- 2) Select the drive where the manual pack CD is loaded. On the File menu, point to Open.
- 3) All the contents of the manual pack CD appear as shown at left. Double-click on the Adobe folder and then click the **Ar405eng.exe** to install Acrobat Reader.

Clicking  on this screen will call up the top screen shown in step (1).



- (3) Double-click on **Owner's Manuals**.

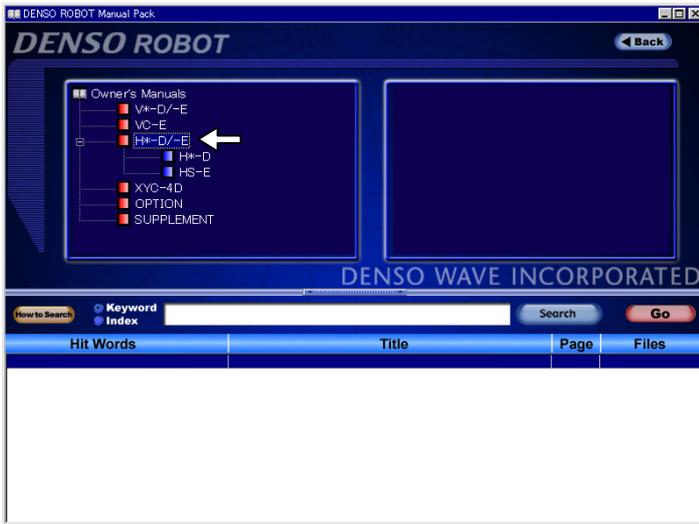


(4) In this example, double-click on **H\*-D/-E** to display the horizontal articulated robot series.




(5) Click on the robot series you want to refer to.  
This time, click on **HS-E**.  
All related manuals will appear in the window on the right.



(6) Click on the manual you want to refer to.  
In this example, click on **SETTING-UP MANUAL**.

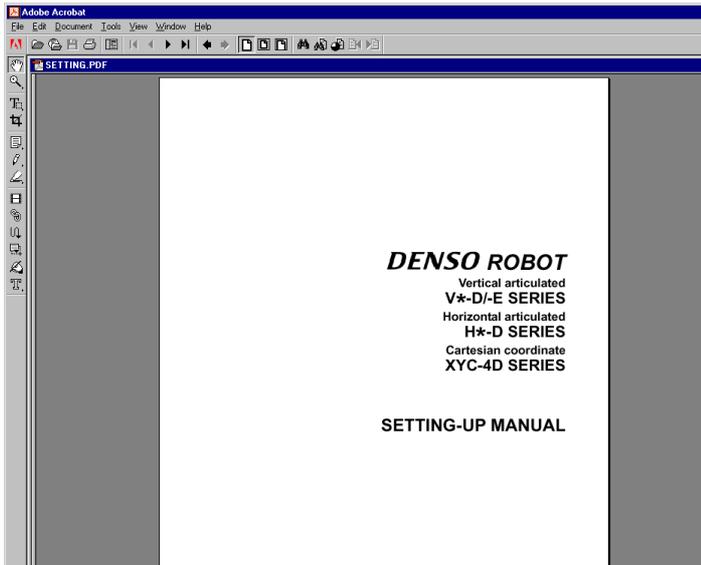

The SETTING-UP MANUAL is opened.

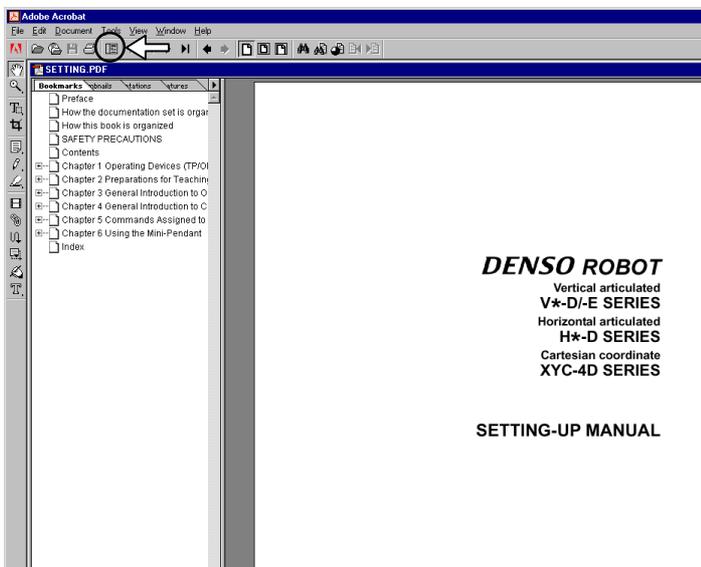


These manuals are all PDF files. As with previous versions of electronic manuals, you can select from "Bookmarks," "Contents" or "Index." (You can also select "Commands List" in the Programmer's Manuals.)

■ **Bookmarks**

Click on  on the tool bar to call up the list of bookmarked items.


Click on the desired item in this list to display the corresponding page.

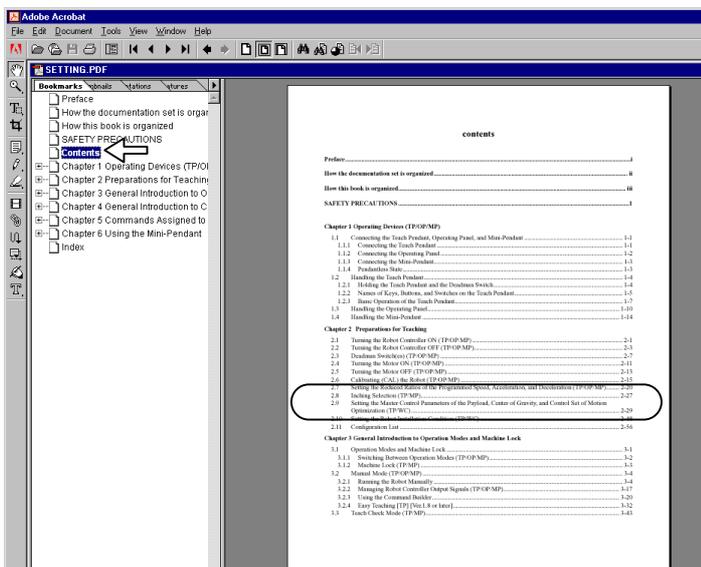

■ **Contents**

Click on **Contents** in the list of book-marked items.


In the table of contents, place the arrow pointer over the page you want to view (the arrow pointer will change to a finger pointer over pages which have an active link) and click to open that page.

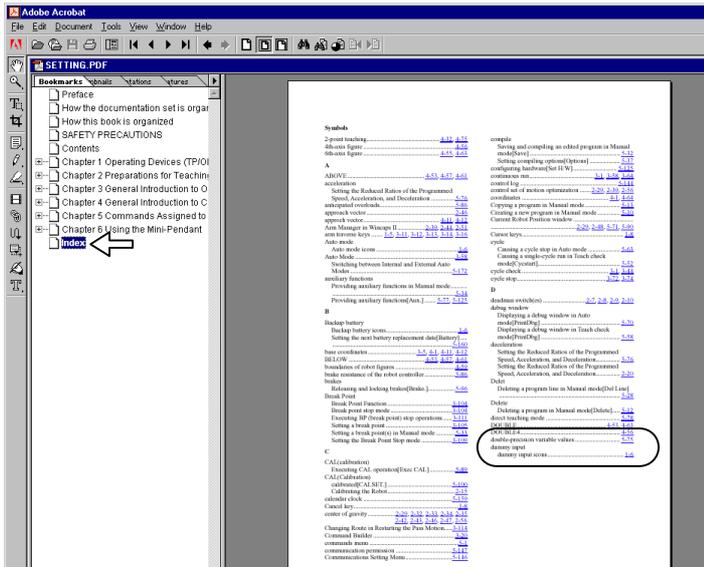

## Index

Click on **Index** in the list of bookmarked items to open the index page.

In the index page, place the arrow pointer over the page you want to view (the arrow pointer will change to a finger pointer over pages which have an active link) and click to open that page.

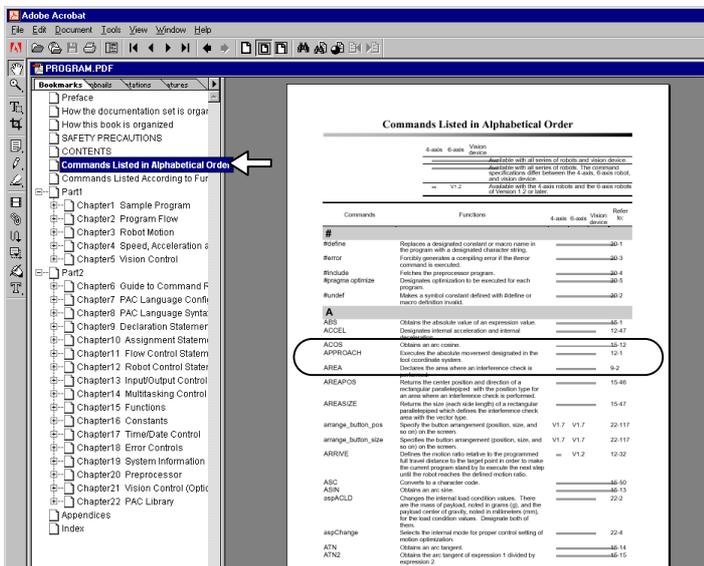

## Command List

Two types of command lists are provided in the Programmer's Manuals.

Click on **Commands Listed in Alphabetical Order** or **Commands Listed According to Functions** in the list of bookmarked items to display the corresponding list.

Place the arrow pointer over the page containing the command you want to view (the arrow pointer will change to a finger pointer over pages which have an active link) and click to open that page.

## 2. Performing a keyword search



In previous versions of electronic manuals, searches were limited to one manual at a time. In this new manual pack CD, however, it is possible to select the scope of the search. In other words you can set the scope to meet your needs, such as "Search manuals related to the selected robot series," "Search all manuals related to the horizontal (vertical) articulated robot series" and "Search all manuals included on the manual pack CD."



(1) Click on **Keyword**.




(2) Select the scope of the search.

If the search to be performed is going to be "Search all manuals included on the manual pack CD," for example, click on **Owner's Manuals**.

If it is going to be "Search manuals related to the horizontal articulated robot series," for example, click on **H\*-D/-E**.

If it is going to be "Search manuals related to the selected robot series," for example, click on **HS-E**.

In this example, click on **Owner's Manuals**.

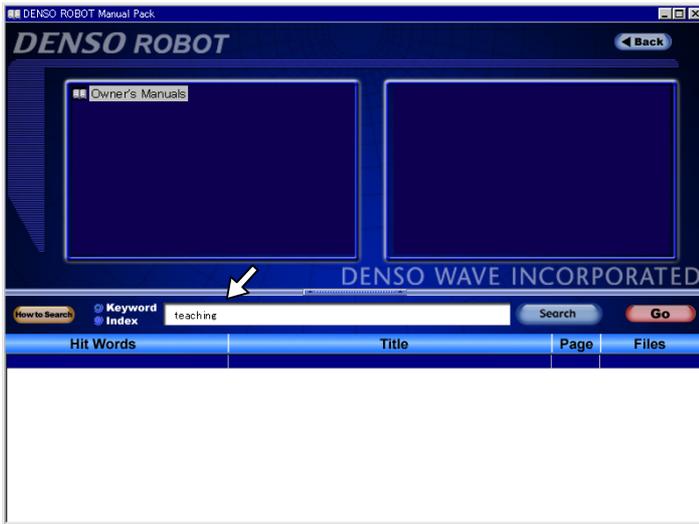

(3) Type the keyword for the search. This time, type "teaching."



If, for example, it is going to be an AND search and you want to include "teaching" and "connections," enter the two words separated by a space.



It is also possible to use wildcards. If you type "\*pendant," for example, both mini pendant and teaching pendant will be included in the search.



(4) Click on the **Search** button or press the Enter key.

All hit words will display, followed by titles, pages, and file names that contain those hit words.




If there are so many hit words that do not fit inside the current search window, click on the separator bar. The search window will be enlarged to its maximum size. (You may drag the separator bar to adjust the search window to the desired size.)

Clicking the separator bar again will return the enlarged window to its previous size.


You may also scroll through all hit words with the vertical scroll bar.



Scroll bar

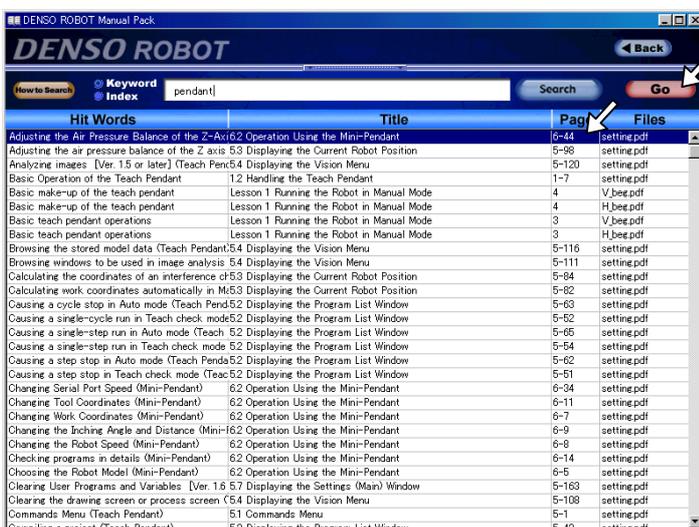

(5) Select the item you want to view and click on the **Go** button or double-click on the highlighted line itself.

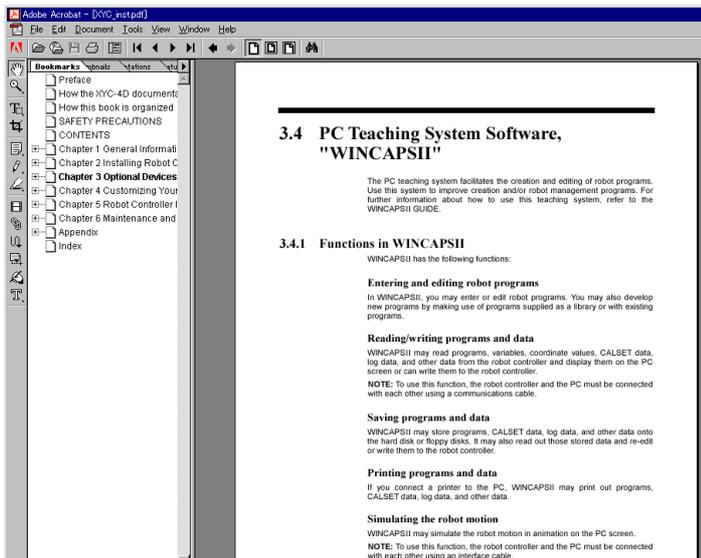

The page containing the specified keyword is opened.

### 3. Using the Index



In previous versions of electronic manuals, the index was simply a list of the vocabulary found in the manual which was attached to the end. In this new manual pack CD, the index can be included as the scope of the search in the same way as a keyword. You can select the type of index to be viewed to meet your needs, such as "Indexes of manuals related to the selected robot series," "Indexes of all manuals related to the horizontal (vertical) articulated robot series" and "Indexes of all manuals included on the manual pack CD."



(1) Click on **Index**.



(2) Select the type of the index(es).

If you want to view "Indexes of all manuals included on the manual pack CD," for example, click on **Owner's Manuals**.

If you want to view "Indexes of manuals related to the horizontal articulated robot series," for example, click on **H\*-D/-E**.

If you want to view "Indexes of manuals related to the selected robot series," for example, click on **HS-E**.

In this example, click on **Owner's Manuals**.



- (3) Type a single letter to choose the part of the index(es) you want to view. In this example, type "w."



It is also possible to search within the index(es) you want to view. For example, within the "w" part of the index(es), it is possible to further define your search to view items which also include "command" by inputting "w" and "command" separated by a space. In this example, the page containing "WAIT Command" will be displayed.



- (4) Click on the **Search** button.


In this example, all hit words starting with "w" in the index(es) selected will be displayed, followed by titles, pages, and file names that contain those hit words.




If there are so many hit words that do not fit inside the current search window, click on the separator bar. The search window will be enlarged to its maximum size. (You may drag the separator bar to adjust the search window to the desired size.)

Clicking the separator bar again will return the enlarged window to its previous size.

You may also scroll through all hit words with the vertical scroll bar.

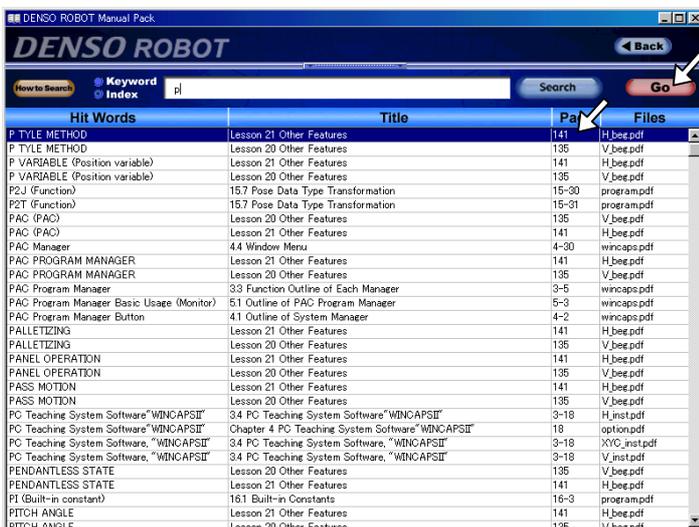

- (5) Select the item you want to view and click on the **Go** button or double-click on the highlighted line itself.

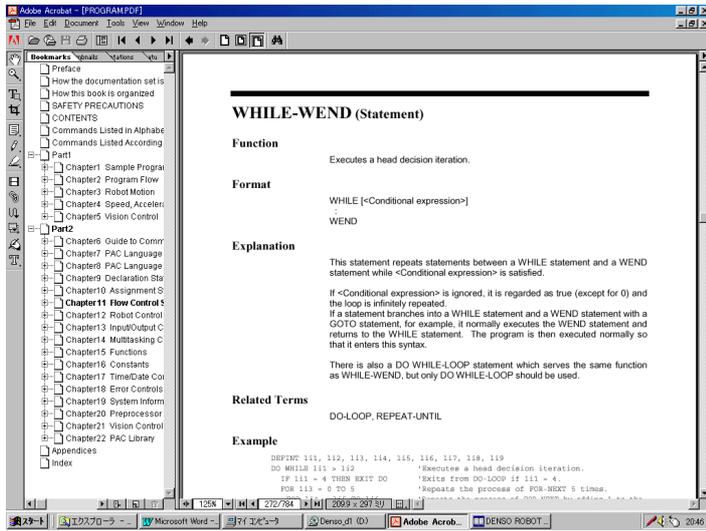

The page containing the word you want to view, which was searched from the index(es), is opened.

# Index

## A

Air piping..... [29](#), [93](#)

## C

Configuration of the Robot System ..... [4](#)

Configurators ..... [4](#)

Controller Setting Table..... [101](#)

## E

end-effector..... [31](#), [95](#)

## H

Hand ..... [31](#), [95](#)

## I

Items Not Covered ..... [104](#)

## M

maximum speed limit ..... [27](#), [28](#), [91](#), [92](#)

Moment-of-inertia Formulas..... [33](#), [97](#)

## O

Optional Components ..... [2](#)

overshoots ..... [17](#), [42](#)

## P

Packing List ..... [1](#)

Positioning Time ..... [17](#), [42](#)

## S

signal wiring ..... [29](#), [93](#)

Specifications..... [9](#), [98](#)

Standard Components ..... [1](#)

## V

vibration dampening time ..... [17](#), [42](#)

## W

Warranty..... [104](#)

Warranty Coverage ..... [104](#)

Warranty Period ..... [104](#)

Workable Space ..... [11](#), [38](#)



# **Horizontal Articulated Robot**

## **H\*-E SERIES**

---

### **GENERAL INFORMATION ABOUT ROBOT**

First Edition	February 2002
Second Edition	May 2002
Third Edition	July 2002
Fourth Edition	September 2002
Fifth Edition	November 2002
Sixth Edition	May 2003
Seventh Edition	February 2004

DENSO WAVE INCORPORATED  
Factory Automation Division

2F\*\*C

---

The purpose of this manual is to provide accurate information in the handling and operating of the robot. Please feel free to send your comments regarding any errors or omissions you may have found, or any suggestions you may have for generally improving the manual.

In no event will DENSO WAVE INCORPORATED be liable for any direct or indirect damages resulting from the application of the information in this manual.

